County of Fresno

Main Annex Jail
ADA Transition Plan

Prepared by:

LARS ANDERSEN & ASSOCIATES, INC.

CIVIL ENGINEERS • LAND SURVEYORS • PLANNERS • LEED ACCREDITED
ACCESS COMPLIANCE • STORM WATER QUALITY

4694 W JACQUELYN AVENUE
FRESNO, CA 93722
PH (559) 276-2790 FX (559) 276-0850

JUNE 30, 2014

Part 1: Introduction and Purpose

1.1 OVERVIEW OF THE ADA

The Americans with Disabilities Act (ADA) was enacted on July 26, 1990 to provide comprehensive civil rights protection to persons with disabilities in the areas of employment, state and local government services, access to public accommodations, transportation and telecommunications. The Act applies to all facilities, including both facilities built before and after 1990. On Friday, July 23, 2010, Attorney General Eric Holder signed final regulations revising the Department's ADA regulations, including its ADA Standards for Accessible Design. The official text was published in the Federal Register on September 15, 2010 (corrections to this text were published in the Federal Register on March 11, 2011).

The revised regulations amend the Department's 1991 title II regulation (State and local governments), 28 CFR Part 35, and the 1991 title III regulation (public accommodations), 28 CFR Part 36. Appendix A to each regulation includes a section-by-section analysis of the rule and responses to public comments on the proposed rule.

These final rules went into effect on March 15, 2011, and were published in the 2011 edition of the Code of Federal Regulations (CFR).

As a necessary step to a program access plan to provide accessibility under the ADA, state and local government, public entities or agencies are required to perform self-evaluations of their current facilities, relative the accessibility requirements of the ADA. The ADA provides that qualified persons with disabilities shall not be excluded from participation in, denied the benefit of, or be subjected to discrimination under any program or activity. The ADA is divided into five parts, covering the following areas:

Title I: EMPLOYMENT

Under this Title, employers, including governmental agencies, must ensure that their practices do not discriminate against persons with disabilities in the application, hiring, advancement, training, compensation, or discharge of an employee, or in other terms, conditions, and rights of employment.

Title II: PUBLIC SERVICES

This Title prohibits state and local governments from discriminating against persons with disabilities or from excluding participation in or denying benefits of programs, services, or activities to persons with disabilities. A self-evaluation is to be prepared. This self-evaluation is intended to outline physical barriers of the Fresno County Jail and to evaluate what cost or

corrections to effect the non-discrimination policies described in Title II. The public entity must than proceed to make the changes necessary to comply with the provisions of the ADA.

Title III: PUBLIC ACCOMMODATIONS

This Title requires places of public accommodation to be accessible to and usable by persons with disabilities.

Title IV: TELECOMMUNICATIONS

This Title requires common carriers offering telephone services to the public to increase the availability of interstate and intrastate telecommunications relay services to individuals with hearing and speech impairments.

Title V: MISCELLANEOUS PROVISIONS

Title V contains several miscellaneous regulations, including construction standards and practices, provisions for attorney's fees, and technical assistance provisions.

In the ADA, the term "disability" means, with respect to an individual:

1. A physical or mental impairment that substantially limits one or more of the major life activities of such individual;
2. A record of such impairment; or
3. Being regarded as having such impairment.

If an individual meets any of these three tests, he or she is considered to be an individual with a disability for purposes of coverage under the ADA.

1.2 FRESNO COUNTY RESPONSIBILITIES UNDER THE ADA

The ADA specifically states intent not to apply lesser standards than are required under other federal, state, or local laws. The law which is most stringent has precedence. This intent has particular application with respect to the Fresno County Jail obligations under Section 504 of the Rehabilitation Act of 1973 or under Title 24 of the California Code of Regulations, which, in some cases, exceed ADA requirements with respect to structural and physical changes.

Title II mandates that public entities, including public Fresno County Jail districts, may not require eligibility criteria for participation in programs and activities that would screen persons with disabilities, unless it can be proven that such requirements are necessary for the mandatory provision of the service or program. A public entity must reasonably modify its

policies and procedures to avoid discrimination toward individuals with disabilities. However, if the public entity can demonstrate that a modification would fundamentally alter the nature of its service, it would not be required to make that modification.

The lone exception to these requirements would be because of undue hardship. "Undue hardship" is defined in the ADA as an "action requiring significant difficulty or expense" when considering the nature and cost of the accommodation in relation to the size, resources and structure of the specific operation. Undue hardship is determined on a case-by-case basis.

The County is required to perform a self-evaluation to identify discriminatory practices and conditions in its programs and services along with a transition plan which outlines the structural modifications it will implement to make its programs and services accessible to people with disabilities.

1.3 COMPLIANCE, NOTICES, AND GRIEVANCE PROCEDURES

The public entity is required to make available to interested parties the self-evaluation and its applicability to services, programs and activities of the entity. A public entity is also required to provide an opportunity for interested persons, including individuals with disabilities or organizations representing individuals with disabilities, to participate in the development of the self-evaluation by submitting comments and specific recommendations. A copy of the draft self-evaluation shall be made available for public inspection during a formal citizen review period.

A public entity that employs more than 50 people is required by the ADA to adopt and publish grievance procedures providing for prompt and equitable resolution of complaints alleging any action that would be prohibited by Title II. Each complaint must be evaluated on a case-by-case basis.

The Fresno County Jail compliance and grievance procedures are described in the separate ADA self-evaluation. The ADA coordinator for resolving grievances and implementing this transition plan is:

Lieutenant Michael Porter
Jail and Program Services
1225 M Street
Fresno, CA 93721
559-600-8444

Sergeant Betty Moreno
Jail and Program Services
1225 M Street
Fresno, CA 93721
559-600-8455

1.4 PUBLIC PROCESS AND INPUT

The transition plan must be formally adopted by the Fresno County Governing Board. The County shall hold a public hearing to gather input on this transition plan, and shall make the document available to the public to allow submission of written comments. All comments must be addressed prior to adoption of the plan. Adoption of the plan commits the County Jail to the barrier removal and modernization projects described in the transition plan, according to the schedule given. Any changes to the plan must be considered with the same standard of public input.

1.5 RELATIONSHIP OF SELF-EVALUATION & TRANSITION PLAN

The self-evaluation and transition plan are considered to be interdependent documents. The self-evaluation describes Fresno County Jail programs and how they will be made accessible. The transition plan describes the structural modifications that will be made to meet the self-evaluation commitments. Information contained in the two documents provides all information regarding Title II compliance.

1.6 TRANSITION PLAN REQUIREMENTS

A transition plan is required when alterations must be made to facilities to provide program access. The transition plan documents architectural barriers at the facilities where programs take place. It provides a description of structural modifications that are necessary along with a timeline for completion of the work.

1.7 DESCRIPTION OF FACILITY ACCESSIBILITY

Determination that a facility or a portion thereof, is accessible is based on the standards of the Americans with Disabilities Act Accessibility Guidelines (ADAAG), and the criteria established by this document. It is not required that all facilities, or facility areas, be accessible to meet the program compliance requirement of the ADA. The transition plan provides the scoping requirements in place of those provided by the ADA and the ADAAG for new construction and remodeling.

The ADAAG sets standards for accessibility of specific elements, and establishes "scoping" requirements for new construction and remodeling. "Scoping" determines which elements need to be accessible for a given type of work. The transition plan establishes the scoping or Fresno County Jail facility accessibility criteria. These criteria delineate the standards that will be used in determining accessibility of an entire facility by referencing specific facility elements. The criteria will be used for existing facilities where new construction or alterations are not otherwise being contemplated.

Where the Fresno County Jail undertakes new construction or modernization not restricted to accessibility work, modifications to upgrade accessibility features may be required that are not proposed in this transition plan. Such work may also be triggered by the applicable state or local building codes and this work is separate from the program access requirement addressed by the self-evaluation and transition plan.

1.8 TRANSITION PLAN PRIORITIES

One of the most important aspects of preparing a transition plan is assigning priorities to structural modifications necessary to achieve program access. Obviously, the highest priority items should be undertaken first, and the schedule is dependent on these determinations.

The assignment of priorities is a process that must provide input and recommendations from the local disability community. Therefore, the public review period is a critical component, and priorities and schedules proposed in the draft plan are subject to review by local groups representing persons with disabilities.

1. Prioritization of individual facilities:

   One of the major determinants for this prioritization involves an analysis of the Fresno County Jail programs and services offered at each facility. Other factors, such as the number of inmates, and type of programs offered also weigh in these determinations.

   The criteria is based upon (1) the relative importance of the programs and services offered at the facility, (2) the amount and extent of work proposed by the facility, and (3) whether accessibility-related or other modifications are already planned for the facility.

2. Prioritization of barriers and their removal within each individual facility:

   High priority (Level 1) items would generally include those that affect the primary accessibility of a facility, that is, conditions that would generally make a facility unusable for a broad spectrum of persons with disabilities. Medium priority (Level 2) items would generally include items that adversely affect the “quality” of usage of a facility for persons with disabilities, as afforded to non-disabled persons. Low priority (Level 3) would generally include items that might represent a small deviation from applicable codes and standards, or items where alternative means of usage are possibly available.

Such prioritization is intended to reflect the desires of the County and the local disability community in establishing which improvements should be undertaken first, or given priority in a phased implementation.

1.9 MAINTENANCE OF ACCESSIBLE FEATURES

Under Title II regulations of the ADA, County Facilities must maintain in working condition those features of facilities and equipment that are required to be readily accessible to and usable by persons with disabilities. Inoperable elevators or wheelchair lifts, locked accessible doors, or accessible routes that are obstructed by furniture, filing cabinets, or potted plants are neither "accessible to" nor "usable by" individuals with disabilities.

It should be noted that ADA requirements regarding maintenance of accessible features do not prohibit temporary obstructions or isolated instances of mechanical failure that do not persist beyond a reasonable period of time.

The County should maintain a system of monitoring standard accessibility improvements at all sites to assure continued compliance with ADA requirements.

While physical access items should be reviewed and monitored at a general level by the ADA Coordinator and the ADA Management Committee, detailed monitoring of such items should be delegated to the County's Department of Plant Operations who are ultimately responsible to oversee accessibility-related items at each County site, train personnel on how to keep systems in working order, and resolve details of potential or reported problems.

Maintenance of accessible features and specific conditions that should be maintained to provide physical accessibility include, but are not limited to, the following:

1. Maintain exterior pathways and repair any surface irregularity that may become greater than ½" due to wear or cracking, and make other repairs to keep pathways from causing hazardous conditions.
2. Maintain disabled parking spaces to have all appropriate signage and to keep access aisles to the spaces and to the main entrances they serve clear and usable.
3. Maintain and replace as required all building signage that would direct persons with disabilities to the accessible paths of travel.
4. Maintain all doors providing primary accessibility to be fully operable and unlocked during normal hours of operation of the facility.
5. Maintain all door pressures required to open doors to be as low as possible, but in no case more than 8.5 pounds for exterior doors and 5 pounds for interior doors.
6. Maintain all elevators in proper working condition. Set up and monitor yearly maintenance inspections by contracted elevator maintenance companies and State Elevator Safety Unit for all elevators.
7. Maintain all wheelchair lifts in proper working condition, with keys prominently displayed at facility main offices. Set up and monitor yearly maintenance inspections by contracted lift maintenance companies and State Elevator Safety Unit for all lifts.
8. Maintain and monitor objects mounted on walls to protrude no more than 4" into paths of travel.
9. Maintain audible and visual fire alarms and pull stations to be fully operational.

10. Maintain all accessible plumbing features, including toilets, urinals, lavatories, sinks, faucets, showers, and drinking fountains, to be fully operational and in compliance with accessibility codes.
11. Maintain all toilet accessories to be fully operational and mounted no more than 40" above the floor at all accessible restrooms. Maintain all grab bars to be tight and structurally sound.

Additional information on maintenance of accessible features is included as recommended policies and procedures within the ADA self-evaluation.

Part 2: Facilities Compliance Plan

2.1 BACKGROUND

The Facilities Compliance Plan establishes the facility modernization work necessary to achieve County Jail Facility- structural access, as described in the self-evaluation.

Part 2 details the process and rationale of designating each facility into one of three categories, which denote the level of accessibility to be obtained. Facility elements are also broken down by three priorities. The priorities establish the specific work to be accomplished depending on the category of the facility. The result is a list of items for modernization at each facility category.

2.5 DEFINITION OF FACILITY ELEMENTS

Facility data and proposed accessibility improvements are separated into 3 Jail facility elements. These elements are used within the transition plan database to help organize the survey data for each facility, and are used in discussing proposed work in the Facilities Compliance Plan, Part 2 of the transition plan. Numbers for elements are assigned in order of the way a person arriving at a site will experience the accessibility elements. These elements are defined below.

1. General Site Information—Programs that were identified in connection with surveys. The programs have been included in the self-evaluation program list, and appear in the detailed facility reports, but are not otherwise addressed in the transition plan.
2. Passenger Loading Zone—One or more sections of curb are located at each facility for passenger loading, usually the bus zone on the street nearest the main entrance. Passenger loading zones are usually located on City property and may not be under the control of the Fresno County Jail.
3. Parking—One or more areas of a site specifically and exclusively identified for parking.
4. Curb Ramps and Crosswalks—Ramps to access sidewalks and street crossings, primarily along the public way (City Property), though may include on-site sidewalks and driveway crossings.
5. Path of Travel—Pedestrian routes from the public way through the site to each element. This element includes protruding object hazards, elements accessed by stairs only, hallway lockers, broken pavement or other irregularities that may create barriers and/or hazards.
6. Ramps—Any sloped pathway exceeding 5% grade (I inch rise in 20 inches run).
7. Stairs—Sets of steps connecting floors or levels.
8. Elevators—Enclosed vertical conveyance between floors or levels.
9. Doors—Interior or exterior doors serving public rooms or circulation areas.
10. Restroom—Adult and student restrooms are separated for Fresno County Jail facilities. Cat walks, and observations towers or booths are not included in the survey data, though should be made accessible when necessary to serve a specific area as required by this transition plan.
11. Drinking Fountains—Drinking fountains along primary paths of travel.
12. Telephone—Pay phones and office phones available for public use.
13. Offices—The main Fresno County Jail office where visitors are required to check in, as well as other offices serving the site.
14. Assembly Areas—multi-purpose rooms, cafeterias, gymnasiums, and other areas used for assembly.
15. Library—The room or area used for bookshelves, card catalogs, computer.

16. Locker Rooms—Areas associated with dressing, includes showers.
17. Playground/Outdoor Sports—Outdoor facilities for recreation activities.
18. Communication—Directional and identification signage, and assistive listening systems.
19. Warning & Alarm—Visual and audible alarm systems.
20. Areas of Rescue Assistance—Safe areas used in conjunction with the facilities emergency evacuation plan.

2.6 PRIORITIZATION OF FACILITY ELEMENTS

Barriers under each facility element are characterized as Priority 1, 2, or 3. Priorities are used to establish consistent levels of accessibility to allow facility comparison. The numeric designation does not necessarily establish a level of importance relative to other work. The prioritization of facility elements should not be interpreted to mean that some work is more important than other work without regard to the facility. All work is equally important at Category 1 sites because it is determined that these facilities should be fully accessible to meet ADA Title II requirements.

High Priority (Priority 1) items would generally include those that affect the primary accessibility of a facility, that is, conditions that would generally make a facility unusable for a broad spectrum of persons with disabilities. Medium Priority (Priority 2) items would generally include items that adversely affect the "quality" of usage of a facility for persons with disabilities, as afforded to non-disabled persons. Low Priority (Priority 3) items would generally include items that might represent a small deviation from applicable codes and standards, or items where alternative means of usage are possibly available.

Priority 1 work will be completed for all facilities, and sets a minimum level of accessibility for all facilities. Completion of Priority 1 work will ensure that a person with a disability can get into the facility and to the main office in order to conduct business with the Fresno County Jail or the Fresno County Jail. Priority 1 work includes upgrades to provide a minimum level of accessibility for facility users.

Priority 2 work will be completed at Category 1 and 2 facilities, and will achieve a high degree of accessibility insuring that all programs at those facilities can be provided in at least one accessible location. Completion of Priority 2 work is essential to providing a reasonable level of access to Fresno County Jail programs. The intention is that completion of Priority 2 work will provide at least one accessible area for each program offered at the site.

Priority 3 items will be completed only at Category 1 facilities under the transition plan. Completion of Priority 3 items will provide full facility access, ensuring that all programs at all of these locations are fully accessible.

It should be noted that the priorities established herein supersede priorities that appear with the survey data in the individual detailed facility reports, where different. The priorities set here are for this transition plan only. Modernization work not related to this transition plan may trigger a requirement to complete access work on a different schedule, or to complete work not scheduled in the transition plan.

2.7 REQUIRED WORK BY PRIORITY

This section identifies which elements are required to be accessible for each priority. The standard for accessibility for each element shall be the most restrictive of the California Building Code, or the ADA Accessibility Guidelines. This section provides the transition plan "scoping" requirements, which are found in the codes for new construction and remodeling.

1. General and Programmatic Data: This category includes data related to the general usage or specific programs at a particular facility. These may affect the application of other priorities described in other categories. (PROGRAMMING WAS NOT EVALUATED WITH THIS REPORT)

2. Path of Travel:

   An accessible route should connect the public sidewalk and parking areas with all public elements of the building. An accessible route must have a hard-paved surface with any change in level more than ½" served by a ramp.

   Priority 1;

   - Primary accessible route connecting public way, accessible parking, main accessible entrance, main office, and public assembly area
   - Hazardous pathways, such as broken or uneven pavement, grates with slots greater than 1", abrupt changes in level
   - Hazardous protruding objects, extending more than 4" into the path of travel

   Priority 2:

   - Accessible path to facility main entrance
   - Primary routes connecting common use rooms, and at correction
   - Grates with wider than ½" slots
   - Other protruding objects not in the main pedestrian route

   Priority 3:

   - Secondary routes connecting alternate entrances or access routes and all facilities and offices

MAIN JAIL COST SUMMARY

Item	Description	Cost
*1	Master Signage Plan throughout Main Annex Jail building. (119 Issues)	$20,000
*2	Doors throughout the building, doors require over 5 Lbs of force to open. (50 Doors)	$10,000
*3	Restrooms that technically infeasible to upgrade. The Master signage program should incorporate signage to the nearest accessible restroom and sign these restroom appropriately.	NA
*4	Alarm system throughout the facility is not provided as required by code. (18 Issues)	$500,000
*5	TTY (53 Issues)	$50,000
*6	Call button and/or Light switch is over the maximum 48” allowed per code. (114 Issues)	$80,000
*7	Showers located at PODS A-F on floors 3-6 where calculated as a single item. There are six (6) PODS per floor and four (4) floors where these types of PODS were present. The calculated cost per shower was $15,000 with a total of 24 showers.	$360,000
*8	Dining tables located at PODS A-F on floors 3-6 where calculated as a single item. There are six (6) PODS per floor and four (4) floors where this type of sitting area was present. Re-arranging the tables to provide an access through the dining area was taken in account as well. The Calculated cost for the dining area was $20,000 per POD.	$480,000
*9	The Cell within the PODS was taken as a single cost, making the cell completely accessible. The cost per Cell will be of $100,000. There are six (6) PODS per floor and four (4) floors.	$2,400,000
*10	Isolation Cell findings were calculated to a single cost item. To provide an accessible cell the cost will be $100,000 per cell, one cell per floor will be accessible.	$400,000
*11	Shower for the Isolation Cell block will require $15,000 to make it completely accessible. There is one (1) shower per floor.	$60,000
*12	Vending machines at the staff break/dining area.	$20,000
*13	Cells on the second floor – it was calculated that it will take $30,000 to completely make each of the 16 Cells accessible.	$480,000
	Sum of priority 1 Items	$1.013,700
	Sum of priority 2 Items	$294,700
	Sum of priority 3 Items	$266,500
	Sum of priority 4 Items	$121,500
	TOTAL	$6,556,400

Main Jail				Basement				Priority :	1
ID:	7	Location:	B - 2	Floor:	Basement	Cost:	$6,000	Duration:	18 hrs
ID:	8	Location:	B - 2	Floor:	Basement	Cost:	See *1	Duration:	See *1
ID:	9	Location:	B - 2	Floor:	Basement	Cost:	See *1	Duration:	See *1
ID:	17	Location:	B - 2	Floor:	Basement	Cost:	$500	Duration:	1 hr
ID:	18	Location:	B - 3	Floor:	Basement	Cost:	$4,000	Duration:	20 hrs
ID:	22	Location:	B - 4	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
ID:	23	Location:	B - 4	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
ID:	24	Location:	B - 4	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
ID:	25	Location:	B - 4	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
ID:	26	Location:	B - 5	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
ID:	27	Location:	B - 5	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
ID:	28	Location:	B - 5	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
ID:	29	Location:	B - 5	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
ID:	30	Location:	B - 5	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
ID:	31	Location:	B - 5	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
Main Jail				First Floor				Priority :	1
ID:	33	Location:	1 - 1	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	34	Location:	1 - 1	Floor:	1st	Cost:	See *2	Duration:	See *2
ID:	35	Location:	1 - 1	Floor:	1st	Cost:	$500	Duration:	1 hr
ID:	43	Location:	1 - 1	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	44	Location:	1 - 1	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	45	Location:	1 - 1	Floor:	1st	Cost:	$500	Duration:	1 hr
ID:	55	Location:	1 - 1	Floor:	1st	Cost:	$1,000	Duration:	4 hrs
ID:	61	Location:	1 - 2	Floor:	1st	Cost:	$500	Duration:	1 hr
ID:	62	Location:	1 - 2	Floor:	1st	Cost:	See *2	Duration:	See *2
ID:	65	Location:	1 - 3	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	66	Location:	1 - 4	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	67	Location:	1 - 4	Floor:	1st	Cost:	See *2	Duration:	See *2
ID:	68	Location:	1 - 11	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	73	Location:	1 - 5	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
ID:	78	Location:	1 - 5	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	80	Location:	1 - 7	Floor:	1st	Cost:	$5,000	Duration:	30 hrs
ID:	86	Location:	1 - 7	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
ID:	91	Location:	1 - 9	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	92	Location:	1 - 9	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
ID:	104	Location:	1 - 10	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	105	Location:	1 - 11	Floor:	1st	Cost:	$200	Duration:	2 hrs
ID:	110	Location:	1 - 11	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	111	Location:	1 - 11	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	117	Location:	1 - 13	Floor:	1st	Cost:	See *2	Duration:	See *2
ID:	118	Location:	1 - 13	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	119	Location:	1 - 13	Floor:	1st	Cost:	See *2	Duration:	See *2
ID:	124	Location:	1 - 15	Floor:	1st	Cost:	$6,000	Duration:	20 hrs
ID:	125	Location:	1 - 15	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	139	Location:	1 - 15	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	140	Location:	1 - 15	Floor:	1st	Cost:	$6,000	Duration:	20 hrs
ID:	158	Location:	1 - 16	Floor:	1st	Cost:	See *2	Duration:	See *2
ID:	159	Location:	1 - 16	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	160	Location:	1 - 16	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	173	Location:	1 - 17	Floor:	1st	Cost:	$2,000	Duration:	8 hrs

ID:	174	Location:	1 - 17	Floor:	1st	Cost:	$2,000	Duration:	8 hrs
ID:	175	Location:	1 - 18	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	176	Location:	1 - 18	Floor:	1st	Cost:	See *2	Duration:	See *2
ID:	177	Location:	1 - 18	Floor:	1st	Cost:	$200	Duration:	2 hrs
ID:	179	Location:	1 - 19	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	180	Location:	1 - 19	Floor:	1st	Cost:	See *2	Duration:	See *2
ID:	191	Location:	1 - 19	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	202	Location:	1 - 20	Floor:	1st	Cost:	$200	Duration:	2 hrs
ID:	204	Location:	1 - 20	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	205	Location:	1 - 21	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	206	Location:	1 - 21	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	211	Location:	1 - 24	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	212	Location:	1 - 24	Floor:	1st	Cost:	$6,000	Duration:	18 hrs
ID:	222	Location:	1 - 24	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	232	Location:	1 - 25	Floor:	1st	Cost:	$800	Duration:	See ID #278
ID:	233	Location:	1 - 26	Floor:	1st	Cost:	See *1	Duration:	See ID #330
ID:	234	Location:	1 - 26	Floor:	1st	Cost:	$500	Duration:	1 hr
ID:	235	Location:	1 - 27	Floor:	1st	Cost:	$6,000	Duration:	18 hrs
ID:	239	Location:	1 - 27	Floor:	1st	Cost:	$800	Duration:	4 hrs
ID:	245	Location:	1 - 27	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
ID:	246	Location:	1 - 28	Floor:	1st	Cost:	$5,000	Duration:	20 hrs
ID:	249	Location:	1 - 30	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	250	Location:	1 - 31	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	252	Location:	1 - 31	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
ID:	269	Location:	1 - 32	Floor:	1st	Cost:	$2,000	Duration:	8 hrs
ID:	270	Location:	1 - 32	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
ID:	274	Location:	1 - 33	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
ID:	281	Location:	1 - 34	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	282	Location:	1 - 34	Floor:	1st	Cost:	$6,000	Duration:	18 hrs
ID:	294	Location:	1 - 34	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	295	Location:	1 - 34	Floor:	1st	Cost:	$6,000	Duration:	18 hrs
ID:	312	Location:	1 - 37	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
ID:	320	Location:	1 - 37	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	321	Location:	1 - 37	Floor:	1st	Cost:	See *1	Duration:	See *1
ID:	322	Location:	1 - 37	Floor:	1st	Cost:	$6,000	Duration:	20 hrs
ID:	328	Location:	1 - 38	Floor:	1st	Cost:	$5,000	Duration:	30 hrs
ID:	329	Location:	1 - 38	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
ID:	334	Location:	1 - 39	Floor:	1st	Cost:	$5,000	Duration:	20 hrs
ID:	335	Location:	1 - 39	Floor:	1st	Cost:	$500	Duration:	1 hr

Main Jail				Second Floor				Priority :	1
ID:	337	Location:	2 - 1	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	344	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	345	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	358	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	359	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	364	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	365	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	383	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	384	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	395	Location:	2 - 5	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	396	Location:	2 - 5	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	400	Location:	2 - 6	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	401	Location:	2 - 6	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	404	Location:	2 - 6	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	403	Location:	2 - 7	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	405	Location:	2 - 7	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	406	Location:	2 - 7	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	408	Location:	2 - 7	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	409	Location:	2 - 7	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	411	Location:	2 - 8	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	412	Location:	2 - 8	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	414	Location:	2 - 8	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	415	Location:	2 - 9	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	417	Location:	2 - 10	Floor:	2nd	Cost:	$6,000	Duration:	18 hrs
ID:	429	Location:	2 - 10	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	433	Location:	2 - 10	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	434	Location:	2 - 10	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	435	Location:	2 - 10	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	436	Location:	2 - 11	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	447	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	448	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	454	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	455	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	481	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	489	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	490	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	496	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	501	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	509	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	510	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	532	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	539	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	540	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	547	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	549	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	555	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	557	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	563	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	571	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	573	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13

ID:	574	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	577	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	579	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	580	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	586	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	600	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	601	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	608	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	611	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	620	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	626	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	632	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	633	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	636	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	639	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	649	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	650	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	653	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	654	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	661	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	667	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	673	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	675	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	681	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	692	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	699	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	706	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	715	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	719	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	721	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	728	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	741	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	746	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	758	Location:	2 - 28	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	759	Location:	2 - 29	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	763	Location:	2 - 29	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	764	Location:	2 - 29	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	765	Location:	2 - 29	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	771	Location:	2 - 30	Floor:	2nd	Cost:	$800	Duration:	4 hrs
ID:	772	Location:	2 - 30	Floor:	2nd	Cost:	$5,000	Duration:	40 hrs
ID:	775	Location:	2 - 31	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	776	Location:	2 - 31	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	781	Location:	2 - 32	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	782	Location:	2 - 32	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	783	Location:	2 - 32	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	784	Location:	2 - 32	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	785	Location:	2 - 32	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	786	Location:	2 - 32	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	787	Location:	2 - 33	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	788	Location:	2 - 33	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	791	Location:	2 - 33	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	792	Location:	2 - 33	Floor:	2nd	Cost:	$200	Duration:	2 hrs

ID:	793	Location:	2 - 33	Floor:	2nd	Cost:	$6,000	Duration:	18 hrs
ID:	797	Location:	2 - 35	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	798	Location:	2 - 35	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	799	Location:	2 - 35	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	801	Location:	2 - 35	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	802	Location:	2 - 35	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	803	Location:	2 - 35	Floor:	2nd	Cost:	$1,000	Duration:	5 hrs
ID:	806	Location:	2 - 35	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	807	Location:	2 - 35	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	808	Location:	2 - 35	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	824	Location:	2 - 35	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	825	Location:	2 - 35	Floor:	2nd	Cost:	$300	Duration:	3 hrs
ID:	826	Location:	2 - 35	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	827	Location:	2 - 35	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	828	Location:	2 - 35	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	829	Location:	2 - 35	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	843	Location:	2 - 35	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	845	Location:	2 - 36	Floor:	2nd	Cost:	$6,000	Duration:	20 hrs
ID:	847	Location:	2 - 36	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	848	Location:	2 - 36	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	849	Location:	2 - 37	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	850	Location:	2 - 37	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	851	Location:	2 - 37	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	852	Location:	2 - 37	Floor:	2nd	Cost:	$5,000	Duration:	40 hrs
ID:	853	Location:	2 - 37	Floor:	2nd	Cost:	$800	Duration:	4 hrs
ID:	854	Location:	2 - 37	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	855	Location:	2 - 37	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	856	Location:	2 - 37	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	857	Location:	2 - 37	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	858	Location:	2 - 37	Floor:	2nd	Cost:	$6,000	Duration:	20 hrs
ID:	859	Location:	2 - 38	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	860	Location:	2 - 38	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	861	Location:	2 - 38	Floor:	2nd	Cost:	$2,000	Duration:	10 hrs
ID:	862	Location:	2 - 38	Floor:	2nd	Cost:	$2,000	Duration:	10 hrs
ID:	863	Location:	2 - 38	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	864	Location:	2 - 39	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	865	Location:	2 - 39	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	866	Location:	2 - 39	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	867	Location:	2 - 39	Floor:	2nd	Cost:	$6,000	Duration:	20 hrs
ID:	868	Location:	2 - 39	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	869	Location:	2 - 39	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	870	Location:	2 - 39	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	871	Location:	2 - 39	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	872	Location:	2 - 39	Floor:	2nd	Cost:	$6,000	Duration:	20 hrs
ID:	873	Location:	2 - 40	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	878	Location:	2 - 40	Floor:	2nd	Cost:	$6,000	Duration:	18 hrs
ID:	879	Location:	2 - 40	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	880	Location:	2 - 41	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	881	Location:	2 - 41	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	882	Location:	2 - 41	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	883	Location:	2 - 41	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	884	Location:	2 - 41	Floor:	2nd	Cost:	$200	Duration:	2 hrs

ID:	885	Location:	2 - 42	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	886	Location:	2 - 42	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	899	Location:	2 - 42	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	900	Location:	2 - 43	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	901	Location:	2 - 43	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	912	Location:	2 - 43	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	913	Location:	2 - 44	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	914	Location:	2 - 44	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	915	Location:	2 - 44	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	916	Location:	2 - 44	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	917	Location:	2 - 44	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	918	Location:	2 - 45	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	919	Location:	2 - 45	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	920	Location:	2 - 45	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	932	Location:	2 - 46	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	933	Location:	2 - 46	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	934	Location:	2 - 46	Floor:	2nd	Cost:	$6,000	Duration:	16 hrs
ID:	945	Location:	2 - 47	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	946	Location:	2 - 47	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	947	Location:	2 - 47	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	954	Location:	2 - 47	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	956	Location:	2 - 48	Floor:	2nd	Cost:	$5,000	Duration:	20 hrs
ID:	957	Location:	2 - 48	Floor:	2nd	Cost:	N/A	Duration:	N/A
ID:	958	Location:	2 - 48	Floor:	2nd	Cost:	$1,500	Duration:	2 hrs
ID:	959	Location:	2 - 49	Floor:	2nd	Cost:	See *1	Duration:	See *1
ID:	960	Location:	2 - 49	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	961	Location:	2 - 49	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	966	Location:	2 - 50	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	967	Location:	2 - 50	Floor:	2nd	Cost:	See *2	Duration:	See *2
ID:	968	Location:	2 - 50	Floor:	2nd	Cost:	$6,000	Duration:	20 hrs
ID:	969	Location:	2 - 50	Floor:	2nd	Cost:	See *1	Duration:	See *1

Main Jail				Third Floor				Priority :	1
ID:	970	Location:	3 - 1	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
ID:	973	Location:	3 - 2	Floor:	3rd	Cost:	$500	Duration:	1 hr
ID:	974	Location:	3 - 3	Floor:	3rd	Cost:	See *1	Duration:	See *1
ID:	988	Location:	3 - 5	Floor:	3rd	Cost:	See *11	Duration:	See *11
ID:	989	Location:	3 - 5	Floor:	3rd	Cost:	See *11	Duration:	See *11
ID:	999	Location:	3 - 4	Floor:	3rd	Cost:	See *10	Duration:	See *10
ID:	1000	Location:	3 - 6	Floor:	3rd	Cost:	$500	Duration:	1 hr
ID:	1001	Location:	3 - 6	Floor:	3rd	Cost:	See *1	Duration:	See *1
ID:	1002	Location:	3 - 7	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
ID:	1003	Location:	3 - 7	Floor:	3rd	Cost:	N/A	Duration:	N/A
ID:	1005	Location:	3 - 7	Floor:	3rd	Cost:	$2,000	Duration:	8 hrs
ID:	1006	Location:	3 - 8	Floor:	3rd	Cost:	See *2	Duration:	See *2
ID:	1020	Location:	3 - 8	Floor:	3rd	Cost:	See *1	Duration:	See *1
ID:	1022	Location:	3 - 9	Floor:	3rd	Cost:	See *1	Duration:	See *1
ID:	1023	Location:	3 - 10	Floor:	3rd	Cost:	See *1	Duration:	See *1
ID:	1024	Location:	3 - 10	Floor:	3rd	Cost:	$500	Duration:	1 hr
ID:	1027	Location:	3 - 11	Floor:	3rd	Cost:	$500	Duration:	1 hr
ID:	1028	Location:	3 - 11	Floor:	3rd	Cost:	See *1	Duration:	See *1
ID:	1034	Location:	3 - 14	Floor:	3rd	Cost:	See *1	Duration:	See *1
ID:	1035	Location:	3 - 14	Floor:	3rd	Cost:	$500	Duration:	1 hr
ID:	1036	Location:	3 - 14	Floor:	3rd	Cost:	See *2	Duration:	See *2
ID:	1038	Location:	3 - 14	Floor:	3rd	Cost:	$1,000	Duration:	5 hrs
ID:	1039	Location:	3 - 15	Floor:	3rd	Cost:	See *1	Duration:	See *1
ID:	1040	Location:	3 - 15	Floor:	3rd	Cost:	See *2	Duration:	See *2
ID:	1041	Location:	3 - 15	Floor:	3rd	Cost:	$500	Duration:	1 hr
ID:	1051	Location:	3 - 15	Floor:	3rd	Cost:	$6,000	Duration:	18 hrs
ID:	1052	Location:	3 - 15	Floor:	3rd	Cost:	See *1	Duration:	See *1
ID:	1053	Location:	3 - 15	Floor:	3rd	Cost:	See *1	Duration:	See *1
ID:	1073	Location:	3 - 17	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1074	Location:	3 - 17	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1076	Location:	3 - 17	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1077	Location:	3 - 17	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1078	Location:	3 - 17	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1079	Location:	3 - 17	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1080	Location:	3 - 17	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
ID:	1081	Location:	3 - 17	Floor:	3rd	Cost:	N/A	Duration:	N/A
ID:	1082	Location:	3 - 17	Floor:	3rd	Cost:	$6,000	Duration:	30 hrs
ID:	1083	Location:	3 - 17	Floor:	3rd	Cost:	$1,500	Duration:	2 hrs
ID:	1084	Location:	3 - 17	Floor:	3rd	Cost:	$10,000	Duration:	50 hrs
ID:	1088	Location:	3 - 17	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1094	Location:	3 - 17	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1096	Location:	3 - 18	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1097	Location:	3 - 18	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1098	Location:	3 - 18	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1099	Location:	3 - 18	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
ID:	1100	Location:	3 - 18	Floor:	3rd	Cost:	N/A	Duration:	N/A
ID:	1101	Location:	3 - 18	Floor:	3rd	Cost:	$1,500	Duration:	2 hrs
ID:	1102	Location:	3 - 18	Floor:	3rd	Cost:	$6,000	Duration:	30 hrs

ID:	1103	Location:	3 - 18	Floor:	3rd	Cost:	$10,000	Duration:	50 hrs
ID:	1105	Location:	3 - 18	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1107	Location:	3 - 18	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1115	Location:	3 - 18	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1121	Location:	3 - 18	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1127	Location:	3 - 18	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1129	Location:	3 - 19	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1130	Location:	3 - 19	Floor:	3rd	Cost:	$6,000	Duration:	30 hrs
ID:	1131	Location:	3 - 19	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
ID:	1132	Location:	3 - 19	Floor:	3rd	Cost:	N/A	Duration:	N/A
ID:	1133	Location:	3 - 19	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1134	Location:	3 - 19	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1135	Location:	3 - 19	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1137	Location:	3 - 19	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1146	Location:	3 - 19	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1151	Location:	3 - 19	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1159	Location:	3 - 19	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1161	Location:	3 - 20	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1164	Location:	3 - 20	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1165	Location:	3 - 20	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1166	Location:	3 - 20	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1171	Location:	3 - 20	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1177	Location:	3 - 20	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1186	Location:	3 - 20	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1188	Location:	3 - 20	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
ID:	1189	Location:	3 - 20	Floor:	3rd	Cost:	N/A	Duration:	N/A
ID:	1190	Location:	3 - 20	Floor:	3rd	Cost:	$6,000	Duration:	30 hrs
ID:	1191	Location:	3 - 20	Floor:	3rd	Cost:	$10,000	Duration:	50 hrs
ID:	1192	Location:	3 - 20	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1194	Location:	3 - 21	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1197	Location:	3 - 21	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1198	Location:	3 - 21	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1199	Location:	3 - 21	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1210	Location:	3 - 21	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
ID:	1211	Location:	3 - 21	Floor:	3rd	Cost:	N/A	Duration:	N/A
ID:	1212	Location:	3 - 21	Floor:	3rd	Cost:	$6,000	Duration:	30 hrs
ID:	1213	Location:	3 - 21	Floor:	3rd	Cost:	$10,000	Duration:	50 hrs
ID:	1214	Location:	3 - 21	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1223	Location:	3 - 21	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1225	Location:	3 - 21	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1227	Location:	3 - 22	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1229	Location:	3 - 22	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
ID:	1230	Location:	3 - 22	Floor:	3rd	Cost:	N/A	Duration:	N/A
ID:	1231	Location:	3 - 22	Floor:	3rd	Cost:	$6,000	Duration:	30 hrs
ID:	1232	Location:	3 - 22	Floor:	3rd	Cost:	$10,000	Duration:	50 hrs
ID:	1233	Location:	3 - 22	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1234	Location:	3 - 22	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1235	Location:	3 - 22	Floor:	3rd	Cost:	$500	Duration:	5 hrs
ID:	1237	Location:	3 - 22	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1240	Location:	3 - 22	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1247	Location:	3 - 22	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1257	Location:	3 - 22	Floor:	3rd	Cost:	See *9	Duration:	See *9

Main Jail				Fourth Floor				Priority :	1
ID:	1259	Location:	4 - 1	Floor:	4th	Cost:	See *10	Duration:	See *10
ID:	1272	Location:	4 - 1	Floor:	4th	Cost:	See *11	Duration:	See *11
ID:	1273	Location:	4 - 1	Floor:	4th	Cost:	See *11	Duration:	See *11
ID:	1285	Location:	4 - 2	Floor:	4th	Cost:	$2,000	Duration:	8 hrs
ID:	1286	Location:	4 - 3	Floor:	4th	Cost:	$5,000	Duration:	20 hrs
ID:	1288	Location:	4 - 3	Floor:	4th	Cost:	N/A	Duration:	N/A
ID:	1290	Location:	4 - 4	Floor:	4th	Cost:	$500	Duration:	1 hr
ID:	1291	Location:	4 - 4	Floor:	4th	Cost:	See *1	Duration:	See *1
ID:	1293	Location:	4 - 5	Floor:	4th	Cost:	See *2	Duration:	See *2
ID:	1294	Location:	4 - 5	Floor:	4th	Cost:	$500	Duration:	1 hr
ID:	1295	Location:	4 - 5	Floor:	4th	Cost:	See *1	Duration:	See *1
ID:	1296	Location:	4 - 6	Floor:	4th	Cost:	See *1	Duration:	See *1
ID:	1297	Location:	4 - 6	Floor:	4th	Cost:	$500	Duration:	1 hr
ID:	1299	Location:	4 - 7	Floor:	4th	Cost:	See *2	Duration:	See *2
ID:	1301	Location:	4 - 7	Floor:	4th	Cost:	$500	Duration:	1 hr
ID:	1302	Location:	4 - 7	Floor:	4th	Cost:	See *1	Duration:	See *1
ID:	1321	Location:	4 - 10	Floor:	4th	Cost:	See *2	Duration:	See *2
ID:	1322	Location:	4 - 10	Floor:	4th	Cost:	See *1	Duration:	See *1
ID:	1323	Location:	4 - 11	Floor:	4th	Cost:	See *1	Duration:	See *1
ID:	1324	Location:	4 - 11	Floor:	4th	Cost:	See *2	Duration:	See *2
ID:	1326	Location:	4 - 12	Floor:	4th	Cost:	$5,000	Duration:	20 hrs
ID:	1327	Location:	4 - 12	Floor:	4th	Cost:	N/A	Duration:	N/A
ID:	1329	Location:	4 - 13	Floor:	4th	Cost:	See *2	Duration:	See *2
ID:	1330	Location:	4 - 13	Floor:	4th	Cost:	$500	Duration:	1 hr
ID:	1332	Location:	4 - 13	Floor:	4th	Cost:	$1,000	Duration:	5 hrs
ID:	1333	Location:	4 - 13	Floor:	4th	Cost:	See *1	Duration:	See *1
ID:	1337	Location:	4 - 14	Floor:	4th	Cost:	See *1	Duration:	See *1
ID:	1339	Location:	4 - 14	Floor:	4th	Cost:	$6,000	Duration:	18 hrs
ID:	1346	Location:	4 - 14	Floor:	4th	Cost:	See *1	Duration:	See *1
ID:	1351	Location:	4 - 14	Floor:	4th	Cost:	See *2	Duration:	See *2
ID:	1352	Location:	4 - 14	Floor:	4th	Cost:	$500	Duration:	1 hr
ID:	1353	Location:	4 - 14	Floor:	4th	Cost:	See *1	Duration:	See *1
ID:	1354	Location:	4 - 14	Floor:	4th	Cost:	See *2	Duration:	See *2
ID:	1357	Location:	4 - 14	Floor:	4th	Cost:	See *1	Duration:	See *1
ID:	1364	Location:	4 - 17	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1365	Location:	4 - 17	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1366	Location:	4 - 17	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1367	Location:	4 - 17	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1372	Location:	4 - 17	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1379	Location:	4 - 17	Floor:	4th	Cost:	$5,000	Duration:	20 hrs
ID:	1380	Location:	4 - 17	Floor:	4th	Cost:	N/A	Duration:	N/A
ID:	1381	Location:	4 - 17	Floor:	4th	Cost:	$6,000	Duration:	30 hrs
ID:	1382	Location:	4 - 17	Floor:	4th	Cost:	$10,000	Duration:	50 hrs
ID:	1383	Location:	4 - 17	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1384	Location:	4 - 17	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1395	Location:	4 - 17	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1398	Location:	4 - 18	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1399	Location:	4 - 18	Floor:	4th	Cost:	$5,000	Duration:	20 hrs
ID:	1400	Location:	4 - 18	Floor:	4th	Cost:	N/A	Duration:	N/A
ID:	1401	Location:	4 - 18	Floor:	4th	Cost:	$6,000	Duration:	30 hrs

ID:	1402	Location:	4 - 18	Floor:	4th	Cost:	$10,000	Duration:	50 hrs
ID:	1404	Location:	4 - 18	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1405	Location:	4 - 18	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1406	Location:	4 - 18	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1410	Location:	4 - 18	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1418	Location:	4 - 18	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1419	Location:	4 - 18	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1428	Location:	4 - 18	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1431	Location:	4 - 19	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1432	Location:	4 - 19	Floor:	4th	Cost:	$5,000	Duration:	20 hrs
ID:	1433	Location:	4 - 19	Floor:	4th	Cost:	N/A	Duration:	N/A
ID:	1434	Location:	4 - 19	Floor:	4th	Cost:	$6,000	Duration:	30 hrs
ID:	1435	Location:	4 - 19	Floor:	4th	Cost:	$10,000	Duration:	50 hrs
ID:	1436	Location:	4 - 19	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1437	Location:	4 - 19	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1438	Location:	4 - 19	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1439	Location:	4 - 19	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1444	Location:	4 - 19	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1451	Location:	4 - 19	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1459	Location:	4 - 19	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1466	Location:	4 - 21	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1467	Location:	4 - 21	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1468	Location:	4 - 21	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1469	Location:	4 - 21	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1473	Location:	4 - 21	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1481	Location:	4 - 21	Floor:	4th	Cost:	$5,000	Duration:	20 hrs
ID:	1482	Location:	4 - 21	Floor:	4th	Cost:	N/A	Duration:	N/A
ID:	1483	Location:	4 - 21	Floor:	4th	Cost:	$1,500	Duration:	2 hrs
ID:	1484	Location:	4 - 21	Floor:	4th	Cost:	$6,000	Duration:	30 hrs
ID:	1485	Location:	4 - 21	Floor:	4th	Cost:	$10,000	Duration:	50 hrs
ID:	1486	Location:	4 - 21	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1495	Location:	4 - 21	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1497	Location:	4 - 21	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1499	Location:	4 - 22	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1502	Location:	4 - 22	Floor:	4th	Cost:	$5,000	Duration:	20 hrs
ID:	1503	Location:	4 - 22	Floor:	4th	Cost:	N/A	Duration:	N/A
ID:	1504	Location:	4 - 22	Floor:	4th	Cost:	$6,000	Duration:	30 hrs
ID:	1505	Location:	4 - 22	Floor:	4th	Cost:	$10,000	Duration:	50 hrs
ID:	1506	Location:	4 - 22	Floor:	4th	Cost:	$1,500	Duration:	2 hrs
ID:	1507	Location:	4 - 22	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1508	Location:	4 - 22	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1509	Location:	4 - 22	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1510	Location:	4 - 22	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1516	Location:	4 - 22	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1522	Location:	4 - 22	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1531	Location:	4 - 22	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1534	Location:	4 - 23	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1536	Location:	4 - 23	Floor:	4th	Cost:	$5,000	Duration:	20 hrs
ID:	1537	Location:	4 - 23	Floor:	4th	Cost:	N/A	Duration:	N/A
ID:	1538	Location:	4 - 23	Floor:	4th	Cost:	$1,500	Duration:	2 hrs
ID:	1539	Location:	4 - 23	Floor:	4th	Cost:	$6,000	Duration:	30 hrs
ID:	1540	Location:	4 - 23	Floor:	4th	Cost:	$10,000	Duration:	50 hrs

ID:	1541	Location:	4 - 23	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1542	Location:	4 - 23	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1543	Location:	4 - 23	Floor:	4th	Cost:	$500	Duration:	5 hrs
ID:	1549	Location:	4 - 23	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1555	Location:	4 - 23	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1564	Location:	4 - 23	Floor:	4th	Cost:	See *9	Duration:	See *9

Main Jail				Fifth Floor				Priority :	1
ID:	1566	Location:	5 - 1	Floor:	5th	Cost:	See *11	Duration:	See *11
ID:	1576	Location:	5 - 1	Floor:	5th	Cost:	See *11	Duration:	See *11
ID:	1578	Location:	5 - 1	Floor:	5th	Cost:	See *10	Duration:	See *10
ID:	1591	Location:	5 - 2	Floor:	5th	Cost:	$2,000	Duration:	8 hrs
ID:	1592	Location:	5 - 3	Floor:	5th	Cost:	$500	Duration:	1 hr
ID:	1593	Location:	5 - 3	Floor:	5th	Cost:	See *1	Duration:	See *1
ID:	1595	Location:	5 - 4	Floor:	5th	Cost:	$5,000	Duration:	20 hrs
ID:	1596	Location:	5 - 4	Floor:	5th	Cost:	N/A	Duration:	N/A
ID:	1597	Location:	5 - 4	Floor:	5th	Cost:	$1,500	Duration:	2 hrs
ID:	1599	Location:	5 - 5	Floor:	5th	Cost:	See *2	Duration:	See *2
ID:	1601	Location:	5 - 5	Floor:	5th	Cost:	See *1	Duration:	See *1
ID:	1602	Location:	5 - 6	Floor:	5th	Cost:	See *1	Duration:	See *1
ID:	1603	Location:	5 - 6	Floor:	5th	Cost:	$500	Duration:	1 hr
ID:	1605	Location:	5 - 7	Floor:	5th	Cost:	See *2	Duration:	See *2
ID:	1609	Location:	5 - 9	Floor:	5th	Cost:	See *1	Duration:	See *1
ID:	1626	Location:	5 - 10	Floor:	5th	Cost:	See *2	Duration:	See *2
ID:	1627	Location:	5 - 10	Floor:	5th	Cost:	$1,000	Duration:	5 hrs
ID:	1628	Location:	5 - 10	Floor:	5th	Cost:	$500	Duration:	1 hr
ID:	1630	Location:	5 - 11	Floor:	5th	Cost:	See *1	Duration:	See *1
ID:	1631	Location:	5 - 11	Floor:	5th	Cost:	See *1	Duration:	See *1
ID:	1632	Location:	5 - 11	Floor:	5th	Cost:	See *2	Duration:	See *2
ID:	1636	Location:	5 - 11	Floor:	5th	Cost:	See *1	Duration:	See *1
ID:	1641	Location:	5 - 11	Floor:	5th	Cost:	See *1	Duration:	See *1
ID:	1642	Location:	5 - 11	Floor:	5th	Cost:	$500	Duration:	1 hr
ID:	1643	Location:	5 - 11	Floor:	5th	Cost:	$6,000	Duration:	18 hrs
ID:	1654	Location:	5 - 11	Floor:	5th	Cost:	See *2	Duration:	See *2
ID:	1655	Location:	5 - 12	Floor:	5th	Cost:	$500	Duration:	1 hr
ID:	1656	Location:	5 - 12	Floor:	5th	Cost:	See *1	Duration:	See *1
ID:	1658	Location:	5 - 13	Floor:	5th	Cost:	N/A	Duration:	N/A
ID:	1659	Location:	5 - 13	Floor:	5th	Cost:	$5,000	Duration:	20 hrs
ID:	1667	Location:	5 - 16	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1668	Location:	5 - 16	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1669	Location:	5 - 16	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1670	Location:	5 - 16	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1674	Location:	5 - 16	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1681	Location:	5 - 16	Floor:	5th	Cost:	N/A	Duration:	N/A
ID:	1682	Location:	5 - 16	Floor:	5th	Cost:	$6,000	Duration:	30 hrs
ID:	1683	Location:	5 - 16	Floor:	5th	Cost:	$5,000	Duration:	20 hrs
ID:	1684	Location:	5 - 16	Floor:	5th	Cost:	$1,500	Duration:	2 hrs
ID:	1685	Location:	5 - 16	Floor:	5th	Cost:	$10,000	Duration:	50 hrs
ID:	1686	Location:	5 - 16	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1687	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1699	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1702	Location:	5 - 17	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1703	Location:	5 - 17	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1705	Location:	5 - 17	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1706	Location:	5 - 17	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1709	Location:	5 - 17	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1716	Location:	5 - 17	Floor:	5th	Cost:	N/A	Duration:	N/A
ID:	1717	Location:	5 - 17	Floor:	5th	Cost:	$5,000	Duration:	20 hrs

ID:	1718	Location:	5 - 17	Floor:	5th	Cost:	$1,500	Duration:	2 hrs
ID:	1719	Location:	5 - 17	Floor:	5th	Cost:	$6,000	Duration:	30 hrs
ID:	1720	Location:	5 - 17	Floor:	5th	Cost:	$10,000	Duration:	50 hrs
ID:	1723	Location:	5 - 17	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1732	Location:	5 - 17	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1734	Location:	5 - 17	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1736	Location:	5 - 18	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1737	Location:	5 - 18	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1738	Location:	5 - 18	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1739	Location:	5 - 18	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1743	Location:	5 - 18	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1750	Location:	5 - 18	Floor:	5th	Cost:	$1,500	Duration:	2 hrs
ID:	1751	Location:	5 - 18	Floor:	5th	Cost:	N/A	Duration:	N/A
ID:	1752	Location:	5 - 18	Floor:	5th	Cost:	$5,000	Duration:	20 hrs
ID:	1753	Location:	5 - 18	Floor:	5th	Cost:	$6,000	Duration:	30 hrs
ID:	1754	Location:	5 - 18	Floor:	5th	Cost:	$10,000	Duration:	50 hrs
ID:	1755	Location:	5 - 18	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1765	Location:	5 - 18	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1767	Location:	5 - 18	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1771	Location:	5 - 19	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1775	Location:	5 - 19	Floor:	5th	Cost:	N/A	Duration:	N/A
ID:	1776	Location:	5 - 19	Floor:	5th	Cost:	$1,500	Duration:	2 hrs
ID:	1777	Location:	5 - 19	Floor:	5th	Cost:	$6,000	Duration:	30 hrs
ID:	1778	Location:	5 - 19	Floor:	5th	Cost:	$5,000	Duration:	20 hrs
ID:	1779	Location:	5 - 19	Floor:	5th	Cost:	$10,000	Duration:	50 hrs
ID:	1780	Location:	5 - 19	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1781	Location:	5 - 19	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1782	Location:	5 - 19	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1786	Location:	5 - 19	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1793	Location:	5 - 19	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1803	Location:	5 - 19	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1805	Location:	5 - 19	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1807	Location:	5 - 20	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1808	Location:	5 - 20	Floor:	5th	Cost:	$1,500	Duration:	2 hrs
ID:	1809	Location:	5 - 20	Floor:	5th	Cost:	N/A	Duration:	N/A
ID:	1810	Location:	5 - 20	Floor:	5th	Cost:	$5,000	Duration:	20 hrs
ID:	1811	Location:	5 - 20	Floor:	5th	Cost:	$6,000	Duration:	30 hrs
ID:	1812	Location:	5 - 20	Floor:	5th	Cost:	$10,000	Duration:	50 hrs
ID:	1815	Location:	5 - 20	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1816	Location:	5 - 20	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1817	Location:	5 - 20	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1820	Location:	5 - 20	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1827	Location:	5 - 20	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1837	Location:	5 - 20	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1839	Location:	5 - 20	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1841	Location:	5 - 21	Floor:	5th	Cost:	See *8	Duration:	See *8

ID:	1842	Location:	5 - 21	Floor:	5th	Cost:	$1,500	Duration:	2 hrs
ID:	1843	Location:	5 - 21	Floor:	5th	Cost:	N/A	Duration:	N/A
ID:	1844	Location:	5 - 21	Floor:	5th	Cost:	$5,000	Duration:	20 hrs
ID:	1845	Location:	5 - 21	Floor:	5th	Cost:	$6,000	Duration:	30 hrs
ID:	1846	Location:	5 - 21	Floor:	5th	Cost:	$10,000	Duration:	50 hrs
ID:	1848	Location:	5 - 21	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1849	Location:	5 - 21	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1850	Location:	5 - 21	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1854	Location:	5 - 21	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1861	Location:	5 - 21	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1871	Location:	5 - 21	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1873	Location:	5 - 21	Floor:	5th	Cost:	See *8	Duration:	See *8

Main Jail				Sixth Floor				Priority :	1
ID:	1876	Location:	6 - 1	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	1877	Location:	6 - 1	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1878	Location:	6 - 1	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1879	Location:	6 - 1	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1883	Location:	6 - 1	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1891	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1903	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1905	Location:	6 - 1	Floor:	6th	Cost:	$1,500	Duration:	2 hrs
ID:	1906	Location:	6 - 1	Floor:	6th	Cost:	N/A	Duration:	N/A
ID:	1907	Location:	6 - 1	Floor:	6th	Cost:	$5,000	Duration:	20 hrs
ID:	1908	Location:	6 - 1	Floor:	6th	Cost:	$6,000	Duration:	30 hrs
ID:	1909	Location:	6 - 1	Floor:	6th	Cost:	$10,000	Duration:	50 hrs
ID:	1910	Location:	6 - 1	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	1912	Location:	6 - 2	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	1916	Location:	6 - 2	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1917	Location:	6 - 2	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1918	Location:	6 - 2	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1920	Location:	6 - 2	Floor:	6th	Cost:	N/A	Duration:	N/A
ID:	1921	Location:	6 - 2	Floor:	6th	Cost:	$5,000	Duration:	20 hrs
ID:	1922	Location:	6 - 2	Floor:	6th	Cost:	$1,500	Duration:	2 hrs
ID:	1923	Location:	6 - 2	Floor:	6th	Cost:	$10,000	Duration:	50 hrs
ID:	1926	Location:	6 - 2	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1934	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1945	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1947	Location:	6 - 2	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	1949	Location:	6 - 3	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	1952	Location:	6 - 3	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1953	Location:	6 - 3	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1954	Location:	6 - 3	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1958	Location:	6 - 3	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1966	Location:	6 - 3	Floor:	6th	Cost:	N/A	Duration:	N/A
ID:	1967	Location:	6 - 3	Floor:	6th	Cost:	$5,000	Duration:	20 hrs
ID:	1968	Location:	6 - 3	Floor:	6th	Cost:	$1,500	Duration:	2 hrs
ID:	1969	Location:	6 - 3	Floor:	6th	Cost:	$6,000	Duration:	30 hrs
ID:	1970	Location:	6 - 3	Floor:	6th	Cost:	$10,000	Duration:	50 hrs
ID:	1971	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1983	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1985	Location:	6 - 3	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	1988	Location:	6 - 5	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	1991	Location:	6 - 5	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1992	Location:	6 - 5	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1993	Location:	6 - 5	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1997	Location:	6 - 5	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2005	Location:	6 - 5	Floor:	6th	Cost:	N/A	Duration:	N/A
ID:	2006	Location:	6 - 5	Floor:	6th	Cost:	$5,000	Duration:	20 hrs
ID:	2007	Location:	6 - 5	Floor:	6th	Cost:	$1,500	Duration:	2 hrs
ID:	2008	Location:	6 - 5	Floor:	6th	Cost:	$6,000	Duration:	30 hrs
ID:	2009	Location:	6 - 5	Floor:	6th	Cost:	$10,000	Duration:	50 hrs
ID:	2010	Location:	6 - 5	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2020	Location:	6 - 5	Floor:	6th	Cost:	See *9	Duration:	See *9

ID:	2022	Location:	6 - 5	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	2024	Location:	6 - 6	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	2028	Location:	6 - 6	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	2029	Location:	6 - 6	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	2030	Location:	6 - 6	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	2034	Location:	6 - 6	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2042	Location:	6 - 6	Floor:	6th	Cost:	N/A	Duration:	N/A
ID:	2043	Location:	6 - 6	Floor:	6th	Cost:	$5,000	Duration:	20 hrs
ID:	2044	Location:	6 - 6	Floor:	6th	Cost:	$6,000	Duration:	30 hrs
ID:	2045	Location:	6 - 6	Floor:	6th	Cost:	$1,500	Duration:	2 hrs
ID:	2046	Location:	6 - 6	Floor:	6th	Cost:	$10,000	Duration:	50 hrs
ID:	2047	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2058	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2060	Location:	6 - 6	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	2062	Location:	6 - 7	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	2065	Location:	6 - 7	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	2066	Location:	6 - 7	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	2067	Location:	6 - 7	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	2071	Location:	6 - 7	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2079	Location:	6 - 7	Floor:	6th	Cost:	N/A	Duration:	N/A
ID:	2080	Location:	6 - 7	Floor:	6th	Cost:	$5,000	Duration:	20 hrs
ID:	2081	Location:	6 - 7	Floor:	6th	Cost:	$1,500	Duration:	2 hrs
ID:	2082	Location:	6 - 7	Floor:	6th	Cost:	$6,000	Duration:	30 hrs
ID:	2083	Location:	6 - 7	Floor:	6th	Cost:	$10,000	Duration:	50 hrs
ID:	2084	Location:	6 - 7	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2094	Location:	6 - 7	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2096	Location:	6 - 7	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	2100	Location:	6 - 9	Floor:	6th	Cost:	See *10	Duration:	See *10
ID:	2111	Location:	6 - 9	Floor:	6th	Cost:	See *10	Duration:	See *10
ID:	2113	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2114	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2129	Location:	6 - 10	Floor:	6th	Cost:	$2,000	Duration:	8 hrs
ID:	2132	Location:	6 - 11	Floor:	6th	Cost:	$500	Duration:	1 hr
ID:	2133	Location:	6 - 11	Floor:	6th	Cost:	See *1	Duration:	See *1
ID:	2134	Location:	6 - 12	Floor:	6th	Cost:	See *1	Duration:	See *1
ID:	2135	Location:	6 - 12	Floor:	6th	Cost:	$500	Duration:	1 hr
ID:	2137	Location:	6 - 13	Floor:	6th	Cost:	See *2	Duration:	See *2
ID:	2138	Location:	6 - 13	Floor:	6th	Cost:	$500	Duration:	1 hr
ID:	2139	Location:	6 - 13	Floor:	6th	Cost:	See *1	Duration:	See *1
ID:	2141	Location:	6 - 14	Floor:	6th	Cost:	See *1	Duration:	See *1
ID:	2142	Location:	6 - 14	Floor:	6th	Cost:	$500	Duration:	1 hr
ID:	2144	Location:	6 - 15	Floor:	6th	Cost:	N/A	Duration:	N/A
ID:	2145	Location:	6 - 15	Floor:	6th	Cost:	$5,000	Duration:	20 hrs
ID:	2146	Location:	6 - 15	Floor:	6th	Cost:	$1,500	Duration:	2 hrs
ID:	2148	Location:	6 - 16	Floor:	6th	Cost:	See *2	Duration:	See *2
ID:	2149	Location:	6 - 16	Floor:	6th	Cost:	$500	Duration:	1 hr
ID:	2150	Location:	6 - 16	Floor:	6th	Cost:	See *1	Duration:	See *1
ID:	2165	Location:	6 - 17	Floor:	6th	Cost:	See *1	Duration:	See *1
ID:	2166	Location:	6 - 17	Floor:	6th	Cost:	$500	Duration:	1 hr
ID:	2168	Location:	6 - 18	Floor:	6th	Cost:	N/A	Duration:	N/A
ID:	2169	Location:	6 - 18	Floor:	6th	Cost:	$5,000	Duration:	20 hrs
ID:	2171	Location:	6 - 19	Floor:	6th	Cost:	See *2	Duration:	See *2

ID:	2172	Location:	6 - 19	Floor:	6th	Cost:	$500	Duration:	1 hr
ID:	2173	Location:	6 - 19	Floor:	6th	Cost:	See *1	Duration:	See *1
ID:	2175	Location:	6 - 20	Floor:	6th	Cost:	See *2	Duration:	See *2
ID:	2176	Location:	6 - 20	Floor:	6th	Cost:	See *1	Duration:	See *1
ID:	2177	Location:	6 - 20	Floor:	6th	Cost:	$500	Duration:	1 hr
ID:	2181	Location:	6 - 20	Floor:	6th	Cost:	See *1	Duration:	See *1
ID:	2185	Location:	6 - 20	Floor:	6th	Cost:	$500	Duration:	1 hr
ID:	2186	Location:	6 - 20	Floor:	6th	Cost:	See *1	Duration:	See *1
ID:	2187	Location:	6 - 20	Floor:	6th	Cost:	See *1	Duration:	See *1
ID:	2199	Location:	6 - 20	Floor:	6th	Cost:	See *2	Duration:	See *2
ID:	2200	Location:	6 - 21	Floor:	6th	Cost:	$500	Duration:	1 hr

Main Jail					Roof				Priority :	1
ID:	2208	Location:	Yard - 1	Floor:	Roof	Cost:	$2,000	Duration:	8 hrs
ID:	2219	Location:	Yard - 1	Floor:	Roof	Cost:	$1,500	Duration:	2 hrs
ID:	2220	Location:	Yard - 1	Floor:	Roof	Cost:	N/A	Duration:	N/A
ID:	2221	Location:	Yard - 1	Floor:	Roof	Cost:	$5,000	Duration:	20 hrs
ID:	2223	Location:	Yard - 1	Floor:	Roof	Cost:	N/A	Duration:	N/A
ID:	2224	Location:	Yard - 1	Floor:	Roof	Cost:	$5,000	Duration:	20 hrs
ID:	2225	Location:	Yard - 1	Floor:	Roof	Cost:	$1,500	Duration:	2 hrs
Main Jail					Outdoor				Priority :	1
ID:	2227	Location:	O -1	Floor:	Outdoor	Cost:	$6,000	Duration:	30 hrs
ID:	2228	Location:	O -1	Floor:	Outdoor	Cost:	$1,500	Duration:	8 hrs
ID:	2229	Location:	O -1	Floor:	Outdoor	Cost:	$5,000	Duration:	25 hrs
ID:	2230	Location:	O -1	Floor:	Outdoor	Cost:	$15,000	Duration:	80 hrs
ID:	2231	Location:	O -1	Floor:	Outdoor	Cost:	$15,000	Duration:	80 hrs
ID:	2232	Location:	O -1	Floor:	Outdoor	Cost:	$1,500	Duration:	8 hrs
ID:	2233	Location:	O -1	Floor:	Outdoor	Cost:	$5,000	Duration:	25 hrs

Main Jail			Basement				Priority :	2
ID:	2	Location:	B - 1	Floor:	Basement	Cost:	$300	Duration:	1.5 hrs
ID:	3	Location:	B - 1	Floor:	Basement	Cost:	$300	Duration:	1.5 hrs
ID:	4	Location:	B - 1	Floor:	Basement	Cost:	$2,000	Duration:	16 hrs
ID:	5	Location:	B - 1	Floor:	Basement	Cost:	$8,000	Duration:	40 hrs
ID:	19	Location:	B - 3	Floor:	Basement	Cost:	See *6	Duration:	See *6
ID:	32	Location:	B - 6	Floor:	Basement	Cost:	See *6	Duration:	See *6
Main Jail			First Floor				Priority :	2
ID:	36	Location:	1 - 1	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	37	Location:	1 - 1	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	38	Location:	1 - 1	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	41	Location:	1 - 1	Floor:	1st	Cost:	$50	Duration:	.5 hrs
ID:	57	Location:	1 - 1	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	58	Location:	1 - 1	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	59	Location:	1 - 1	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	60	Location:	1 - 1	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	64	Location:	1 - 2	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	69	Location:	1 - 5	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	70	Location:	1 - 5	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	71	Location:	1 - 5	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	72	Location:	1 - 5	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
ID:	75	Location:	1 - 5	Floor:	1st	Cost:	See ID #74	Duration:	See ID #74
ID:	77	Location:	1 - 5	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	79	Location:	1 - 6	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
ID:	81	Location:	1 - 7	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	82	Location:	1 - 7	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	83	Location:	1 - 7	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	84	Location:	1 - 7	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
ID:	87	Location:	1 - 7	Floor:	1st	Cost:	See ID #85	Duration:	See ID #85
ID:	89	Location:	1 - 8	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
ID:	90	Location:	1 - 8	Floor:	1st	Cost:	$200	Duration:	2 hrs
ID:	93	Location:	1 - 9	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
ID:	94	Location:	1 - 9	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	95	Location:	1 - 9	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	96	Location:	1 - 9	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	97	Location:	1 - 9	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	98	Location:	1 - 9	Floor:	1st	Cost:	$50	Duration:	.25 hrs
ID:	99	Location:	1 - 9	Floor:	1st	Cost:	$800	Duration:	4 hrs
ID:	100	Location:	1 - 9	Floor:	1st	Cost:	$50	Duration:	.5 hrs
ID:	101	Location:	1 - 9	Floor:	1st	Cost:	$50	Duration:	.5 hrs
ID:	102	Location:	1 - 9	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	103	Location:	1 - 9	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	106	Location:	1 - 11	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	108	Location:	1 - 11	Floor:	1st	Cost:	$50	Duration:	.5 hrs
ID:	112	Location:	1 - 12	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	113	Location:	1 - 12	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	114	Location:	1 - 12	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	115	Location:	1 - 12	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	116	Location:	1 - 12	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	120	Location:	1 - 13	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	122	Location:	1 - 14	Floor:	1st	Cost:	See *6	Duration:	See *6

ID:	123	Location:	1 - 15	Floor:	1st	Cost:	See *12	Duration:	See *12
ID:	144	Location:	1 - 15	Floor:	1st	Cost:	$500	Duration:	1 hr
ID:	147	Location:	1 - 15	Floor:	1st	Cost:	$50	Duration:	.5 hr
ID:	156	Location:	1 - 15	Floor:	1st	Cost:	See *12	Duration:	See *12
ID:	157	Location:	1 - 15	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
ID:	165	Location:	1 - 16	Floor:	1st	Cost:	$500	Duration:	1 hr
ID:	170	Location:	1 - 16	Floor:	1st	Cost:	$50	Duration:	.5 hr
ID:	171	Location:	1 - 17	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
ID:	195	Location:	1 - 19	Floor:	1st	Cost:	$500	Duration:	1 hr
ID:	207	Location:	1 - 21	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	208	Location:	1 - 22	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	209	Location:	1 - 22	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	210	Location:	1 - 23	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	223	Location:	1 - 24	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	224	Location:	1 - 25	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	225	Location:	1 - 25	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	226	Location:	1 - 25	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
ID:	227	Location:	1 - 25	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	228	Location:	1 - 25	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
ID:	229	Location:	1 - 25	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	231	Location:	1 - 25	Floor:	1st	Cost:	See ID #23	Duration:	See ID #230
ID:	236	Location:	1 - 27	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	237	Location:	1 - 27	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	238	Location:	1 - 27	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
ID:	240	Location:	1 - 27	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	241	Location:	1 - 27	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	244	Location:	1 - 27	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	247	Location:	1 - 28	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	248	Location:	1 - 29	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
ID:	251	Location:	1 - 31	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
ID:	253	Location:	1 - 31	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
ID:	254	Location:	1 - 31	Floor:	1st	Cost:	$2,000	Duration:	20 hrs
ID:	255	Location:	1 - 31	Floor:	1st	Cost:	$800	Duration:	1 hr
ID:	256	Location:	1 - 31	Floor:	1st	Cost:	$800	Duration:	1 hr
ID:	257	Location:	1 - 31	Floor:	1st	Cost:	$800	Duration:	1 hr
ID:	258	Location:	1 - 31	Floor:	1st	Cost:	$800	Duration:	1 hr
ID:	259	Location:	1 - 31	Floor:	1st	Cost:	$200	Duration:	1 hr
ID:	260	Location:	1 - 31	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
ID:	261	Location:	1 - 31	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
ID:	262	Location:	1 - 31	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
ID:	263	Location:	1 - 31	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	264	Location:	1 - 31	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	265	Location:	1 - 31	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	266	Location:	1 - 31	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	272	Location:	1 - 33	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	273	Location:	1 - 33	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	275	Location:	1 - 33	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
ID:	276	Location:	1 - 33	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
ID:	277	Location:	1 - 33	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	279	Location:	1 - 33	Floor:	1st	Cost:	See ID #27	Duration:	See ID #278
ID:	280	Location:	1 - 33	Floor:	1st	Cost:	See *6	Duration:	See *6
ID:	299	Location:	1 - 34	Floor:	1st	Cost:	$100	Duration:	1 hr

ID:	300	Location:	1 - 34	Floor:	1st	Cost:	$500	Duration:	1 hr
ID:	305	Location:	1 - 34	Floor:	1st	Cost:	$200	Duration:	1 hr
ID:	308	Location:	1 - 34	Floor:	1st	Cost:	$50	Duration:	.5 hr
ID:	311	Location:	1 - 37	Floor:	1st	Cost:	$2,000	Duration:	20 hrs
ID:	313	Location:	1 - 37	Floor:	1st	Cost:	$800	Duration:	1 hr
ID:	314	Location:	1 - 37	Floor:	1st	Cost:	$800	Duration:	1 hr
ID:	315	Location:	1 - 37	Floor:	1st	Cost:	$800	Duration:	1 hr
ID:	316	Location:	1 - 37	Floor:	1st	Cost:	$800	Duration:	1 hr
ID:	317	Location:	1 - 37	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
ID:	318	Location:	1 - 37	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
ID:	319	Location:	1 - 37	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
ID:	323	Location:	1 - 38	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
ID:	324	Location:	1 - 38	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	325	Location:	1 - 38	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
ID:	326	Location:	1 - 38	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	327	Location:	1 - 38	Floor:	1st	Cost:	$300	Duration:	1.5 hrs
ID:	331	Location:	1 - 38	Floor:	1st	Cost:	See ID #33	Duration:	See ID #330
ID:	332	Location:	1 - 38	Floor:	1st	Cost:	See *6	Duration:	See *6

Main Jail				Second Floor				Priority :	2
ID:	339	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	340	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	341	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	342	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	343	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	346	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	347	Location:	2 - 2	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	348	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	349	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	350	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	351	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	352	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	355	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	356	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	357	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	360	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	362	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	366	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	367	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	368	Location:	2 - 3	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	369	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	370	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	371	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	372	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	375	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	376	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	377	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	378	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	380	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	385	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	386	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	387	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	388	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	389	Location:	2 - 4	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	390	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	391	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	393	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	394	Location:	2 - 4	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	397	Location:	2 - 5	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	398	Location:	2 - 5	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	399	Location:	2 - 5	Floor:	2nd	Cost:	$500	Duration:	5 hrs
ID:	402	Location:	2 - 6	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	407	Location:	2 - 7	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	410	Location:	2 - 8	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	413	Location:	2 - 8	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	424	Location:	2 - 10	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	428	Location:	2 - 10	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	432	Location:	2 - 10	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	437	Location:	2 - 12	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	438	Location:	2 - 12	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	439	Location:	2 - 12	Floor:	2nd	Cost:	See *6	Duration:	See *6

ID:	440	Location:	2 - 13	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	441	Location:	2 - 13	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	442	Location:	2 - 13	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	443	Location:	2 - 13	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	444	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	445	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	446	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	449	Location:	2 - 14	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	450	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	451	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	452	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	453	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	456	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	457	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	458	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	459	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	460	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	461	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	462	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	464	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	465	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	466	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	467	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	468	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	469	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	472	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	473	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	474	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	475	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	476	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	477	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	478	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	479	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	480	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	482	Location:	2 - 15	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	483	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	484	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	485	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	486	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	487	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	488	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	492	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	493	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	494	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	495	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	499	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	500	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	502	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	503	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	504	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	505	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	506	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13

ID:	507	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	508	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	512	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	513	Location:	2 - 16	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	514	Location:	2 - 16	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	515	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	516	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	517	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	518	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	519	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	520	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	523	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	524	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	525	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	526	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	527	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	528	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	529	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	530	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	531	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	533	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	534	Location:	2 - 17	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	535	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	536	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	537	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	538	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	542	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	543	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	544	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	545	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	546	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	548	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	552	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	553	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	554	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	556	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	558	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	559	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	560	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	561	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	562	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	564	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	565	Location:	2 - 18	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	566	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	567	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	569	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	570	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	572	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	575	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	576	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	578	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	581	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13

ID:	584	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	585	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	587	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	588	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	589	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	590	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	591	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	592	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	593	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	594	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	595	Location:	2 - 19	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	596	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	597	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	598	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	599	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	603	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	604	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	605	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	606	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	609	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	610	Location:	2 - 19	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	612	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	613	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	614	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	615	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	616	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	617	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	619	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	621	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	622	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	623	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	624	Location:	2 - 20	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	625	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	627	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	628	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	629	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	634	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	635	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	637	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	638	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	640	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	642	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	643	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	644	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	645	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	646	Location:	2 - 21	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	647	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	648	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	651	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	652	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	657	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	658	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13

ID:	659	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	660	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	662	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	663	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	664	Location:	2 - 22	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	665	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	666	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	669	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	670	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	671	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	672	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	676	Location:	2 - 22	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	677	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	678	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	679	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	680	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	682	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	683	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	684	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	685	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	686	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	687	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	688	Location:	2 - 23	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	689	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	690	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	691	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	693	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	695	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	696	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	697	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	698	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	700	Location:	2 - 23	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	702	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	703	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	704	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	705	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	707	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	708	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	709	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	710	Location:	2 - 24	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	711	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	713	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	714	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	718	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	720	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	722	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	723	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	724	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	725	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	726	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	727	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	729	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13

ID:	730	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	731	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	733	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	734	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	737	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	738	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	739	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	740	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	742	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	743	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	745	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	747	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	750	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	751	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	752	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	753	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	754	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	762	Location:	2 - 29	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
ID:	766	Location:	2 - 29	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	767	Location:	2 - 30	Floor:	2nd	Cost:	$300	Duration:	1.5 hrs
ID:	768	Location:	2 - 30	Floor:	2nd	Cost:	$300	Duration:	1.5 hrs
ID:	769	Location:	2 - 30	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	770	Location:	2 - 30	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
ID:	777	Location:	2 - 31	Floor:	2nd	Cost:	$200	Duration:	2 hrs
ID:	780	Location:	2 - 31	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
ID:	800	Location:	2 - 35	Floor:	2nd	Cost:	See *12	Duration:	See *12
ID:	804	Location:	2 - 35	Floor:	2nd	Cost:	$6,000	Duration:	18 hrs
ID:	805	Location:	2 - 35	Floor:	2nd	Cost:	$4,000	Duration:	20 hrs
ID:	842	Location:	2 - 35	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	844	Location:	2 - 36	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	846	Location:	2 - 36	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	876	Location:	2 - 40	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
ID:	877	Location:	2 - 40	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
ID:	893	Location:	2 - 42	Floor:	2nd	Cost:	$50	Duration:	.25 hrs
ID:	894	Location:	2 - 42	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
ID:	898	Location:	2 - 42	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	944	Location:	2 - 47	Floor:	2nd	Cost:	$500	Duration:	1 hr
ID:	948	Location:	2 - 47	Floor:	2nd	Cost:	See *12	Duration:	See *12
ID:	949	Location:	2 - 47	Floor:	2nd	Cost:	See *12	Duration:	See *12
ID:	950	Location:	2 - 47	Floor:	2nd	Cost:	See *12	Duration:	See *12
ID:	951	Location:	2 - 47	Floor:	2nd	Cost:	See *12	Duration:	See *12
ID:	952	Location:	2 - 47	Floor:	2nd	Cost:	See *12	Duration:	See *12
ID:	953	Location:	2 - 47	Floor:	2nd	Cost:	$2,000	Duration:	10 hrs
ID:	955	Location:	2 - 48	Floor:	2nd	Cost:	See *6	Duration:	See *6
ID:	963	Location:	2 - 50	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
ID:	964	Location:	2 - 50	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
ID:	965	Location:	2 - 50	Floor:	2nd	Cost:	$50	Duration:	.5 hrs

Main Jail				Third Floor				Priority :	2
ID:	971	Location:	3 - 1	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	972	Location:	3 - 2	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	976	Location:	3 - 4	Floor:	3rd	Cost:	$2,000	Duration:	16 hrs
ID:	977	Location:	3 - 4	Floor:	3rd	Cost:	See *10	Duration:	See *10
ID:	978	Location:	3 - 4	Floor:	3rd	Cost:	See *10	Duration:	See *10
ID:	979	Location:	3 - 4	Floor:	3rd	Cost:	See *10	Duration:	See *10
ID:	980	Location:	3 - 4	Floor:	3rd	Cost:	See *10	Duration:	See *10
ID:	982	Location:	3 - 4	Floor:	3rd	Cost:	See *10	Duration:	See *10
ID:	983	Location:	3 - 4	Floor:	3rd	Cost:	See *10	Duration:	See *10
ID:	985	Location:	3 - 4	Floor:	3rd	Cost:	See *10	Duration:	See *10
ID:	986	Location:	3 - 4	Floor:	3rd	Cost:	See *10	Duration:	See *10
ID:	987	Location:	3 - 4	Floor:	3rd	Cost:	See *10	Duration:	See *10
ID:	990	Location:	3 - 5	Floor:	3rd	Cost:	See *11	Duration:	See *11
ID:	991	Location:	3 - 5	Floor:	3rd	Cost:	See *11	Duration:	See *11
ID:	992	Location:	3 - 5	Floor:	3rd	Cost:	See *11	Duration:	See *11
ID:	993	Location:	3 - 5	Floor:	3rd	Cost:	See *11	Duration:	See *11
ID:	994	Location:	3 - 5	Floor:	3rd	Cost:	See *11	Duration:	See *11
ID:	995	Location:	3 - 5	Floor:	3rd	Cost:	See *11	Duration:	See *11
ID:	996	Location:	3 - 5	Floor:	3rd	Cost:	See *11	Duration:	See *11
ID:	997	Location:	3 - 5	Floor:	3rd	Cost:	See *11	Duration:	See *11
ID:	998	Location:	3 - 5	Floor:	3rd	Cost:	See *11	Duration:	See *11
ID:	1004	Location:	3 - 7	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	1011	Location:	3 - 8	Floor:	3rd	Cost:	$50	Duration:	.5 hrs
ID:	1012	Location:	3 - 8	Floor:	3rd	Cost:	$500	Duration:	1 hr
ID:	1018	Location:	3 - 8	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	1019	Location:	3 - 8	Floor:	3rd	Cost:	$50	Duration:	.5 hr
ID:	1021	Location:	3 - 9	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	1025	Location:	3 - 10	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	1026	Location:	3 - 11	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	1030	Location:	3 - 12	Floor:	3rd	Cost:	$1,000	Duration:	1 hr
ID:	1031	Location:	3 - 12	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	1037	Location:	3 - 14	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	1042	Location:	3 - 15	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	1043	Location:	3 - 15	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	1044	Location:	3 - 15	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	1048	Location:	3 - 15	Floor:	3rd	Cost:	$50	Duration:	.5 hrs
ID:	1049	Location:	3 - 15	Floor:	3rd	Cost:	$50	Duration:	.5 hrs
ID:	1050	Location:	3 - 15	Floor:	3rd	Cost:	$50	Duration:	.5 hrs
ID:	1058	Location:	3 - 15	Floor:	3rd	Cost:	See *6	Duration:	See *6
ID:	1062	Location:	3 - 17	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1063	Location:	3 - 17	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1064	Location:	3 - 17	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1065	Location:	3 - 17	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1067	Location:	3 - 17	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1068	Location:	3 - 17	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1071	Location:	3 - 17	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1072	Location:	3 - 17	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1075	Location:	3 - 17	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1085	Location:	3 - 17	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1086	Location:	3 - 17	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1087	Location:	3 - 17	Floor:	3rd	Cost:	See *7	Duration:	See *7

ID:	1089	Location:	3 - 17	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1090	Location:	3 - 17	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1091	Location:	3 - 17	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1092	Location:	3 - 17	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1093	Location:	3 - 17	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1095	Location:	3 - 18	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1106	Location:	3 - 18	Floor:	3rd	Cost:	$1,000	Duration:	5 hrs
ID:	1108	Location:	3 - 18	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1109	Location:	3 - 18	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1110	Location:	3 - 18	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1111	Location:	3 - 18	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1112	Location:	3 - 18	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1113	Location:	3 - 18	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1116	Location:	3 - 18	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1117	Location:	3 - 18	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1118	Location:	3 - 18	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1119	Location:	3 - 18	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1120	Location:	3 - 18	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1122	Location:	3 - 18	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1123	Location:	3 - 18	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1124	Location:	3 - 18	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1125	Location:	3 - 18	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1126	Location:	3 - 18	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1128	Location:	3 - 19	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1136	Location:	3 - 19	Floor:	3rd	Cost:	$1,000	Duration:	5 hrs
ID:	1138	Location:	3 - 19	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1139	Location:	3 - 19	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1140	Location:	3 - 19	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1141	Location:	3 - 19	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1142	Location:	3 - 19	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1144	Location:	3 - 19	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1145	Location:	3 - 19	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1147	Location:	3 - 19	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1148	Location:	3 - 19	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1149	Location:	3 - 19	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1150	Location:	3 - 19	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1152	Location:	3 - 19	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1153	Location:	3 - 19	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1154	Location:	3 - 19	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1155	Location:	3 - 19	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1156	Location:	3 - 19	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1157	Location:	3 - 19	Floor:	3rd	Cost:	$200	Duration:	2 hrs
ID:	1160	Location:	3 - 20	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1167	Location:	3 - 20	Floor:	3rd	Cost:	$1,000	Duration:	5 hrs
ID:	1168	Location:	3 - 20	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1169	Location:	3 - 20	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1170	Location:	3 - 20	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1172	Location:	3 - 20	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1173	Location:	3 - 20	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1174	Location:	3 - 20	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1175	Location:	3 - 20	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1176	Location:	3 - 20	Floor:	3rd	Cost:	See *7	Duration:	See *7

ID:	1178	Location:	3 - 20	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1179	Location:	3 - 20	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1180	Location:	3 - 20	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1181	Location:	3 - 20	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1182	Location:	3 - 20	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1184	Location:	3 - 20	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1185	Location:	3 - 20	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1187	Location:	3 - 20	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1193	Location:	3 - 21	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1195	Location:	3 - 21	Floor:	3rd	Cost:	$200	Duration:	2 hrs
ID:	1200	Location:	3 - 21	Floor:	3rd	Cost:	$1,000	Duration:	5 hrs
ID:	1201	Location:	3 - 21	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1202	Location:	3 - 21	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1203	Location:	3 - 21	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1204	Location:	3 - 21	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1205	Location:	3 - 21	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1206	Location:	3 - 21	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1207	Location:	3 - 21	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1208	Location:	3 - 21	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1209	Location:	3 - 21	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1215	Location:	3 - 21	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1216	Location:	3 - 21	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1217	Location:	3 - 21	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1219	Location:	3 - 21	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1220	Location:	3 - 21	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1221	Location:	3 - 21	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1222	Location:	3 - 21	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1224	Location:	3 - 21	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1226	Location:	3 - 22	Floor:	3rd	Cost:	See *8	Duration:	See *8
ID:	1236	Location:	3 - 22	Floor:	3rd	Cost:	$1,000	Duration:	5 hrs
ID:	1238	Location:	3 - 22	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1239	Location:	3 - 22	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1241	Location:	3 - 22	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1242	Location:	3 - 22	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1243	Location:	3 - 22	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1244	Location:	3 - 22	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1245	Location:	3 - 22	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1246	Location:	3 - 22	Floor:	3rd	Cost:	See *7	Duration:	See *7
ID:	1248	Location:	3 - 22	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1249	Location:	3 - 22	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1250	Location:	3 - 22	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1252	Location:	3 - 22	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1253	Location:	3 - 22	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1254	Location:	3 - 22	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1255	Location:	3 - 22	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1256	Location:	3 - 22	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1258	Location:	3 - 22	Floor:	3rd	Cost:	See *9	Duration:	See *9

Main Jail				Fourth Floor				Priority :	2
ID:	1260	Location:	4 - 1	Floor:	4th	Cost:	$2,000	Duration:	16 hrs
ID:	1261	Location:	4 - 1	Floor:	4th	Cost:	See *10	Duration:	See *10
ID:	1262	Location:	4 - 1	Floor:	4th	Cost:	See *10	Duration:	See *10
ID:	1263	Location:	4 - 1	Floor:	4th	Cost:	See *10	Duration:	See *10
ID:	1264	Location:	4 - 1	Floor:	4th	Cost:	See *10	Duration:	See *10
ID:	1268	Location:	4 - 1	Floor:	4th	Cost:	See *10	Duration:	See *10
ID:	1269	Location:	4 - 1	Floor:	4th	Cost:	See *10	Duration:	See *10
ID:	1270	Location:	4 - 1	Floor:	4th	Cost:	See *10	Duration:	See *10
ID:	1271	Location:	4 - 1	Floor:	4th	Cost:	See *10	Duration:	See *10
ID:	1274	Location:	4 - 1	Floor:	4th	Cost:	See *11	Duration:	See *11
ID:	1275	Location:	4 - 1	Floor:	4th	Cost:	See *11	Duration:	See *11
ID:	1276	Location:	4 - 1	Floor:	4th	Cost:	See *11	Duration:	See *11
ID:	1277	Location:	4 - 1	Floor:	4th	Cost:	See *11	Duration:	See *11
ID:	1278	Location:	4 - 1	Floor:	4th	Cost:	See *11	Duration:	See *11
ID:	1279	Location:	4 - 1	Floor:	4th	Cost:	See *11	Duration:	See *11
ID:	1280	Location:	4 - 1	Floor:	4th	Cost:	See *11	Duration:	See *11
ID:	1281	Location:	4 - 1	Floor:	4th	Cost:	See *11	Duration:	See *11
ID:	1282	Location:	4 - 1	Floor:	4th	Cost:	See *11	Duration:	See *11
ID:	1283	Location:	4 - 1	Floor:	4th	Cost:	See *11	Duration:	See *11
ID:	1287	Location:	4 - 3	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1289	Location:	4 - 4	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1292	Location:	4 - 5	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1298	Location:	4 - 6	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1300	Location:	4 - 7	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1303	Location:	4 - 8	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1309	Location:	4 - 10	Floor:	4th	Cost:	$50	Duration:	.5 hrs
ID:	1310	Location:	4 - 10	Floor:	4th	Cost:	$500	Duration:	1 hr
ID:	1319	Location:	4 - 10	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1320	Location:	4 - 10	Floor:	4th	Cost:	$50	Duration:	.5 hr
ID:	1325	Location:	4 - 11	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1328	Location:	4 - 12	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1331	Location:	4 - 13	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1334	Location:	4 - 14	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1335	Location:	4 - 14	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1336	Location:	4 - 14	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1349	Location:	4 - 14	Floor:	4th	Cost:	$50	Duration:	.5 hrs
ID:	1350	Location:	4 - 14	Floor:	4th	Cost:	$50	Duration:	.5 hrs
ID:	1355	Location:	4 - 14	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1356	Location:	4 - 14	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1360	Location:	4 - 16	Floor:	4th	Cost:	$1,000	Duration:	1 hr
ID:	1362	Location:	4 - 16	Floor:	4th	Cost:	See *6	Duration:	See *6
ID:	1363	Location:	4 - 17	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1368	Location:	4 - 17	Floor:	4th	Cost:	$1,000	Duration:	5 hrs
ID:	1369	Location:	4 - 17	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1370	Location:	4 - 17	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1371	Location:	4 - 17	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1373	Location:	4 - 17	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1374	Location:	4 - 17	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1375	Location:	4 - 17	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1376	Location:	4 - 17	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1377	Location:	4 - 17	Floor:	4th	Cost:	See *7	Duration:	See *7

ID:	1378	Location:	4 - 17	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1385	Location:	4 - 17	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1386	Location:	4 - 17	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1387	Location:	4 - 17	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1389	Location:	4 - 17	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1390	Location:	4 - 17	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1393	Location:	4 - 17	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1394	Location:	4 - 17	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1396	Location:	4 - 17	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1397	Location:	4 - 18	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1407	Location:	4 - 18	Floor:	4th	Cost:	$1,000	Duration:	5 hrs
ID:	1408	Location:	4 - 18	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1409	Location:	4 - 18	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1411	Location:	4 - 18	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1412	Location:	4 - 18	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1413	Location:	4 - 18	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1414	Location:	4 - 18	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1415	Location:	4 - 18	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1416	Location:	4 - 18	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1417	Location:	4 - 18	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1420	Location:	4 - 18	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1421	Location:	4 - 18	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1422	Location:	4 - 18	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1423	Location:	4 - 18	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1425	Location:	4 - 18	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1426	Location:	4 - 18	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1427	Location:	4 - 18	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1429	Location:	4 - 18	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1430	Location:	4 - 19	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1440	Location:	4 - 19	Floor:	4th	Cost:	$1,000	Duration:	5 hrs
ID:	1441	Location:	4 - 19	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1442	Location:	4 - 19	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1443	Location:	4 - 19	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1445	Location:	4 - 19	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1446	Location:	4 - 19	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1447	Location:	4 - 19	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1448	Location:	4 - 19	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1449	Location:	4 - 19	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1450	Location:	4 - 19	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1452	Location:	4 - 19	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1453	Location:	4 - 19	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1454	Location:	4 - 19	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1455	Location:	4 - 19	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1456	Location:	4 - 19	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1457	Location:	4 - 19	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1458	Location:	4 - 19	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1460	Location:	4 - 19	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1464	Location:	4 - 21	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1470	Location:	4 - 21	Floor:	4th	Cost:	$1,000	Duration:	5 hrs
ID:	1471	Location:	4 - 21	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1472	Location:	4 - 21	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1474	Location:	4 - 21	Floor:	4th	Cost:	See *7	Duration:	See *7

ID:	1475	Location:	4 - 21	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1476	Location:	4 - 21	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1477	Location:	4 - 21	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1478	Location:	4 - 21	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1479	Location:	4 - 21	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1480	Location:	4 - 21	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1487	Location:	4 - 21	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1488	Location:	4 - 21	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1489	Location:	4 - 21	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1490	Location:	4 - 21	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1491	Location:	4 - 21	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1493	Location:	4 - 21	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1494	Location:	4 - 21	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1496	Location:	4 - 21	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1498	Location:	4 - 22	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1501	Location:	4 - 22	Floor:	4th	Cost:	$200	Duration:	2 hrs
ID:	1511	Location:	4 - 22	Floor:	4th	Cost:	$1,000	Duration:	5 hrs
ID:	1512	Location:	4 - 22	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1513	Location:	4 - 22	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1514	Location:	4 - 22	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1515	Location:	4 - 22	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1517	Location:	4 - 22	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1518	Location:	4 - 22	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1519	Location:	4 - 22	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1520	Location:	4 - 22	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1521	Location:	4 - 22	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1523	Location:	4 - 22	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1524	Location:	4 - 22	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1525	Location:	4 - 22	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1526	Location:	4 - 22	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1527	Location:	4 - 22	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1529	Location:	4 - 22	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1530	Location:	4 - 22	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1532	Location:	4 - 22	Floor:	4th	Cost:	See *9	Duration:	See *9

ID:	1533	Location:	4 - 23	Floor:	4th	Cost:	See *8	Duration:	See *8
ID:	1544	Location:	4 - 23	Floor:	4th	Cost:	$1,000	Duration:	5 hrs
ID:	1545	Location:	4 - 23	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1546	Location:	4 - 23	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1547	Location:	4 - 23	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1548	Location:	4 - 23	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1550	Location:	4 - 23	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1551	Location:	4 - 23	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1552	Location:	4 - 23	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1553	Location:	4 - 23	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1554	Location:	4 - 23	Floor:	4th	Cost:	See *7	Duration:	See *7
ID:	1556	Location:	4 - 23	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1557	Location:	4 - 23	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1558	Location:	4 - 23	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1559	Location:	4 - 23	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1560	Location:	4 - 23	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1562	Location:	4 - 23	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1563	Location:	4 - 23	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1565	Location:	4 - 23	Floor:	4th	Cost:	See *9	Duration:	See *9

Main Jail				Fifth Floor				Priority :	2
ID:	1567	Location:	5 - 1	Floor:	5th	Cost:	See *11	Duration:	See *11
ID:	1568	Location:	5 - 1	Floor:	5th	Cost:	See *11	Duration:	See *11
ID:	1569	Location:	5 - 1	Floor:	5th	Cost:	See *11	Duration:	See *11
ID:	1570	Location:	5 - 1	Floor:	5th	Cost:	See *11	Duration:	See *11
ID:	1571	Location:	5 - 1	Floor:	5th	Cost:	See *11	Duration:	See *11
ID:	1572	Location:	5 - 1	Floor:	5th	Cost:	See *11	Duration:	See *11
ID:	1573	Location:	5 - 1	Floor:	5th	Cost:	See *11	Duration:	See *11
ID:	1574	Location:	5 - 1	Floor:	5th	Cost:	See *11	Duration:	See *11
ID:	1575	Location:	5 - 1	Floor:	5th	Cost:	See *11	Duration:	See *11
ID:	1577	Location:	5 - 1	Floor:	5th	Cost:	See *11	Duration:	See *11
ID:	1579	Location:	5 - 1	Floor:	5th	Cost:	$2,000	Duration:	16 hrs
ID:	1580	Location:	5 - 1	Floor:	5th	Cost:	See *10	Duration:	See *10
ID:	1581	Location:	5 - 1	Floor:	5th	Cost:	See *10	Duration:	See *10
ID:	1582	Location:	5 - 1	Floor:	5th	Cost:	See *10	Duration:	See *10
ID:	1583	Location:	5 - 1	Floor:	5th	Cost:	See *10	Duration:	See *10
ID:	1584	Location:	5 - 1	Floor:	5th	Cost:	See *10	Duration:	See *10
ID:	1585	Location:	5 - 1	Floor:	5th	Cost:	See *10	Duration:	See *10
ID:	1588	Location:	5 - 1	Floor:	5th	Cost:	See *10	Duration:	See *10
ID:	1589	Location:	5 - 1	Floor:	5th	Cost:	$500	Duration:	5 hrs
ID:	1594	Location:	5 - 3	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1598	Location:	5 - 4	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1600	Location:	5 - 5	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1604	Location:	5 - 6	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1606	Location:	5 - 7	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1608	Location:	5 - 8	Floor:	5th	Cost:	$1,000	Duration:	1 hr
ID:	1610	Location:	5 - 9	Floor:	5th	Cost:	$2,000	Duration:	16 hrs
ID:	1611	Location:	5 - 9	Floor:	5th	Cost:	$2,000	Duration:	16 hrs
ID:	1612	Location:	5 - 9	Floor:	5th	Cost:	$300	Duration:	1.5 hrs
ID:	1613	Location:	5 - 9	Floor:	5th	Cost:	$300	Duration:	1.5 hrs
ID:	1615	Location:	5 - 9	Floor:	5th	Cost:	$50	Duration:	.5 hrs
ID:	1616	Location:	5 - 9	Floor:	5th	Cost:	$500	Duration:	1 hr
ID:	1624	Location:	5 - 9	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1625	Location:	5 - 9	Floor:	5th	Cost:	$50	Duration:	.5 hr
ID:	1629	Location:	5 - 10	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1633	Location:	5 - 11	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1634	Location:	5 - 11	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1635	Location:	5 - 11	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1644	Location:	5 - 11	Floor:	5th	Cost:	$2,000	Duration:	16 hrs
ID:	1645	Location:	5 - 11	Floor:	5th	Cost:	$2,000	Duration:	16 hrs
ID:	1652	Location:	5 - 11	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1653	Location:	5 - 11	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1657	Location:	5 - 12	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1660	Location:	5 - 13	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1662	Location:	5 - 14	Floor:	5th	Cost:	$1,000	Duration:	1 hr
ID:	1663	Location:	5 - 14	Floor:	5th	Cost:	See *6	Duration:	See *6
ID:	1666	Location:	5 - 16	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1671	Location:	5 - 16	Floor:	5th	Cost:	$1,000	Duration:	5 hrs
ID:	1672	Location:	5 - 16	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1673	Location:	5 - 16	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1675	Location:	5 - 16	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1676	Location:	5 - 16	Floor:	5th	Cost:	See *7	Duration:	See *7

ID:	1677	Location:	5 - 16	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1678	Location:	5 - 16	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1679	Location:	5 - 16	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1680	Location:	5 - 16	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1688	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1689	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1690	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1692	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1693	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1695	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1696	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1700	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1701	Location:	5 - 17	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1704	Location:	5 - 17	Floor:	5th	Cost:	$1,000	Duration:	5 hrs
ID:	1707	Location:	5 - 17	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1708	Location:	5 - 17	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1710	Location:	5 - 17	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1711	Location:	5 - 17	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1712	Location:	5 - 17	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1713	Location:	5 - 17	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1714	Location:	5 - 17	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1715	Location:	5 - 17	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1722	Location:	5 - 17	Floor:	5th	Cost:	$200	Duration:	2 hrs
ID:	1724	Location:	5 - 17	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1725	Location:	5 - 17	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1726	Location:	5 - 17	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1727	Location:	5 - 17	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1728	Location:	5 - 17	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1730	Location:	5 - 17	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1731	Location:	5 - 17	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1733	Location:	5 - 17	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1735	Location:	5 - 18	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1740	Location:	5 - 18	Floor:	5th	Cost:	$1,000	Duration:	5 hrs
ID:	1741	Location:	5 - 18	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1742	Location:	5 - 18	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1744	Location:	5 - 18	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1745	Location:	5 - 18	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1746	Location:	5 - 18	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1747	Location:	5 - 18	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1748	Location:	5 - 18	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1749	Location:	5 - 18	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1756	Location:	5 - 18	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1757	Location:	5 - 18	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1758	Location:	5 - 18	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1759	Location:	5 - 18	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1760	Location:	5 - 18	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1761	Location:	5 - 18	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1763	Location:	5 - 18	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1764	Location:	5 - 18	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1766	Location:	5 - 18	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1769	Location:	5 - 18	Floor:	5th	Cost:	$200	Duration:	2 hrs
ID:	1770	Location:	5 - 19	Floor:	5th	Cost:	See *8	Duration:	See *8

ID:	1774	Location:	5 - 19	Floor:	5th	Cost:	$1,000	Duration:	5 hrs
ID:	1783	Location:	5 - 19	Floor:	5th	Cost:	$1,000	Duration:	5 hrs
ID:	1784	Location:	5 - 19	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1785	Location:	5 - 19	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1787	Location:	5 - 19	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1788	Location:	5 - 19	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1789	Location:	5 - 19	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1790	Location:	5 - 19	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1791	Location:	5 - 19	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1792	Location:	5 - 19	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1794	Location:	5 - 19	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1796	Location:	5 - 19	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1797	Location:	5 - 19	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1798	Location:	5 - 19	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1799	Location:	5 - 19	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1801	Location:	5 - 19	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1802	Location:	5 - 19	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1804	Location:	5 - 19	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1806	Location:	5 - 20	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1814	Location:	5 - 20	Floor:	5th	Cost:	$1,000	Duration:	5 hrs
ID:	1818	Location:	5 - 20	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1819	Location:	5 - 20	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1821	Location:	5 - 20	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1822	Location:	5 - 20	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1823	Location:	5 - 20	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1824	Location:	5 - 20	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1825	Location:	5 - 20	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1826	Location:	5 - 20	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1828	Location:	5 - 20	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1829	Location:	5 - 20	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1830	Location:	5 - 20	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1832	Location:	5 - 20	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1833	Location:	5 - 20	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1834	Location:	5 - 20	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1835	Location:	5 - 20	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1836	Location:	5 - 20	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1838	Location:	5 - 20	Floor:	5th	Cost:	See *9	Duration:	See *9

ID:	1840	Location:	5 - 21	Floor:	5th	Cost:	See *8	Duration:	See *8
ID:	1851	Location:	5 - 21	Floor:	5th	Cost:	$1,000	Duration:	5 hrs
ID:	1852	Location:	5 - 21	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1853	Location:	5 - 21	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1855	Location:	5 - 21	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1856	Location:	5 - 21	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1857	Location:	5 - 21	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1858	Location:	5 - 21	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1859	Location:	5 - 21	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1860	Location:	5 - 21	Floor:	5th	Cost:	See *7	Duration:	See *7
ID:	1862	Location:	5 - 21	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1863	Location:	5 - 21	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1864	Location:	5 - 21	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1865	Location:	5 - 21	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1866	Location:	5 - 21	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1867	Location:	5 - 21	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1869	Location:	5 - 21	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1870	Location:	5 - 21	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1872	Location:	5 - 21	Floor:	5th	Cost:	See *9	Duration:	See *9

Main Jail				Sixth Floor				Priority :	2
ID:	1875	Location:	6 - 1	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	1880	Location:	6 - 1	Floor:	6th	Cost:	$1,000	Duration:	5 hrs
ID:	1881	Location:	6 - 1	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1882	Location:	6 - 1	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1884	Location:	6 - 1	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1885	Location:	6 - 1	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1886	Location:	6 - 1	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1887	Location:	6 - 1	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1888	Location:	6 - 1	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1889	Location:	6 - 1	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1890	Location:	6 - 1	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1892	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1893	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1894	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1895	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1896	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1897	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1899	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1900	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1904	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1911	Location:	6 - 2	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	1913	Location:	6 - 2	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1914	Location:	6 - 2	Floor:	6th	Cost:	$200	Duration:	2 hrs
ID:	1919	Location:	6 - 2	Floor:	6th	Cost:	$1,000	Duration:	5 hrs
ID:	1924	Location:	6 - 2	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1925	Location:	6 - 2	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1927	Location:	6 - 2	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1928	Location:	6 - 2	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1929	Location:	6 - 2	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1930	Location:	6 - 2	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1931	Location:	6 - 2	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1932	Location:	6 - 2	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1933	Location:	6 - 2	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1935	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1936	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1937	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1938	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1939	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1940	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1942	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1943	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1946	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1948	Location:	6 - 3	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	1950	Location:	6 - 3	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1955	Location:	6 - 3	Floor:	6th	Cost:	$1,000	Duration:	5 hrs
ID:	1956	Location:	6 - 3	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1957	Location:	6 - 3	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1959	Location:	6 - 3	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1960	Location:	6 - 3	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1961	Location:	6 - 3	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1962	Location:	6 - 3	Floor:	6th	Cost:	See *7	Duration:	See *7

ID:	1963	Location:	6 - 3	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1964	Location:	6 - 3	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1965	Location:	6 - 3	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1972	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1973	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1974	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1975	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1976	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1977	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1979	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1980	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1984	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1987	Location:	6 - 5	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	1990	Location:	6 - 5	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	1994	Location:	6 - 5	Floor:	6th	Cost:	$1,000	Duration:	5 hrs
ID:	1995	Location:	6 - 5	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1996	Location:	6 - 5	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1998	Location:	6 - 5	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	1999	Location:	6 - 5	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2000	Location:	6 - 5	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2001	Location:	6 - 5	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2002	Location:	6 - 5	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2003	Location:	6 - 5	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2004	Location:	6 - 5	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2011	Location:	6 - 5	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2012	Location:	6 - 5	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2013	Location:	6 - 5	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2014	Location:	6 - 5	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2015	Location:	6 - 5	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2017	Location:	6 - 5	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2018	Location:	6 - 5	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2019	Location:	6 - 5	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2021	Location:	6 - 5	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2023	Location:	6 - 6	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	2026	Location:	6 - 6	Floor:	6th	Cost:	$200	Duration:	2 hrs
ID:	2027	Location:	6 - 6	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	2031	Location:	6 - 6	Floor:	6th	Cost:	$1,000	Duration:	5 hrs
ID:	2032	Location:	6 - 6	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2033	Location:	6 - 6	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2035	Location:	6 - 6	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2036	Location:	6 - 6	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2037	Location:	6 - 6	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2038	Location:	6 - 6	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2039	Location:	6 - 6	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2040	Location:	6 - 6	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2041	Location:	6 - 6	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2048	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2049	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2050	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2052	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2053	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2054	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9

ID:	2055	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2056	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2059	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2061	Location:	6 - 7	Floor:	6th	Cost:	See *8	Duration:	See *8
ID:	2064	Location:	6 - 7	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	2068	Location:	6 - 7	Floor:	6th	Cost:	$1,000	Duration:	5 hrs
ID:	2069	Location:	6 - 7	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2070	Location:	6 - 7	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2072	Location:	6 - 7	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2073	Location:	6 - 7	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2074	Location:	6 - 7	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2075	Location:	6 - 7	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2076	Location:	6 - 7	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2077	Location:	6 - 7	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2078	Location:	6 - 7	Floor:	6th	Cost:	See *7	Duration:	See *7
ID:	2085	Location:	6 - 7	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2086	Location:	6 - 7	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2087	Location:	6 - 7	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2088	Location:	6 - 7	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2089	Location:	6 - 7	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2091	Location:	6 - 7	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2092	Location:	6 - 7	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2093	Location:	6 - 7	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2095	Location:	6 - 7	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2098	Location:	6 - 8	Floor:	6th	Cost:	$1,000	Duration:	1 hr
ID:	2099	Location:	6 - 8	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2101	Location:	6 - 9	Floor:	6th	Cost:	$2,000	Duration:	16 hrs
ID:	2102	Location:	6 - 9	Floor:	6th	Cost:	See *10	Duration:	See *10
ID:	2103	Location:	6 - 9	Floor:	6th	Cost:	See *10	Duration:	See *10
ID:	2104	Location:	6 - 9	Floor:	6th	Cost:	See *10	Duration:	See *10
ID:	2105	Location:	6 - 9	Floor:	6th	Cost:	See *10	Duration:	See *10
ID:	2109	Location:	6 - 9	Floor:	6th	Cost:	See *10	Duration:	See *10
ID:	2110	Location:	6 - 9	Floor:	6th	Cost:	See *10	Duration:	See *10
ID:	2112	Location:	6 - 9	Floor:	6th	Cost:	See *10	Duration:	See *10
ID:	2115	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2116	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2117	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2118	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2119	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2120	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2121	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2122	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2123	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2124	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2126	Location:	6 - 9	Floor:	6th	Cost:	$500	Duration:	5 hrs
ID:	2128	Location:	6 - 10	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2131	Location:	6 - 11	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2136	Location:	6 - 12	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2140	Location:	6 - 13	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2143	Location:	6 - 14	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2147	Location:	6 - 15	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2151	Location:	6 - 16	Floor:	6th	Cost:	See *6	Duration:	See *6

ID:	2152	Location:	6 - 16	Floor:	6th	Cost:	$50	Duration:	.5 hr
ID:	2159	Location:	6 - 16	Floor:	6th	Cost:	$50	Duration:	.5 hrs
ID:	2160	Location:	6 - 16	Floor:	6th	Cost:	$500	Duration:	1 hr
ID:	2167	Location:	6 - 17	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2170	Location:	6 - 18	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2174	Location:	6 - 19	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2178	Location:	6 - 20	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2179	Location:	6 - 20	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2180	Location:	6 - 20	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2184	Location:	6 - 20	Floor:	6th	Cost:	$50	Duration:	.5 hrs
ID:	2196	Location:	6 - 20	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2197	Location:	6 - 20	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2198	Location:	6 - 20	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2202	Location:	6 - 21	Floor:	6th	Cost:	See *6	Duration:	See *6
ID:	2203	Location:	6 - 21	Floor:	6th	Cost:	$1,000	Duration:	1 hr
Main Jail					Roof			Priority :	2
ID:	2207	Location:	Yard - 1	Floor:	Roof	Cost:	$2,000	Duration:	10 hrs
ID:	2209	Location:	Yard - 1	Floor:	Roof	Cost:	$2,000	Duration:	16 hrs
ID:	2210	Location:	Yard - 1	Floor:	Roof	Cost:	$2,000	Duration:	16 hrs
ID:	2211	Location:	Yard - 1	Floor:	Roof	Cost:	$800	Duration:	1 hr
ID:	2212	Location:	Yard - 1	Floor:	Roof	Cost:	$800	Duration:	1 hr
ID:	2215	Location:	Yard - 1	Floor:	Roof	Cost:	$2,000	Duration:	16 hrs
ID:	2216	Location:	Yard - 1	Floor:	Roof	Cost:	$500	Duration:	1 hr
ID:	2217	Location:	Yard - 1	Floor:	Roof	Cost:	$500	Duration:	1 hr
ID:	2218	Location:	Yard - 1	Floor:	Roof	Cost:	$8,000	Duration:	40 hrs
ID:	2222	Location:	Yard - 1	Floor:	Roof	Cost:	See *6	Duration:	See *6
ID:	2226	Location:	Yard - 1	Floor:	Roof	Cost:	See *6	Duration:	See *6

Main Jail				Basement				Priority :	3
ID:	1	Location:	B - 1	Floor:	Basement	Cost:	3000	Duration:	16 hrs
ID:	10	Location:	B - 2	Floor:	Basement	Cost:	2000	Duration:	16 hrs
ID:	11	Location:	B - 2	Floor:	Basement	Cost:	2000	Duration:	16 hrs
ID:	12	Location:	B - 2	Floor:	Basement	Cost:	3000	Duration:	16 hrs
ID:	13	Location:	B - 2	Floor:	Basement	Cost:	1000	Duration:	8 hrs
ID:	14	Location:	B - 2	Floor:	Basement	Cost:	50	Duration:	.5 hrs
ID:	15	Location:	B - 2	Floor:	Basement	Cost:	50	Duration:	.5 hrs
ID:	16	Location:	B - 2	Floor:	Basement	Cost:	50	Duration:	.5 hrs
Main Jail				First Floor				Priority :	3
ID:	42	Location:	1 - 1	Floor:	1st	Cost:	1000	Duration:	8 hrs
ID:	46	Location:	1 - 1	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	47	Location:	1 - 1	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	48	Location:	1 - 1	Floor:	1st	Cost:	2000	Duration:	10 hrs
ID:	49	Location:	1 - 1	Floor:	1st	Cost:	50	Duration:	.25 hrs
ID:	50	Location:	1 - 1	Floor:	1st	Cost:	1000	Duration:	8 hrs
ID:	51	Location:	1 - 1	Floor:	1st	Cost:	100	Duration:	1 hr
ID:	52	Location:	1 - 1	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	53	Location:	1 - 1	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	54	Location:	1 - 1	Floor:	1st	Cost:	500	Duration:	2 hrs
ID:	63	Location:	1 - 2	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	74	Location:	1 - 5	Floor:	1st	Cost:	3000	Duration:	16 hrs
ID:	85	Location:	1 - 7	Floor:	1st	Cost:	3000	Duration:	16 hrs
ID:	126	Location:	1 - 15	Floor:	1st	Cost:	100	Duration:	1 hr
ID:	127	Location:	1 - 15	Floor:	1st	Cost:	50	Duration:	.25 hrs
ID:	128	Location:	1 - 15	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	129	Location:	1 - 15	Floor:	1st	Cost:	500	Duration:	1 hr
ID:	130	Location:	1 - 15	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	131	Location:	1 - 15	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	132	Location:	1 - 15	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	133	Location:	1 - 15	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	134	Location:	1 - 15	Floor:	1st	Cost:	2000	Duration:	10 hrs
ID:	135	Location:	1 - 15	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	136	Location:	1 - 15	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	137	Location:	1 - 15	Floor:	1st	Cost:	4000	Duration:	20 hrs
ID:	138	Location:	1 - 15	Floor:	1st	Cost:	100	Duration:	0.5 hrs
ID:	141	Location:	1 - 15	Floor:	1st	Cost:	50	Duration:	.25 hrs
ID:	142	Location:	1 - 15	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	143	Location:	1 - 15	Floor:	1st	Cost:	100	Duration:	1 hr
ID:	145	Location:	1 - 15	Floor:	1st	Cost:	100	Duration:	0.5 hrs
ID:	146	Location:	1 - 15	Floor:	1st	Cost:	100	Duration:	1 hr
ID:	148	Location:	1 - 15	Floor:	1st	Cost:	500	Duration:	1 hr
ID:	149	Location:	1 - 15	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	150	Location:	1 - 15	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	151	Location:	1 - 15	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	152	Location:	1 - 15	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	153	Location:	1 - 15	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	154	Location:	1 - 15	Floor:	1st	Cost:	2000	Duration:	10 hrs
ID:	155	Location:	1 - 15	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	161	Location:	1 - 16	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	162	Location:	1 - 16	Floor:	1st	Cost:	300	Duration:	1.5 hrs

ID:	163	Location:	1 - 16	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	164	Location:	1 - 16	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	166	Location:	1 - 16	Floor:	1st	Cost:	4000	Duration:	20 hrs
ID:	167	Location:	1 - 16	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	168	Location:	1 - 16	Floor:	1st	Cost:	100	Duration:	1 hr
ID:	169	Location:	1 - 16	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	172	Location:	1 - 16	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	181	Location:	1 - 19	Floor:	1st	Cost:	50	Duration:	.25 hrs
ID:	182	Location:	1 - 19	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	183	Location:	1 - 19	Floor:	1st	Cost:	500	Duration:	1 hr
ID:	184	Location:	1 - 19	Floor:	1st	Cost:	100	Duration:	1 hr
ID:	185	Location:	1 - 19	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	186	Location:	1 - 19	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	187	Location:	1 - 19	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	188	Location:	1 - 19	Floor:	1st	Cost:	4000	Duration:	20 hrs
ID:	189	Location:	1 - 19	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	190	Location:	1 - 19	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	192	Location:	1 - 19	Floor:	1st	Cost:	50	Duration:	.25 hrs
ID:	193	Location:	1 - 19	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	194	Location:	1 - 19	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	196	Location:	1 - 19	Floor:	1st	Cost:	100	Duration:	1 hr
ID:	197	Location:	1 - 19	Floor:	1st	Cost:	500	Duration:	1 hr
ID:	198	Location:	1 - 19	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	199	Location:	1 - 19	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	200	Location:	1 - 19	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	201	Location:	1 - 19	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	203	Location:	1 - 20	Floor:	1st	Cost:	100	Duration:	1 hr
ID:	213	Location:	1 - 24	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	214	Location:	1 - 24	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	215	Location:	1 - 24	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	216	Location:	1 - 24	Floor:	1st	Cost:	2000	Duration:	10 hrs
ID:	217	Location:	1 - 24	Floor:	1st	Cost:	100	Duration:	1 hr
ID:	218	Location:	1 - 24	Floor:	1st	Cost:	1000	Duration:	8 hrs
ID:	219	Location:	1 - 24	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	220	Location:	1 - 24	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	221	Location:	1 - 24	Floor:	1st	Cost:	500	Duration:	2 hrs
ID:	230	Location:	1 - 25	Floor:	1st	Cost:	3000	Duration:	16 hrs
ID:	242	Location:	1 - 27	Floor:	1st	Cost:	3000	Duration:	16 hrs
ID:	243	Location:	1 - 27	Floor:	1st	Cost:	1000	Duration:	8 hrs
ID:	267	Location:	1 - 31	Floor:	1st	Cost:	3000	Duration:	16 hrs
ID:	268	Location:	1 - 31	Floor:	1st	Cost:	1000	Duration:	8 hrs
ID:	278	Location:	1 - 33	Floor:	1st	Cost:	3000	Duration:	16 hrs

ID:	283	Location:	1 - 34	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	284	Location:	1 - 34	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	285	Location:	1 - 34	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	286	Location:	1 - 34	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	287	Location:	1 - 34	Floor:	1st	Cost:	2000	Duration:	10 hrs
ID:	288	Location:	1 - 34	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	289	Location:	1 - 34	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	290	Location:	1 - 34	Floor:	1st	Cost:	100	Duration:	1 hr
ID:	291	Location:	1 - 34	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	292	Location:	1 - 34	Floor:	1st	Cost:	50	Duration:	.25 hrs
ID:	293	Location:	1 - 34	Floor:	1st	Cost:	1000	Duration:	8 hrs
ID:	296	Location:	1 - 34	Floor:	1st	Cost:	2000	Duration:	16 hrs
ID:	297	Location:	1 - 34	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	298	Location:	1 - 34	Floor:	1st	Cost:	300	Duration:	1.5 hrs
ID:	301	Location:	1 - 34	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	302	Location:	1 - 34	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	303	Location:	1 - 34	Floor:	1st	Cost:	50	Duration:	.25 hrs
ID:	304	Location:	1 - 34	Floor:	1st	Cost:	1000	Duration:	8 hrs
ID:	306	Location:	1 - 34	Floor:	1st	Cost:	50	Duration:	.5 hrs
ID:	307	Location:	1 - 34	Floor:	1st	Cost:	100	Duration:	1 hr
ID:	330	Location:	1 - 38	Floor:	1st	Cost:	3000	Duration:	16 hrs

Main Jail			Second Floor			Priority :	3
ID:	338	Location: 2 - 2	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	361	Location: 2 - 3	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	381	Location: 2 - 4	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	382	Location: 2 - 4	Floor: 2nd	Cost: 1000	Duration:	8 hrs	
ID:	416	Location: 2 - 10	Floor: 2nd	Cost: 2000	Duration:	16 hrs	
ID:	418	Location: 2 - 10	Floor: 2nd	Cost: 2000	Duration:	16 hrs	
ID:	419	Location: 2 - 10	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	420	Location: 2 - 10	Floor: 2nd	Cost: 50	Duration:	.5 hrs	
ID:	421	Location: 2 - 10	Floor: 2nd	Cost: 50	Duration:	.5 hrs	
ID:	422	Location: 2 - 10	Floor: 2nd	Cost: 100	Duration:	1 hr	
ID:	423	Location: 2 - 10	Floor: 2nd	Cost: 50	Duration:	.5 hrs	
ID:	425	Location: 2 - 10	Floor: 2nd	Cost: 50	Duration:	.5 hrs	
ID:	427	Location: 2 - 10	Floor: 2nd	Cost: 50	Duration:	.25 hrs	
ID:	463	Location: 2 - 14	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	491	Location: 2 - 15	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	511	Location: 2 - 16	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	541	Location: 2 - 17	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	568	Location: 2 - 18	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	602	Location: 2 - 19	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	618	Location: 2 - 20	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	641	Location: 2 - 21	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	668	Location: 2 - 22	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	694	Location: 2 - 23	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	712	Location: 2 - 24	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	732	Location: 2 - 25	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	744	Location: 2 - 26	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	755	Location: 2 - 27	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	756	Location: 2 - 27	Floor: 2nd	Cost: 200	Duration:	1 hr	
ID:	773	Location: 2 - 30	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	774	Location: 2 - 30	Floor: 2nd	Cost: 1000	Duration:	8 hrs	
ID:	809	Location: 2 - 35	Floor: 2nd	Cost: 100	Duration:	1 hr	
ID:	810	Location: 2 - 35	Floor: 2nd	Cost: 2000	Duration:	10 hrs	
ID:	811	Location: 2 - 35	Floor: 2nd	Cost: 10000	Duration:	40 hrs	
ID:	812	Location: 2 - 35	Floor: 2nd	Cost: 2000	Duration:	16 hrs	
ID:	813	Location: 2 - 35	Floor: 2nd	Cost: 2000	Duration:	16 hrs	
ID:	814	Location: 2 - 35	Floor: 2nd	Cost: 300	Duration:	1.5 hrs	
ID:	815	Location: 2 - 35	Floor: 2nd	Cost: 300	Duration:	1.5 hrs	
ID:	816	Location: 2 - 35	Floor: 2nd	Cost: 300	Duration:	1.5 hrs	
ID:	817	Location: 2 - 35	Floor: 2nd	Cost: 3000	Duration:	16 hrs	
ID:	818	Location: 2 - 35	Floor: 2nd	Cost: 50	Duration:	.25 hrs	
ID:	819	Location: 2 - 35	Floor: 2nd	Cost: 100	Duration:	1 hr	
ID:	820	Location: 2 - 35	Floor: 2nd	Cost: 50	Duration:	.5 hrs	
ID:	821	Location: 2 - 35	Floor: 2nd	Cost: 50	Duration:	.5 hrs	
ID:	822	Location: 2 - 35	Floor: 2nd	Cost: 2000	Duration:	10 hrs	
ID:	823	Location: 2 - 35	Floor: 2nd	Cost: 50	Duration:	.5 hrs	
ID:	830	Location: 2 - 35	Floor: 2nd	Cost: 2000	Duration:	16 hrs	
ID:	831	Location: 2 - 35	Floor: 2nd	Cost: 2000	Duration:	10 hrs	
ID:	832	Location: 2 - 35	Floor: 2nd	Cost: 50	Duration:	.5 hrs	
ID:	833	Location: 2 - 35	Floor: 2nd	Cost: 2000	Duration:	16 hrs	
ID:	834	Location: 2 - 35	Floor: 2nd	Cost: 300	Duration:	1.5 hrs	
ID:	835	Location: 2 - 35	Floor: 2nd	Cost: 300	Duration:	1.5 hrs	

ID:	836	Location:	2 - 35	Floor:	2nd	Cost:	200	Duration:	1 hr
ID:	837	Location:	2 - 35	Floor:	2nd	Cost:	1000	Duration:	8 hrs
ID:	838	Location:	2 - 35	Floor:	2nd	Cost:	100	Duration:	1 hr
ID:	839	Location:	2 - 35	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	840	Location:	2 - 35	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	841	Location:	2 - 35	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	887	Location:	2 - 42	Floor:	2nd	Cost:	300	Duration:	1.5 hrs
ID:	888	Location:	2 - 42	Floor:	2nd	Cost:	300	Duration:	1.5 hrs
ID:	889	Location:	2 - 42	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	890	Location:	2 - 42	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	891	Location:	2 - 42	Floor:	2nd	Cost:	2000	Duration:	10 hrs
ID:	892	Location:	2 - 42	Floor:	2nd	Cost:	3000	Duration:	20 hrs
ID:	895	Location:	2 - 42	Floor:	2nd	Cost:	100	Duration:	1 hr
ID:	896	Location:	2 - 42	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	897	Location:	2 - 42	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	902	Location:	2 - 43	Floor:	2nd	Cost:	2000	Duration:	16 hrs
ID:	903	Location:	2 - 43	Floor:	2nd	Cost:	300	Duration:	1.5 hrs
ID:	904	Location:	2 - 43	Floor:	2nd	Cost:	300	Duration:	1.5 hrs
ID:	905	Location:	2 - 43	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	906	Location:	2 - 43	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	907	Location:	2 - 43	Floor:	2nd	Cost:	50	Duration:	.25 hrs
ID:	908	Location:	2 - 43	Floor:	2nd	Cost:	100	Duration:	1 hr
ID:	909	Location:	2 - 43	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	910	Location:	2 - 43	Floor:	2nd	Cost:	1000	Duration:	8 hrs
ID:	911	Location:	2 - 43	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	921	Location:	2 - 45	Floor:	2nd	Cost:	1000	Duration:	8 hrs
ID:	922	Location:	2 - 45	Floor:	2nd	Cost:	2000	Duration:	10 hrs
ID:	923	Location:	2 - 45	Floor:	2nd	Cost:	1000	Duration:	8 hrs
ID:	924	Location:	2 - 45	Floor:	2nd	Cost:	100	Duration:	1 hr
ID:	925	Location:	2 - 45	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	926	Location:	2 - 45	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	927	Location:	2 - 45	Floor:	2nd	Cost:	500	Duration:	1 hr
ID:	928	Location:	2 - 45	Floor:	2nd	Cost:	2000	Duration:	16 hrs
ID:	929	Location:	2 - 45	Floor:	2nd	Cost:	300	Duration:	1.5 hrs
ID:	930	Location:	2 - 45	Floor:	2nd	Cost:	300	Duration:	1.5 hrs
ID:	931	Location:	2 - 45	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	935	Location:	2 - 46	Floor:	2nd	Cost:	50	Duration:	.25 hrs
ID:	936	Location:	2 - 46	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	937	Location:	2 - 46	Floor:	2nd	Cost:	50	Duration:	.5 hrs
ID:	938	Location:	2 - 46	Floor:	2nd	Cost:	1000	Duration:	8 hrs
ID:	939	Location:	2 - 46	Floor:	2nd	Cost:	500	Duration:	1 hr
ID:	940	Location:	2 - 46	Floor:	2nd	Cost:	2000	Duration:	16 hrs
ID:	941	Location:	2 - 47	Floor:	2nd	Cost:	300	Duration:	1.5 hrs
ID:	942	Location:	2 - 47	Floor:	2nd	Cost:	300	Duration:	1.5 hrs
ID:	943	Location:	2 - 47	Floor:	2nd	Cost:	50	Duration:	.5 hrs

Main Jail				Third Floor				Priority :	3
ID:	981	Location:	3 - 4	Floor:	3rd	Cost:	3000	Duration:	16 hrs
ID:	1007	Location:	3 - 8	Floor:	3rd	Cost:	2000	Duration:	16 hrs
ID:	1008	Location:	3 - 8	Floor:	3rd	Cost:	2000	Duration:	16 hrs
ID:	1009	Location:	3 - 8	Floor:	3rd	Cost:	300	Duration:	1.5 hrs
ID:	1010	Location:	3 - 8	Floor:	3rd	Cost:	300	Duration:	1.5 hrs
ID:	1013	Location:	3 - 8	Floor:	3rd	Cost:	50	Duration:	.5 hrs
ID:	1014	Location:	3 - 8	Floor:	3rd	Cost:	100	Duration:	1 hr
ID:	1015	Location:	3 - 8	Floor:	3rd	Cost:	50	Duration:	.25 hrs
ID:	1016	Location:	3 - 8	Floor:	3rd	Cost:	3000	Duration:	16 hrs
ID:	1017	Location:	3 - 8	Floor:	3rd	Cost:	50	Duration:	.5 hrs
ID:	1054	Location:	3 - 15	Floor:	3rd	Cost:	2000	Duration:	16 hrs
ID:	1055	Location:	3 - 15	Floor:	3rd	Cost:	100	Duration:	1 hr
ID:	1056	Location:	3 - 15	Floor:	3rd	Cost:	50	Duration:	.5 hrs
ID:	1057	Location:	3 - 15	Floor:	3rd	Cost:	50	Duration:	.25 hrs
ID:	1059	Location:	3 - 15	Floor:	3rd	Cost:	300	Duration:	1.5 hrs
ID:	1060	Location:	3 - 15	Floor:	3rd	Cost:	300	Duration:	1.5 hrs
ID:	1066	Location:	3 - 17	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1114	Location:	3 - 18	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1143	Location:	3 - 19	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1183	Location:	3 - 20	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1218	Location:	3 - 21	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1251	Location:	3 - 22	Floor:	3rd	Cost:	See *9	Duration:	See *9
Main Jail				Fourth Floor				Priority :	3
ID:	1265	Location:	4 - 1	Floor:	4th	Cost:	3000	Duration:	16 hrs
ID:	1305	Location:	4 - 10	Floor:	4th	Cost:	2000	Duration:	16 hrs
ID:	1306	Location:	4 - 10	Floor:	4th	Cost:	2000	Duration:	16 hrs
ID:	1307	Location:	4 - 10	Floor:	4th	Cost:	300	Duration:	1.5 hrs
ID:	1308	Location:	4 - 10	Floor:	4th	Cost:	300	Duration:	1.5 hrs
ID:	1311	Location:	4 - 10	Floor:	4th	Cost:	50	Duration:	.5 hrs
ID:	1312	Location:	4 - 10	Floor:	4th	Cost:	50	Duration:	.5 hrs
ID:	1313	Location:	4 - 10	Floor:	4th	Cost:	2000	Duration:	10 hrs
ID:	1314	Location:	4 - 10	Floor:	4th	Cost:	50	Duration:	.25 hrs
ID:	1315	Location:	4 - 10	Floor:	4th	Cost:	3000	Duration:	16 hrs
ID:	1316	Location:	4 - 10	Floor:	4th	Cost:	50	Duration:	.5 hrs
ID:	1317	Location:	4 - 10	Floor:	4th	Cost:	100	Duration:	1 hr
ID:	1318	Location:	4 - 10	Floor:	4th	Cost:	50	Duration:	.5 hrs
ID:	1338	Location:	4 - 14	Floor:	4th	Cost:	2000	Duration:	16 hrs
ID:	1340	Location:	4 - 14	Floor:	4th	Cost:	2000	Duration:	16 hrs
ID:	1341	Location:	4 - 14	Floor:	4th	Cost:	50	Duration:	.25 hrs
ID:	1342	Location:	4 - 14	Floor:	4th	Cost:	50	Duration:	.5 hrs
ID:	1343	Location:	4 - 14	Floor:	4th	Cost:	100	Duration:	1 hr
ID:	1344	Location:	4 - 14	Floor:	4th	Cost:	50	Duration:	.5 hrs
ID:	1388	Location:	4 - 17	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1424	Location:	4 - 18	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1492	Location:	4 - 21	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1528	Location:	4 - 22	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1561	Location:	4 - 23	Floor:	4th	Cost:	See *9	Duration:	See *9

Main Jail				Fifth Floor				Priority :	3
ID:	1614	Location:	5 - 9	Floor:	5th	Cost:	50	Duration:	.5 hrs
ID:	1617	Location:	5 - 9	Floor:	5th	Cost:	50	Duration:	.5 hrs
ID:	1618	Location:	5 - 9	Floor:	5th	Cost:	50	Duration:	.25 hrs
ID:	1619	Location:	5 - 9	Floor:	5th	Cost:	3000	Duration:	16 hrs
ID:	1620	Location:	5 - 9	Floor:	5th	Cost:	50	Duration:	.5 hrs
ID:	1621	Location:	5 - 9	Floor:	5th	Cost:	100	Duration:	1 hr
ID:	1622	Location:	5 - 9	Floor:	5th	Cost:	50	Duration:	.5 hrs
ID:	1623	Location:	5 - 9	Floor:	5th	Cost:	2000	Duration:	10 hrs
ID:	1639	Location:	5 - 11	Floor:	5th	Cost:	50	Duration:	.5 hrs
ID:	1640	Location:	5 - 11	Floor:	5th	Cost:	50	Duration:	.5 hrs
ID:	1646	Location:	5 - 11	Floor:	5th	Cost:	50	Duration:	.5 hrs
ID:	1647	Location:	5 - 11	Floor:	5th	Cost:	50	Duration:	.25 hrs
ID:	1648	Location:	5 - 11	Floor:	5th	Cost:	50	Duration:	.5 hrs
ID:	1649	Location:	5 - 11	Floor:	5th	Cost:	50	Duration:	.5 hrs
ID:	1650	Location:	5 - 11	Floor:	5th	Cost:	100	Duration:	1 hr
ID:	1691	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1729	Location:	5 - 17	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1762	Location:	5 - 18	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1795	Location:	5 - 19	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1800	Location:	5 - 19	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1831	Location:	5 - 20	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1868	Location:	5 - 21	Floor:	5th	Cost:	See *9	Duration:	See *9
Main Jail				Sixth Floor				Priority :	3
ID:	1898	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1941	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1978	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2016	Location:	6 - 5	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2051	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2090	Location:	6 - 7	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2106	Location:	6 - 9	Floor:	6th	Cost:	3000	Duration:	16 hrs
ID:	2153	Location:	6 - 16	Floor:	6th	Cost:	2000	Duration:	16 hrs
ID:	2154	Location:	6 - 16	Floor:	6th	Cost:	2000	Duration:	16 hrs
ID:	2155	Location:	6 - 16	Floor:	6th	Cost:	300	Duration:	1.5 hrs
ID:	2156	Location:	6 - 16	Floor:	6th	Cost:	300	Duration:	1.5 hrs
ID:	2157	Location:	6 - 16	Floor:	6th	Cost:	50	Duration:	.5 hrs
ID:	2158	Location:	6 - 16	Floor:	6th	Cost:	50	Duration:	.5 hrs
ID:	2161	Location:	6 - 16	Floor:	6th	Cost:	50	Duration:	.25 hrs
ID:	2162	Location:	6 - 16	Floor:	6th	Cost:	50	Duration:	.5 hrs
ID:	2163	Location:	6 - 16	Floor:	6th	Cost:	100	Duration:	1 hr
ID:	2164	Location:	6 - 16	Floor:	6th	Cost:	50	Duration:	.5 hrs
ID:	2188	Location:	6 - 20	Floor:	6th	Cost:	2000	Duration:	16 hrs
ID:	2189	Location:	6 - 20	Floor:	6th	Cost:	50	Duration:	.5 hrs
ID:	2190	Location:	6 - 20	Floor:	6th	Cost:	50	Duration:	.5 hrs
ID:	2191	Location:	6 - 20	Floor:	6th	Cost:	50	Duration:	.5 hrs
ID:	2192	Location:	6 - 20	Floor:	6th	Cost:	100	Duration:	1 hr
ID:	2193	Location:	6 - 20	Floor:	6th	Cost:	50	Duration:	.5 hrs
ID:	2194	Location:	6 - 20	Floor:	6th	Cost:	50	Duration:	.25 hrs
Main Jail				Roof				Priority :	3
ID:	2206	Location:	Yard - 1	Floor:	Roof	Cost:	3000	Duration:	16 hrs
ID:	2214	Location:	Yard - 1	Floor:	Roof	Cost:	3000	Duration:	16 hrs

Main Jail				Basement				Priority :	4
ID:	6	Location:	B - 2	Floor:	Basement	Cost:	10000	Duration:	50 hrs
ID:	20	Location:	B - 4	Floor:	Basement	Cost:	See *4	Duration:	See *4
ID:	21	Location:	B - 4	Floor:	Basement	Cost:	See *4	Duration:	See *4
Main Jail				First Floor				Priority :	4
ID:	39	Location:	1 - 1	Floor:	1st	Cost:	50	Duration:	.25 hrs
ID:	40	Location:	1 - 1	Floor:	1st	Cost:	1000	Duration:	8 hrs
ID:	56	Location:	1 - 1	Floor:	1st	Cost:	10000	Duration:	50 hrs
ID:	76	Location:	1 - 5	Floor:	1st	Cost:	See *5	Duration:	See ID #85
ID:	88	Location:	1 - 7	Floor:	1st	Cost:	See *5	Duration:	See *5
ID:	107	Location:	1 - 11	Floor:	1st	Cost:	1000	Duration:	8 hrs
ID:	109	Location:	1 - 11	Floor:	1st	Cost:	50	Duration:	.25 hrs
ID:	121	Location:	1 - 14	Floor:	1st	Cost:	See *5	Duration:	See *5
ID:	178	Location:	1 - 19	Floor:	1st	Cost:	2000	Duration:	8 hrs
ID:	271	Location:	1 - 32	Floor:	1st	Cost:	See *4	Duration:	See *4
ID:	309	Location:	1 - 35	Floor:	1st	Cost:	2000	Duration:	8 hrs
ID:	310	Location:	1 - 36	Floor:	1st	Cost:	See *5	Duration:	See *5
ID:	333	Location:	1 - 38	Floor:	1st	Cost:	See *5	Duration:	See *5
Main Jail				Second Floor				Priority :	4
ID:	336	Location:	2 - 1	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	353	Location:	2 - 2	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	354	Location:	2 - 2	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	363	Location:	2 - 3	Floor:	2nd	Cost:	4000	Duration:	20 hrs
ID:	373	Location:	2 - 3	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	374	Location:	2 - 3	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	379	Location:	2 - 4	Floor:	2nd	Cost:	4000	Duration:	20 hrs
ID:	392	Location:	2 - 4	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	426	Location:	2 - 10	Floor:	2nd	Cost:	10000	Duration:	50 hrs
ID:	430	Location:	2 - 10	Floor:	2nd	Cost:	1000	Duration:	8 hrs
ID:	431	Location:	2 - 10	Floor:	2nd	Cost:	4000	Duration:	20 hrs
ID:	470	Location:	2 - 14	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	471	Location:	2 - 14	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	497	Location:	2 - 15	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	498	Location:	2 - 15	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	521	Location:	2 - 16	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	522	Location:	2 - 16	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	550	Location:	2 - 17	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	551	Location:	2 - 17	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	582	Location:	2 - 18	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	583	Location:	2 - 18	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	607	Location:	2 - 19	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	630	Location:	2 - 20	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	631	Location:	2 - 20	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	655	Location:	2 - 21	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	656	Location:	2 - 21	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	674	Location:	2 - 22	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	701	Location:	2 - 23	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	716	Location:	2 - 24	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	717	Location:	2 - 24	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	735	Location:	2 - 25	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	736	Location:	2 - 25	Floor:	2nd	Cost:	See *5	Duration:	See *5

ID:	748	Location:	2 - 26	Floor:	2nd	Cost:	See *5	Duration:	See *5
ID:	749	Location:	2 - 26	Floor:	2nd	Cost:	See *13	Duration:	See *13
ID:	757	Location:	2 - 28	Floor:	2nd	Cost:	See *4	Duration:	See *4
ID:	760	Location:	2 - 29	Floor:	2nd	Cost:	50	Duration:	.25 hrs
ID:	761	Location:	2 - 29	Floor:	2nd	Cost:	1000	Duration:	8 hrs
ID:	778	Location:	2 - 31	Floor:	2nd	Cost:	1000	Duration:	8 hrs
ID:	779	Location:	2 - 31	Floor:	2nd	Cost:	50	Duration:	.25 hrs
ID:	789	Location:	2 - 33	Floor:	2nd	Cost:	1000	Duration:	8 hrs
ID:	790	Location:	2 - 33	Floor:	2nd	Cost:	50	Duration:	.25 hrs
ID:	794	Location:	2 - 34	Floor:	2nd	Cost:	See *4	Duration:	See *4
ID:	795	Location:	2 - 34	Floor:	2nd	Cost:	2000	Duration:	8 hrs
ID:	796	Location:	2 - 34	Floor:	2nd	Cost:	4000	Duration:	20 hrs
ID:	874	Location:	2 - 40	Floor:	2nd	Cost:	1000	Duration:	8 hrs
ID:	875	Location:	2 - 40	Floor:	2nd	Cost:	50	Duration:	.25 hrs
ID:	962	Location:	2 - 50	Floor:	2nd	Cost:	1000	Duration:	8 hrs
Main Jail				Third Floor				Priority :	4
ID:	975	Location:	3 - 4	Floor:	3rd	Cost:	See *4	Duration:	See *4
ID:	984	Location:	3 - 4	Floor:	3rd	Cost:	See *10	Duration:	See *10
ID:	1029	Location:	3 - 12	Floor:	3rd	Cost:	See *4	Duration:	See *4
ID:	1032	Location:	3 - 13	Floor:	3rd	Cost:	2000	Duration:	8 hrs
ID:	1033	Location:	3 - 13	Floor:	3rd	Cost:	1000	Duration:	8 hrs
ID:	1045	Location:	3 - 15	Floor:	3rd	Cost:	4000	Duration:	20 hrs
ID:	1046	Location:	3 - 15	Floor:	3rd	Cost:	50	Duration:	.25 hrs
ID:	1047	Location:	3 - 15	Floor:	3rd	Cost:	1000	Duration:	8 hrs
ID:	1061	Location:	3 - 16	Floor:	3rd	Cost:	See *4	Duration:	See *4
ID:	1069	Location:	3 - 17	Floor:	3rd	Cost:	See *9	Duration:	See *9
ID:	1070	Location:	3 - 17	Floor:	3rd	Cost:	See *5	Duration:	See *5
ID:	1104	Location:	3 - 18	Floor:	3rd	Cost:	See *5	Duration:	See *5
ID:	1158	Location:	3 - 19	Floor:	3rd	Cost:	See *5	Duration:	See *5
ID:	1162	Location:	3 - 20	Floor:	3rd	Cost:	See *5	Duration:	See *5
ID:	1163	Location:	3 - 20	Floor:	3rd	Cost:	3000	Duration:	15 hrs
ID:	1196	Location:	3 - 21	Floor:	3rd	Cost:	See *5	Duration:	See *5
ID:	1228	Location:	3 - 22	Floor:	3rd	Cost:	See *5	Duration:	See *5

Main Jail				Fourth Floor				Priority :	4
ID:	1266	Location:	4 - 1	Floor:	4th	Cost:	See *5	Duration:	See *5
ID:	1267	Location:	4 - 1	Floor:	4th	Cost:	See *10	Duration:	See *10
ID:	1284	Location:	4 - 2	Floor:	4th	Cost:	See *4	Duration:	See *4
ID:	1304	Location:	4 - 9	Floor:	4th	Cost:	See *4	Duration:	See *4
ID:	1345	Location:	4 - 14	Floor:	4th	Cost:	10000	Duration:	50 hrs
ID:	1347	Location:	4 - 14	Floor:	4th	Cost:	1000	Duration:	8 hrs
ID:	1348	Location:	4 - 14	Floor:	4th	Cost:	50	Duration:	.25 hrs
ID:	1358	Location:	4 - 15	Floor:	4th	Cost:	1000	Duration:	8 hrs
ID:	1359	Location:	4 - 15	Floor:	4th	Cost:	2000	Duration:	8 hrs
ID:	1361	Location:	4 - 16	Floor:	4th	Cost:	See *4	Duration:	See *4
ID:	1391	Location:	4 - 17	Floor:	4th	Cost:	See *9	Duration:	See *9
ID:	1392	Location:	4 - 17	Floor:	4th	Cost:	See *5	Duration:	See *5
ID:	1403	Location:	4 - 18	Floor:	4th	Cost:	See *5	Duration:	See *5
ID:	1461	Location:	4 - 19	Floor:	4th	Cost:	See *5	Duration:	See *5
ID:	1462	Location:	4 - 20	Floor:	4th	Cost:	3000	Duration:	15 hrs
ID:	1463	Location:	4 - 20	Floor:	4th	Cost:	See *5	Duration:	See *5
ID:	1465	Location:	4 - 21	Floor:	4th	Cost:	See *5	Duration:	See *5
ID:	1500	Location:	4 - 22	Floor:	4th	Cost:	See *5	Duration:	See *5
ID:	1535	Location:	4 - 23	Floor:	4th	Cost:	See *5	Duration:	See *5
Main Jail				Fifth Floor				Priority :	4
ID:	1586	Location:	5 - 1	Floor:	5th	Cost:	See *10	Duration:	See *10
ID:	1587	Location:	5 - 1	Floor:	5th	Cost:	See *5	Duration:	See *5
ID:	1590	Location:	5 - 1	Floor:	5th	Cost:	See *4	Duration:	See *4
ID:	1607	Location:	5 - 8	Floor:	5th	Cost:	See *4	Duration:	See *4
ID:	1637	Location:	5 - 11	Floor:	5th	Cost:	1000	Duration:	8 hrs
ID:	1638	Location:	5 - 11	Floor:	5th	Cost:	50	Duration:	.25 hrs
ID:	1651	Location:	5 - 11	Floor:	5th	Cost:	10000	Duration:	50 hrs
ID:	1661	Location:	5 - 14	Floor:	5th	Cost:	See *4	Duration:	See *4
ID:	1664	Location:	5 - 15	Floor:	5th	Cost:	2000	Duration:	8 hrs
ID:	1665	Location:	5 - 15	Floor:	5th	Cost:	1000	Duration:	8 hrs
ID:	1694	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1697	Location:	5 - 16	Floor:	5th	Cost:	See *5	Duration:	See *5
ID:	1698	Location:	5 - 16	Floor:	5th	Cost:	See *9	Duration:	See *9
ID:	1721	Location:	5 - 17	Floor:	5th	Cost:	See *5	Duration:	See *5
ID:	1768	Location:	5 - 18	Floor:	5th	Cost:	See *5	Duration:	See *5
ID:	1772	Location:	5 - 19	Floor:	5th	Cost:	3000	Duration:	15 hrs
ID:	1773	Location:	5 - 19	Floor:	5th	Cost:	See *5	Duration:	See *5
ID:	1813	Location:	5 - 20	Floor:	5th	Cost:	See *5	Duration:	See *5
ID:	1847	Location:	5 - 21	Floor:	5th	Cost:	See *5	Duration:	See *5
ID:	1874	Location:	5 - 22	Floor:	5th	Cost:	See *5	Duration:	See *5

Main Jail				Sixth Floor				Priority :	4
ID:	1901	Location:	6 - 1	Floor:	6th	Cost:	See *5	Duration:	See *5
ID:	1902	Location:	6 - 1	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1915	Location:	6 - 2	Floor:	6th	Cost:	See *5	Duration:	See *5
ID:	1944	Location:	6 - 2	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1951	Location:	6 - 3	Floor:	6th	Cost:	See *5	Duration:	See *5
ID:	1981	Location:	6 - 3	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	1982	Location:	6 - 3	Floor:	6th	Cost:	See *5	Duration:	See *5
ID:	1986	Location:	6 - 4	Floor:	6th	Cost:	See *5	Duration:	See *5
ID:	1989	Location:	6 - 5	Floor:	6th	Cost:	See *5	Duration:	See *5
ID:	2025	Location:	6 - 6	Floor:	6th	Cost:	See *5	Duration:	See *5
ID:	2057	Location:	6 - 6	Floor:	6th	Cost:	See *9	Duration:	See *9
ID:	2063	Location:	6 - 7	Floor:	6th	Cost:	See *5	Duration:	See *5
ID:	2097	Location:	6 - 8	Floor:	6th	Cost:	See *4	Duration:	See *4
ID:	2107	Location:	6 - 9	Floor:	6th	Cost:	See *10	Duration:	See *10
ID:	2108	Location:	6 - 9	Floor:	6th	Cost:	See *5	Duration:	See *5
ID:	2125	Location:	6 - 9	Floor:	6th	Cost:	See *11	Duration:	See *11
ID:	2127	Location:	6 - 9	Floor:	6th	Cost:	See *4	Duration:	See *4
ID:	2130	Location:	6 - 10	Floor:	6th	Cost:	See *4	Duration:	See *4
ID:	2182	Location:	6 - 20	Floor:	6th	Cost:	50	Duration:	.25 hrs
ID:	2183	Location:	6 - 20	Floor:	6th	Cost:	1000	Duration:	8 hrs
ID:	2195	Location:	6 - 20	Floor:	6th	Cost:	10000	Duration:	50 hrs
ID:	2201	Location:	6 - 21	Floor:	6th	Cost:	See *4	Duration:	See *4
ID:	2204	Location:	6 - 22	Floor:	6th	Cost:	2000	Duration:	8 hrs
ID:	2205	Location:	6 - 22	Floor:	6th	Cost:	1000	Duration:	8 hrs
Main Jail				Roof				Priority :	4
ID:	2213	Location:	Yard - 1	Floor:	Roof	Cost:	2000	Duration:	8 hrs

Main Annex Jail

B - 1 Holding Cell

Priority:	3	ID:	1	Floor:	Basement	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	2	Floor:	Basement	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	3	Floor:	Basement	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	4	Floor:	Basement	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	5	Floor:	Basement	Cost:	$8,000	Duration:	40 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								

B - 2 Staff Restroom

Priority:	4	ID:	6	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
Category:	Accessible Clearance					State:	11B-304.3	Federal:	304.3
Issue:	Required 60" diameter circle or 'T'-shaped clear floor space not provided within room								
Recommendation:	Provide required clearance								
Priority:	1	ID:	7	Floor:	Basement	Cost:	$6,000	Duration:	18 hrs
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	1	ID:	8	Floor:	Basement	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	9	Floor:	Basement	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.1	Federal:	703.5.1
Issue:	Toilet door sign not contrasting colors								
Recommendation:	Remove and replace sign per current standards								
Priority:	3	ID:	10	Floor:	Basement	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	3	ID:	11	Floor:	Basement	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								

Priority:	3	ID:	12	Floor:	Basement	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	3	ID:	13	Floor:	Basement	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	3	ID:	14	Floor:	Basement	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	15	Floor:	Basement	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	16	Floor:	Basement	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	1	ID:	17	Floor:	Basement	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								

B - 3 Guard Station

Priority:	1	ID:	18	Floor:	Basement	Cost:	$4,000	Duration:	20 hrs
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								
Priority:	2	ID:	19	Floor:	Basement	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum								
Recommendation:	Provide required reach range								

B - 4 Tunnel - to South Annex Jail

Priority:	4	ID:	20	Floor:	Basement	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								
Priority:	4	ID:	21	Floor:	Basement	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								
Priority:	1	ID:	22	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Directional slope of walk over 5.0%								
Recommendation:	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with hanc								

Priority:	1	ID:	23	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Directional slope of walk over 5.0%								
Recommendation:	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with hanc								
Priority:	1	ID:	24	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Directional slope of walk over 5.0%								
Recommendation:	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with hanc								
Priority:	1	ID:	25	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Directional slope of walk over 5.0%								
Recommendation:	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with hanc								

B - 5 Staff Tunnel - to South Annex Jail

Priority:	1	ID:	26	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Directional slope of walk over 5.0%								
Recommendation:	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with hanc								
Priority:	1	ID:	27	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Directional slope of walk over 5.0%								
Recommendation:	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with hanc								
Priority:	1	ID:	28	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Directional slope of walk over 5.0%								
Recommendation:	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with hanc								
Priority:	1	ID:	29	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Directional slope of walk over 5.0%								
Recommendation:	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with hanc								
Priority:	1	ID:	30	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Directional slope of walk over 5.0%								
Recommendation:	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with hanc								
Priority:	1	ID:	31	Floor:	Basement	Cost:	$10,000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								

B - 6 Elevator - Vestubule

Priority:	2	ID:	32	Floor:	Basement	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum								
Recommendation:	Provide required reach range								

Main Annex Jail

1 - 1 Exam Room

Priority:	1	ID:	33	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	34	Floor:	1st	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	35	Floor:	1st	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	2	ID:	36	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	37	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	38	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	4	ID:	39	Floor:	1st	Cost:	$50	Duration:	.25 hrs
Category:	Sinks (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate piping as required to protect against contact								
Priority:	4	ID:	40	Floor:	1st	Cost:	$1,000	Duration:	8 hrs
Category:	Sinks (ADULT)					State:	11B-606.3	Federal:	606.3
Issue:	Height of rim or counter measured over 34" AFF								
Recommendation:	Reset sink/or provide maximum 34" AFF counter								
Priority:	2	ID:	41	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	3	ID:	42	Floor:	1st	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	1	ID:	43	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

Priority:	1	ID:	44	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.1	Federal:	703.5.1
Issue:	Toilet door sign not contrasting colorsno sign								
Recommendation:	Remove and replace sign per current standards								
Priority:	1	ID:	45	Floor:	1st	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	3	ID:	46	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	47	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	48	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	49	Floor:	1st	Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	50	Floor:	1st	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	3	ID:	51	Floor:	1st	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	52	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	53	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	54	Floor:	1st	Cost:	$500	Duration:	2 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.2	Federal:	606.2
Issue:	Minimum 30" x 48" clear floor space not provided								
Recommendation:	Provide 30" X 48" clearance								
Priority:	1	ID:	55	Floor:	1st	Cost:	$1,000	Duration:	4 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	4	ID:	56	Floor:	1st	Cost:	$10,000	Duration:	50 hrs
Category:	Accessible Clearance					State:	11B-304.3	Federal:	304.3
Issue:	Required 60" diameter circle or 'T'-shaped clear floor space not provided within room								
Recommendation:	Provide required clearance								
Priority:	2	ID:	57	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	58	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	59	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	60	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

1 - 2 Female Clothing

Priority:	1	ID:	61	Floor:	1st	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	62	Floor:	1st	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	3	ID:	63	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	2	ID:	64	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

1 - 3 Strip Room

Priority:	1	ID:	65	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

1 - 4								Sergeant Office
Priority:	1	ID:	66	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	67	Floor:	1st	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
1 - 5								Pre-book-1
Priority:	2	ID:	69	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	70	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	71	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	72	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	1	ID:	73	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	3	ID:	74	Floor:	1st	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	75	Floor:	1st	Cost:	See ID #74	Duration:	See ID #74
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	4	ID:	76	Floor:	1st	Cost:	See *5	Duration:	See ID #85
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	77	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	1	ID:	78	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								

1 - 6 Booking

Priority:	2	ID:	79	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
Category:	Counters					State:	11B-904.4.1	Federal:	N/A
Issue:	Counter height measured over 34" AFF (parallel approach)								
Recommendation:	Recess a portion of the counter to be 34" maximum AFF								

1 - 7 Detox

Priority:	1	ID:	80	Floor:	1st	Cost:	$5,000	Duration:	30 hrs
Category:	Walks					State:	11B-303.2	Federal:	303.2
Issue:	Changes in level along route exceeds 1/4" maximum height								
Recommendation:	Provide affected concrete walk where level changes occur of 1/4" high								
Priority:	2	ID:	81	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	82	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	83	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	84	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	85	Floor:	1st	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	1	ID:	86	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	87	Floor:	1st	Cost:	See ID #85	Duration:	See ID #85
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	4	ID:	88	Floor:	1st	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								

1 - 8								Main Booking
Priority:	2	ID:	89	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
Category:	Counters					State:	11B-904.4.1	Federal:	N/A
Issue:	Counter height measured over 34" AFF (parallel approach)								
Recommendation:	Recess a portion of the counter to be 34" maximum AFF								
Priority:	2	ID:	90	Floor:	1st	Cost:	$200	Duration:	2 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide assistance placard								
1 - 9								Intoxilizer
Priority:	1	ID:	91	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	92	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	93	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	94	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								
Priority:	2	ID:	95	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	96	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	97	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	98	Floor:	1st	Cost:	$50	Duration:	.25 hrs
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	2	ID:	99	Floor:	1st	Cost:	$800	Duration:	4 hrs
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								

Priority:	2	ID:	100	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Detention Facility Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	2	ID:	101	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Detention Facility Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	2	ID:	102	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	103	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

1 - 10 Booking

Priority:	1	ID:	104	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								

1 - 11 Finger Prints / ID Room

Priority:	1	ID:	68	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	105	Floor:	1st	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								
Priority:	2	ID:	106	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	4	ID:	107	Floor:	1st	Cost:	$1,000	Duration:	8 hrs
Category:	Sinks (ADULT)					State:	11B-606.3	Federal:	606.3
Issue:	Height of rim or counter measured over 34" AFF								
Recommendation:	Reset sink/or provide maximum 34" AFF counter								
Priority:	2	ID:	108	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.3.2	Federal:	308.3.2
Issue:	Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is betwee								
Recommendation:	Provide required reach range								
Priority:	4	ID:	109	Floor:	1st	Cost:	$50	Duration:	.25 hrs
Category:	Sinks (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate piping as required to protect against contact								

Priority:	1	ID:	110	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign over 40"-70" AFF (to bottom) not 5/8" minimum								
Recommendation:	Remove and replace sign per current standards								
Priority:	1	ID:	111	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

1 - 12 Services Unit

Priority:	2	ID:	112	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	113	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	114	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	115	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	116	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

1 - 13 Elevator Vestibule

Priority:	1	ID:	117	Floor:	1st	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	118	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	119	Floor:	1st	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	2	ID:	120	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

1 - 14 Visitation

Priority:	4	ID:	121	Floor:	1st	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	122	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

1 - 15 Lobby

Priority:	2	ID:	123	Floor:	1st	Cost:	See *12	Duration:	See *12
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	124	Floor:	1st	Cost:	$6,000	Duration:	20 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 12" maneuvering clearance on latch side of interior door not provided (push side,								
Recommendation:	Provide minimum 12" maneuvering clearance								
Priority:	1	ID:	125	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	3	ID:	126	Floor:	1st	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Automatic hand dryer measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	127	Floor:	1st	Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	128	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	129	Floor:	1st	Cost:	$500	Duration:	1 hr
Category:	Water Closet Compartments (GENERAL)					State:	11B-604.8.2.2	Federal:	604.8.2.2
Issue:	Lever, pull or push type handle on inside face near latch of door not provided								
Recommendation:	Provide required handle per current standards								
Priority:	3	ID:	130	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	3	ID:	131	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								

Priority:	3	ID:	132	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	133	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser located over 9" from edge of toilet								
Recommendation:	Relocate TPD with 9" maximum from edge of toilet								
Priority:	3	ID:	134	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	135	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	136	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								
Priority:	3	ID:	137	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	N/A
Issue:	Water closet clearance not 48" long measured from front of toilet to front wall or door								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	138	Floor:	1st	Cost:	$100	Duration:	0.5
Category:	Water Closet Compartments (GENERAL)					State:	11B-604.8.1.2	Federal:	604.8.1.2
Issue:	Automatic closing device not provided on accessible compartment door								
Recommendation:	Provide required closing device								
Priority:	1	ID:	139	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	140	Floor:	1st	Cost:	$6,000	Duration:	20 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, f								
Recommendation:	Provide minimum 12" maneuvering clearance								
Priority:	3	ID:	141	Floor:	1st	Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	142	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	143	Floor:	1st	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Automatic hand dryer measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								

Priority:	2	ID:	144	Floor:	1st	Cost:	$500	Duration:	1 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	3	ID:	145	Floor:	1st	Cost:	$100	Duration:	0.5
Category:	Water Closet Compartments (GENERAL)					State:	11B-604.8.1.2	Federal:	604.8.1.2
Issue:	Automatic closing device not provided on accessible compartment door								
Recommendation:	Provide required closing device								
Priority:	3	ID:	146	Floor:	1st	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	2	ID:	147	Floor:	1st	Cost:	$50	Duration:	.5 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	3	ID:	148	Floor:	1st	Cost:	$500	Duration:	1 hr
Category:	Water Closet Compartments (GENERAL)					State:	11B-604.8.2.2	Federal:	604.8.2.2
Issue:	Lever, pull or push type handle on outside face near latch of door not provided								
Recommendation:	Provide required handle per current standards								
Priority:	3	ID:	149	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	3	ID:	150	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	3	ID:	151	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	152	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	153	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	154	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	155	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser not located min. 7" from edge of toilet								
Recommendation:	Relocate TPD with 7" minimum from edge of toilet								

Priority:	2	ID:	156	Floor:	1st	Cost:	See *12	Duration:	See *12
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	157	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
Category:	Counters					State:	11B-904.4.1	Federal:	N/A
Issue:	Counter height measured over 34" AFF (parallel approach)								
Recommendation:	Recess a portion of the counter to be 34" maximum AFF								

1 - 16 Line-Up

Priority:	1	ID:	158	Floor:	1st	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	159	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	160	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	3	ID:	161	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	3	ID:	162	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	163	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	164	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser not located min. 7" from edge of toilet								
Recommendation:	Relocate TPD with 7" minimum from edge of toilet								
Priority:	2	ID:	165	Floor:	1st	Cost:	$500	Duration:	1 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	3	ID:	166	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	N/A
Issue:	Water closet clearance not 48" long measured from front of toilet to front wall or door								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	167	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								

Priority:	3	ID:	168	Floor:	1st	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	169	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	2	ID:	170	Floor:	1st	Cost:	$50	Duration:	.5 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	3	ID:	172	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								

1 - 17 Corridor

Priority:	2	ID:	171	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
Category:	Counters					State:	11B-904.4.1	Federal:	N/A
Issue:	Counter height measured over 34" AFF (parallel approach)								
Recommendation:	Recess a portion of the counter to be 34" maximum AFF								
Priority:	1	ID:	173	Floor:	1st	Cost:	$2,000	Duration:	8 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	174	Floor:	1st	Cost:	$2,000	Duration:	8 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

1 - 18 Records

Priority:	1	ID:	175	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	176	Floor:	1st	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	177	Floor:	1st	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, r								
Recommendation:	Provide minimum 12" maneuvering clearance								

1 - 19 Staff Restroom

Priority:	4	ID: 178	Floor: 1st		Cost:	$2,000	Duration:	8 hrs
Category:	Drinking Fountains				State:	11B-211.3	Federal:	211.3
Issue:	50% of all drinking fountains are not standing accessible							
Recommendation:	Install for standing persons drinking fountain(s)							
Priority:	1	ID: 179	Floor: 1st		Cost:	See *1	Duration:	See *1
Category:	Interior Signage				State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille							
Recommendation:	Provide sign per current standards							
Priority:	1	ID: 180	Floor: 1st		Cost:	See *2	Duration:	See *2
Category:	Doors / Gates				State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open							
Recommendation:	Adjust closing device							
Priority:	3	ID: 181	Floor: 1st		Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)				State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)							
Recommendation:	Insulate as required to protect against contact							
Priority:	3	ID: 182	Floor: 1st		Cost:	$50	Duration:	.5 hrs
Category:	Accessories				State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part							
Recommendation:	Reset accessories to maximum 40" AFF to operating controls							
Priority:	3	ID: 183	Floor: 1st		Cost:	$500	Duration:	1 hr
Category:	Water Closet Compartments (GENERAL)				State:	11B-604.8.2.2	Federal:	604.8.2.2
Issue:	Lever, pull or push type handle on inside face near latch of door not provided							
Recommendation:	Provide required handle per current standards							
Priority:	3	ID: 184	Floor: 1st		Cost:	$100	Duration:	1 hr
Category:	Accessories				State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF							
Recommendation:	Reset hook to maximum 48" AFF							
Priority:	3	ID: 185	Floor: 1st		Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)				State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall							
Recommendation:	Adjust as required and/or provide new bar per current standards							
Priority:	3	ID: 186	Floor: 1st		Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)				State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side							
Recommendation:	Adjust as required and/or provide new bar per current standards							
Priority:	3	ID: 187	Floor: 1st		Cost:	$50	Duration:	.5 hrs
Category:	Accessories				State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part							
Recommendation:	Reset accessories to maximum 40" AFF to operating controls							
Priority:	3	ID: 188	Floor: 1st		Cost:	$4,000	Duration:	20 hrs
Category:	Water Closet Compartments (GENERAL)				State:	11B-604.8.1.1	Federal:	N/A
Issue:	Water closet compartment not 60" deep for maneuvering for side opening door in front of to							
Recommendation:	Provide required clearance or provide alternative accessible water closet							
Priority:	3	ID: 189	Floor: 1st		Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)				State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com							
Recommendation:	Relocate/adjust as required							

Priority:	3	ID:	190	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser not located min. 7" from edge of toilet								
Recommendation:	Relocate TPD with 7" minimum from edge of toilet								
Priority:	1	ID:	191	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	3	ID:	192	Floor:	1st	Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	193	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	194	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	2	ID:	195	Floor:	1st	Cost:	$500	Duration:	1 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	3	ID:	196	Floor:	1st	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	3	ID:	197	Floor:	1st	Cost:	$500	Duration:	1 hr
Category:	Water Closet Compartments (GENERAL)					State:	11B-604.8.2.2	Federal:	604.8.2.2
Issue:	Lever, pull or push type handle on inside face near latch of door not provided								
Recommendation:	Provide required handle per current standards								
Priority:	3	ID:	198	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								
Priority:	3	ID:	199	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	3	ID:	200	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	201	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser not located min. 7" from edge of toilet								
Recommendation:	Relocate TPD with 7" minimum from edge of toilet								

1 - 20 Transportation

Priority:	1	ID:	202	Floor:	1st	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								
Priority:	3	ID:	203	Floor:	1st	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	1	ID:	204	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

1 - 21 Storage

Priority:	1	ID:	205	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	206	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	2	ID:	207	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

1 - 22 Corridor

Priority:	2	ID:	208	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	209	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

1 - 23 Receiving

Priority:	2	ID:	210	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	1	ID:	211	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.7.2.6	Federal:	N/A
Issue:	Unisex toilet door sign not 1/4" thick of contrasting circle and triangle symbols with the circle								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	212	Floor:	1st	Cost:	$6,000	Duration:	18 hrs
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	3	ID:	213	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	3	ID:	214	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	215	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	N/A
Issue:	Sidewall grab bar less than 24" from front of toilet to far edge								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	216	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	217	Floor:	1st	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	218	Floor:	1st	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	3	ID:	219	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	220	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	221	Floor:	1st	Cost:	$500	Duration:	2 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.2	Federal:	606.2
Issue:	Minimum 30" x 48" clear floor space not provided								
Recommendation:	Provide 30" X 48" clearance								

Priority:	1	ID:	222	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	2	ID:	223	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	224	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	225	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	226	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	227	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	228	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	N/A
Issue:	Water closet clearance not 48" long measured from front of toilet to front wall or door								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	229	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	3	ID:	230	Floor:	1st	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	231	Floor:	1st	Cost:	See ID #230	Duration:	See ID #230
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	1	ID:	232	Floor:	1st	Cost:	$800	Duration:	See ID #278
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								

1 - 26 Janitor

Priority:	1	ID:	233	Floor:	1st	Cost:	See *1	Duration:	See ID #330
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	234	Floor:	1st	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								

1 - 27 Pre-release - B

Priority:	1	ID:	235	Floor:	1st	Cost:	$6,000	Duration:	18 hrs
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	236	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	237	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	238	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	1	ID:	239	Floor:	1st	Cost:	$800	Duration:	4 hrs
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	2	ID:	240	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	241	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	3	ID:	242	Floor:	1st	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.3	Federal:	606.3
Issue:	Height of lavatory rim or counter measured over 34" AFF								
Recommendation:	Reset lavatory as required								
Priority:	3	ID:	243	Floor:	1st	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								

Priority:	2	ID:	244	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	245	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								

1 - 28 Stairwell

Priority:	1	ID:	246	Floor:	1st	Cost:	$5,000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	2	ID:	247	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

1 - 29 Dress-out

Priority:	2	ID:	248	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
Category:	Counters					State:	11B-904.4.1	Federal:	N/A
Issue:	Counter height measured over 34" AFF (parallel approach)								
Recommendation:	Recess a portion of the counter to be 34" maximum AFF								

1 - 30 Mail Room

Priority:	1	ID:	249	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

1 - 31 Male Dress-In

Priority:	1	ID:	250	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	2	ID:	251	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
Category:	Counters					State:	11B-904.4.1	Federal:	N/A
Issue:	Counter height measured over 34" AFF (parallel approach)								
Recommendation:	Recess a portion of the counter to be 34" maximum AFF								
Priority:	1	ID:	252	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	253	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	2	ID:	254	Floor:	1st	Cost:	$2,000	Duration:	20 hrs
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								

Priority:	2	ID:	255	Floor:	1st	Cost:	$800	Duration:	1 hr
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	256	Floor:	1st	Cost:	$800	Duration:	1 hr
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	257	Floor:	1st	Cost:	$800	Duration:	1 hr
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	258	Floor:	1st	Cost:	$800	Duration:	1 hr
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	259	Floor:	1st	Cost:	$200	Duration:	1 hr
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	260	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	261	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	262	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	263	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	264	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	604.2
Issue:	Centerline of toilet not 17"-19" from sidewall or partition in ambulatory accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	265	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	266	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								

Priority:	3	ID:	267	Floor:	1st	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	3	ID:	268	Floor:	1st	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								

1 - 32 Corridor

Priority:	1	ID:	269	Floor:	1st	Cost:	$2,000	Duration:	8 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	270	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	4	ID:	271	Floor:	1st	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								

1 - 33 Enroute

Priority:	2	ID:	272	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	273	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	1	ID:	274	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	275	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
Category:	Counters					State:	11B-904.4.1	Federal:	N/A
Issue:	Counter height measured over 34" AFF (parallel approach)								
Recommendation:	Recess a portion of the counter to be 34" maximum AFF								
Priority:	2	ID:	276	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	277	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								

Priority:	3	ID:	278	Floor:	1st	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	279	Floor:	1st	Cost:	See ID #278	Duration:	See ID #278
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	2	ID:	280	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

1 - 34 Staff Restroom

Priority:	1	ID:	281	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	282	Floor:	1st	Cost:	$6,000	Duration:	18 hrs
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	3	ID:	283	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								
Priority:	3	ID:	284	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	3	ID:	285	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	286	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	287	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	288	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	289	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								

Priority:	3	ID:	290	Floor:	1st	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	291	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	292	Floor:	1st	Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	293	Floor:	1st	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	1	ID:	294	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	295	Floor:	1st	Cost:	$6,000	Duration:	18 hrs
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	3	ID:	296	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	3	ID:	297	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	298	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	299	Floor:	1st	Cost:	$100	Duration:	1 hr
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	300	Floor:	1st	Cost:	$500	Duration:	1 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	3	ID:	301	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								

Priority:	3	ID:	302	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	303	Floor:	1st	Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	304	Floor:	1st	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	2	ID:	305	Floor:	1st	Cost:	$200	Duration:	1 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	3	ID:	306	Floor:	1st	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	307	Floor:	1st	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	308	Floor:	1st	Cost:	$50	Duration:	.5 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								

1 - 35 Corridor

Priority:	4	ID:	309	Floor:	1st	Cost:	$2,000	Duration:	8 hrs
Category:	Drinking Fountains					State:	11B-211.3	Federal:	211.3
Issue:	50% of all drinking fountains are not standing accessible								
Recommendation:	Install for standing persons drinking fountain(s)								

1 - 36 Visitation

Priority:	4	ID:	310	Floor:	1st	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								

1 - 37 Male Dress-In

Priority:	2	ID:	313	Floor:	1st	Cost:	$2,000	Duration:	20 hrs
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	314	Floor:	1st	Cost:	$800	Duration:	1 hr
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								

Priority:	2	ID:	315	Floor:	1st	Cost:	$800	Duration:	1 hr
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	316	Floor:	1st	Cost:	$800	Duration:	1 hr
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	317	Floor:	1st	Cost:	$800	Duration:	1 hr
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	318	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	319	Floor:	1st	Cost:	$2,000	Duration:	10 hrs
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	311	Floor:	1st	Cost:	$4,000	Duration:	20 hrs
Category:	Counters					State:	11B-904.4.1	Federal:	N/A
Issue:	Counter height measured over 34" AFF (parallel approach)								
Recommendation:	Recess a portion of the counter to be 34" maximum AFF								
Priority:	1	ID:	312	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	1	ID:	320	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	321	Floor:	1st	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								
Priority:	1	ID:	322	Floor:	1st	Cost:	$6,000	Duration:	20 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Level area in direction of door swing (pull side) not 60" minimum length/maneuvering clear								
Recommendation:	Provide required clearance area								

Priority:	2	ID:	323	Floor:	1st	Cost:	$8,000	Duration:	40 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	324	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								

Priority:	2	ID:	325	Floor:	1st	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	326	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	327	Floor:	1st	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	1	ID:	328	Floor:	1st	Cost:	$5,000	Duration:	30 hrs
Category:	Walks					State:	11B-303.2	Federal:	303.2
Issue:	Changes in level along route exceeds 1/4" maximum height								
Recommendation:	Provide affected concrete walk where level changes occur of 1/4" high								
Priority:	1	ID:	329	Floor:	1st	Cost:	$5,000	Duration:	40 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	3	ID:	330	Floor:	1st	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	331	Floor:	1st	Cost:	See ID #330	Duration:	See ID #330
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	2	ID:	332	Floor:	1st	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	333	Floor:	1st	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								

Elevator 4

Priority:	1	ID:	334	Floor:	1st	Cost:	$5,000	Duration:	20 hrs
Category:	Elevators					State:	11B-407.4.9	Federal:	407.4.9
Issue:	Emergency communication device (telephone) not provided or over 48" AFF								
Recommendation:	Adjust as required								
Priority:	1	ID:	335	Floor:	1st	Cost:	$500	Duration:	1 hr
Category:	Elevators					State:	11B-407.1	Federal:	407.1
Issue:	rear grab bar not provided								
Recommendation:	0								

Main Annex Jail

2 - 1 Visitation - Inmate

Priority:	4	ID:	336	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	337	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								

2 - 2 Cell B4

Priority:	3	ID:	338	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	339	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	340	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	2	ID:	341	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	342	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	343	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	344	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	345	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	346	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								

Priority:	2	ID:	347	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	348	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	349	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	350	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	351	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	352	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	353	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	4	ID:	354	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								

2 - 3 Cell B3

Priority:	2	ID:	355	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	2	ID:	356	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	357	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	358	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								

Priority:	1	ID:	359	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	360	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	3	ID:	361	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	362	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	4	ID:	363	Floor:	2nd	Cost:	$4,000	Duration:	20 hrs
Category:	Drinking Fountains					State:	11B-602.2	Federal:	602.2
Issue:	Clear floor space (30" x 48") not provided								
Recommendation:	Provide 30" X 48" clearance								
Priority:	1	ID:	364	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	365	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	366	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	367	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	368	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	369	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	370	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								

Priority:	2	ID:	371	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	372	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	373	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	4	ID:	374	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	375	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

2 - 4 Cell B2

Priority:	2	ID:	376	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	377	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	378	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	4	ID:	379	Floor:	2nd	Cost:	$4,000	Duration:	20 hrs
Category:	Drinking Fountains					State:	11B-602.2	Federal:	602.2
Issue:	Clear floor space (30" x 48") not provided								
Recommendation:	Provide 30" X 48" clearance								
Priority:	2	ID:	380	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.2.1	Federal:	608.2.2.1
Issue:	Clear floor space (36" x 60") not provided adjacent to standard roll-in compartment								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	3	ID:	381	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	3	ID:	382	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								

Priority:	1	ID:	383	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	384	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	385	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	386	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	387	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	388	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	389	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	390	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	391	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	392	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	393	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	394	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

2 - 5 Medical Records

Priority:	1	ID:	395	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	396	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 12" maneuvering clearance on latch side of interior door not provided (push side,								
Recommendation:	Provide minimum 12" maneuvering clearance								
Priority:	2	ID:	397	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	398	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	399	Floor:	2nd	Cost:	$500	Duration:	5 hrs
Category:	Aisles					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum clear aisle width of 44" (serving two sides) not provided								
Recommendation:	Provide 44" width clearance								

2 - 6 Support Office Staff/ Secretary

Priority:	1	ID:	400	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	401	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	2	ID:	402	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	1	ID:	404	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								

2 - 7 Medical Administration

Priority:	1	ID:	403	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	405	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

Priority:	1	ID:	406	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								
Priority:	2	ID:	407	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	1	ID:	408	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	409	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								

2 - 8 Secretary

Priority:	2	ID:	410	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	1	ID:	411	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	412	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	2	ID:	413	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	1	ID:	414	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								

2 - 9 Corridor

Priority:	1	ID:	415	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								

2 - 10 Nurse Room

Priority:	3	ID:	416	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	1	ID:	417	Floor:	2nd	Cost:	$6,000	Duration:	18 hrs
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	3	ID:	418	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	3	ID:	419	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	3	ID:	420	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	421	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	422	Floor:	2nd	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	423	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	2	ID:	424	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	3	ID:	425	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser located over 9" from edge of toilet								
Recommendation:	Relocate TPD with 9" maximum from edge of toilet								
Priority:	4	ID:	426	Floor:	2nd	Cost:	$10,000	Duration:	50 hrs
Category:	Accessible Clearance					State:	11B-304.3	Federal:	304.3
Issue:	Required 60" diameter circle or 'T'-shaped clear floor space not provided within room								
Recommendation:	Provide required clearance								
Priority:	3	ID:	427	Floor:	2nd	Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								

Priority:	2	ID:	428	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	429	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	4	ID:	430	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Sinks (ADULT)					State:	11B-606.3	Federal:	606.3
Issue:	Height of rim or counter measured over 34" AFF								
Recommendation:	Reset sink/or provide maximum 34" AFF counter								
Priority:	4	ID:	431	Floor:	2nd	Cost:	$4,000	Duration:	20 hrs
Category:	Sinks (GENERAL)					State:	11B-606.1	Federal:	606.1
Issue:	Accessible sink not provided								
Recommendation:	Provide accessible sink								
Priority:	2	ID:	432	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	433	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	434	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	435	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

2 - 11 Utility

Priority:	1	ID:	436	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

2 - 12 Exam Room

Priority:	2	ID:	437	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	438	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	439	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

2 - 13 Pharmacy

Priority:	2	ID:	440	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	441	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	442	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	443	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

2 - 14 Cell B1

Priority:	2	ID:	444	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	2	ID:	445	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	446	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	447	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								

Priority:	1	ID:	448	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	449	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	450	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	451	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	452	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	453	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	454	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	455	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	456	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	457	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	458	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	459	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								

Priority:	2	ID:	460	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	461	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	462	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	3	ID:	463	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	464	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	2	ID:	465	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	466	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.2	Federal:	606.2
Issue:	Minimum 30" x 48" clear floor space not provided								
Recommendation:	Provide 30" X 48" clearance								
Priority:	2	ID:	467	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	468	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	469	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	470	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	4	ID:	471	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								

Priority:	2	ID:	472	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								

2 - 15 Cell A10

Priority:	2	ID:	473	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	474	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	2	ID:	475	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	476	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	477	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	478	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	479	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	480	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	1	ID:	481	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	482	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	483	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								

Priority:	2	ID:	484	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	485	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	486	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	487	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	488	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	489	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	490	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	3	ID:	491	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	492	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	493	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.2	Federal:	606.2
Issue:	Minimum 30" x 48" clear floor space not provided								
Recommendation:	Provide 30" X 48" clearance								
Priority:	2	ID:	494	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	495	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	1	ID:	496	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	4	ID:	497	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	4	ID:	498	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	2	ID:	499	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	500	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	501	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

Priority:	2	ID:	502	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	503	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	504	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	505	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	2	ID:	506	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	507	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								

Priority:	2	ID:	508	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	509	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	510	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	3	ID:	511	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	512	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	513	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	514	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	515	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	516	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	517	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	518	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	519	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	520	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	521	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	4	ID:	522	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								

2 - 17 Cell A8

Priority:	2	ID:	523	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	524	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	2	ID:	525	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	526	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	527	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	528	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	529	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	530	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	531	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								

Priority:	1	ID:	532	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	533	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	534	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	535	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	536	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	537	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	538	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	539	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	540	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	3	ID:	541	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	542	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	543	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.2	Federal:	606.2
Issue:	Minimum 30" x 48" clear floor space not provided								
Recommendation:	Provide 30" X 48" clearance								

Priority:	2	ID:	544	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	545	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	546	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	1	ID:	547	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	2	ID:	548	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	549	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	4	ID:	550	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	4	ID:	551	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								

2 - 18 Cell A7

Priority:	2	ID:	552	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	553	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	554	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	1	ID:	555	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								

Priority:	2	ID:	556	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	557	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	558	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	559	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	560	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	561	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	562	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	563	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	564	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	565	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	566	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	567	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								

Priority:	3	ID:	568	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	569	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	570	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	571	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	2	ID:	572	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	573	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	574	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	575	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	576	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	577	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	578	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	579	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								

Priority:	1	ID:	580	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	2	ID:	581	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	4	ID:	582	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	4	ID:	583	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								

2 - 19 Cell A6

Priority:	1	ID:	584	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	585	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	3	ID:	586	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	587	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	4	ID:	588	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	589	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	1	ID:	590	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	591	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								

Priority:	2	ID:	592	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	593	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	594	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	595	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	596	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	597	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	4	ID:	598	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	4	ID:	599	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide assistance placard								
Priority:	2	ID:	600	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	601	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	602	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	603	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								

Priority:	4	ID:	604	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	605	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	3	ID:	606	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	3	ID:	607	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	608	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	1	ID:	609	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	610	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	611	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								

Priority:	2	ID:	612	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	4	ID:	613	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	614	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	615	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not within 6" maximum of adjacent wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								

Priority:	2	ID:	616	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	617	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.2	Federal:	606.2
Issue:	Minimum 30" x 48" clear floor space not provided								
Recommendation:	Provide 30" X 48" clearance								
Priority:	2	ID:	618	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	619	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	620	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	621	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	622	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	4	ID:	623	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	4	ID:	624	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	625	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	626	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	2	ID:	627	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	628	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	629	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	630	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	3	ID:	631	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	3	ID:	632	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

2 - 21 Cell A4

Priority:	1	ID:	633	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Directional slope of walk over 5.0%								
Recommendation:	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with handrails								
Priority:	2	ID:	634	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	635	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	636	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	637	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	638	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide assistance placard								
Priority:	1	ID:	639	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	2	ID:	640	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	641	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	642	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	2	ID:	643	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	644	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.1	Federal:	N/A
Issue:	Sidewall grab bar less than 24" from front of toilet to far edge								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	645	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	646	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured over 19" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	647	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	648	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	649	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	650	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	2	ID:	651	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								

Priority:	2	ID:	652	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	653	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	654	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	4	ID:	655	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	4	ID:	656	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								

2 - 22 Cell A3

Priority:	2	ID:	657	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	658	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	2	ID:	659	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	660	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	661	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	662	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	663	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								

Priority:	2	ID:	664	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	665	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	666	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	1	ID:	667	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	3	ID:	668	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	669	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	670	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	2	ID:	671	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	672	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	673	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	4	ID:	674	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	675	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	2	ID:	676	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Minimum 15" AFF reach range not provided / front approach								
Recommendation:	Provide required reach range								

2 - 23 Cell A2

Priority:	2	ID:	677	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	678	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	2	ID:	679	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	680	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	681	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	682	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	683	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	684	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	685	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	686	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	687	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								

Priority:	2	ID:	688	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	689	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	690	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	691	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	1	ID:	692	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	693	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	694	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	695	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	2	ID:	696	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	697	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	698	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	699	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	2	ID:	700	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	701	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								

2 - 24 Cell A1

Priority:	2	ID:	702	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	2	ID:	703	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	704	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	705	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	706	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	707	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	2	ID:	708	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	709	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	710	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	711	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	3	ID:	712	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	713	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	714	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	1	ID:	715	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	4	ID:	716	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	4	ID:	717	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	718	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	719	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	720	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	721	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	2	ID:	722	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	723	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	724	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.2.3	Federal:	608.2.3
Issue:	Width opening (36") not provided at one end of 60" long alternate shower								
Recommendation:	Provide required clearance or provide alternative accessible shower								
Priority:	2	ID:	725	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	726	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	727	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	728	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	729	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	730	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	731	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	732	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	733	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	734	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	4	ID:	735	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	4	ID:	736	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	737	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

2 - 26 Cell C1

Priority:	2	ID:	738	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	739	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	740	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	741	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	742	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	743	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	744	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	745	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	1	ID:	746	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								

Priority:	2	ID:	747	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	748	Floor:	2nd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	4	ID:	749	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	2	ID:	750	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	751	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	752	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	753	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	754	Floor:	2nd	Cost:	See *13	Duration:	See *13
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								

2 - 27 Cell C1 and C2

Priority:	3	ID:	755	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	3	ID:	756	Floor:	2nd	Cost:	$200	Duration:	1 hr
Category:	Lavatories (GENERAL)					State:	11B-606.4	Federal:	606.4
Issue:	Faucet controls require tight grasping, pinching or twisting to operate								
Recommendation:	Remove and replace faucet per current standards								

2 - 28 Corridor

Priority:	4	ID:	757	Floor:	2nd	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								
Priority:	1	ID:	758	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

2 - 29 X-Ray

Priority:	1	ID:	759	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	4	ID:	760	Floor:	2nd	Cost:	$50	Duration:	.25 hrs
Category:	Sinks (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate piping as required to protect against contact								
Priority:	4	ID:	761	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Sinks (ADULT)					State:	11B-606.3	Federal:	606.3
Issue:	Height of rim or counter measured over 34" AFF								
Recommendation:	Reset sink/or provide maximum 34" AFF counter								
Priority:	2	ID:	762	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.3.2	Federal:	308.3.2
Issue:	Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is betwee								
Recommendation:	Provide required reach range								
Priority:	1	ID:	763	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								
Priority:	1	ID:	764	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	765	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	2	ID:	766	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

2 - 30 Holding Cell

Priority:	2	ID:	767	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	768	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	769	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	770	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	1	ID:	771	Floor:	2nd	Cost:	$800	Duration:	4 hrs
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	1	ID:	772	Floor:	2nd	Cost:	$5,000	Duration:	40 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	3	ID:	773	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	3	ID:	774	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								

2 - 31 Exam Room

Priority:	1	ID:	775	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	776	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	2	ID:	777	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide assistance placard								

Priority:	4	ID:	778	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Sinks (ADULT)					State:	11B-606.3	Federal:	606.3
Issue:	Height of rim or counter measured over 34" AFF								
Recommendation:	Reset sink/or provide maximum 34" AFF counter								
Priority:	4	ID:	779	Floor:	2nd	Cost:	$50	Duration:	.25 hrs
Category:	Sinks (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate piping as required to protect against contact								
Priority:	2	ID:	780	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.3.2	Federal:	308.3.2
Issue:	Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is betwee								
Recommendation:	Provide required reach range								

2 - 32 Records

Priority:	1	ID:	781	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	782	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	783	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								
Priority:	1	ID:	784	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, f								
Recommendation:	Provide minimum 12" maneuvering clearance								
Priority:	1	ID:	785	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	786	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								

2 - 33 Laboratory

Priority:	1	ID:	787	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	788	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								

Priority:	4	ID:	789	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Sinks (ADULT)					State:	11B-606.3	Federal:	606.3
Issue:	Height of rim or counter measured over 34" AFF								
Recommendation:	Reset sink/or provide maximum 34" AFF counter								
Priority:	4	ID:	790	Floor:	2nd	Cost:	$50	Duration:	.25 hrs
Category:	Sinks (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate piping as required to protect against contact								
Priority:	1	ID:	791	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	792	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								
Priority:	1	ID:	793	Floor:	2nd	Cost:	$6,000	Duration:	18 hrs
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								

2 - 34 Corridor

Priority:	4	ID:	794	Floor:	2nd	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								
Priority:	4	ID:	795	Floor:	2nd	Cost:	$2,000	Duration:	8 hrs
Category:	Drinking Fountains					State:	11B-211.3	Federal:	211.3
Issue:	50% of all drinking fountains are not standing accessible								
Recommendation:	Install for standing persons drinking fountain(s)								
Priority:	4	ID:	796	Floor:	2nd	Cost:	$4,000	Duration:	20 hrs
Category:	Drinking Fountains					State:	11B-602.2	Federal:	602.2
Issue:	Clear floor space (30" x 48") not provided								
Recommendation:	Provide 30" X 48" clearance								

2 - 35 Break room

Priority:	1	ID:	797	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	798	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	799	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								

Priority:	2	ID:	800	Floor:	2nd	Cost:	See *12	Duration:	See *12
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	801	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	802	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	803	Floor:	2nd	Cost:	$1,000	Duration:	5 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								
Priority:	2	ID:	804	Floor:	2nd	Cost:	$6,000	Duration:	18 hrs
Category:	Dressing/Fitting/Locker Rooms					State:	11B-803.3	Federal:	803.3
Issue:	Door swings into room/turning space not provided								
Recommendation:	Provide turning space								
Priority:	2	ID:	805	Floor:	2nd	Cost:	$4,000	Duration:	20 hrs
Category:	Dressing/Fitting/Locker Rooms					State:	11B-803.2	Federal:	803.2
Issue:	Turning space not provided within room								
Recommendation:	Provide turning space								
Priority:	1	ID:	806	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								
Priority:	1	ID:	807	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	808	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	3	ID:	809	Floor:	2nd	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	3	ID:	810	Floor:	2nd	Cost:	$2,000	Duration:	10 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	811	Floor:	2nd	Cost:	$10,000	Duration:	40 hrs
Category:	Water Closet Compartments (GENERAL)					State:	11B-604.8.1.1	Federal:	N/A
Issue:	Water closet compartment not 48" long for maneuvering for end opening door in front of toil								
Recommendation:	Provide required clearance or provide alternative accessible water closet								

Priority:	3	ID:	812	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								
Priority:	3	ID:	813	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	3	ID:	814	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 36" minimum length								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	815	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	N/A
Issue:	Sidewall grab bar less than 24" from front of toilet to far edge								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	816	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	817	Floor:	2nd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	3	ID:	818	Floor:	2nd	Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	819	Floor:	2nd	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	820	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	821	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	822	Floor:	2nd	Cost:	$2,000	Duration:	10 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	823	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								

Priority:	1	ID:	824	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	825	Floor:	2nd	Cost:	$300	Duration:	3 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Level area in direction of door swing (pull side) not 60" minimum length/maneuvering cleara								
Recommendation:	Provide required clearance area								
Priority:	1	ID:	826	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	1	ID:	827	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	828	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	829	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, t								
Recommendation:	Provide minimum 12" maneuvering clearance								
Priority:	3	ID:	830	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	3	ID:	831	Floor:	2nd	Cost:	$2,000	Duration:	10 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	832	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser located over 9" from edge of toilet								
Recommendation:	Relocate TPD with 9" maximum from edge of toilet								
Priority:	3	ID:	833	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								
Priority:	3	ID:	834	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	835	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								

Priority:	3	ID:	836	Floor:	2nd	Cost:	$200	Duration:	1 hr
Category:	Lavatories (GENERAL)					State:	11B-606.4	Federal:	606.4
Issue:	Faucet controls require tight grasping, pinching or twisting to operate								
Recommendation:	Remove and replace faucet per current standards								
Priority:	3	ID:	837	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	3	ID:	838	Floor:	2nd	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	839	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	840	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	841	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	2	ID:	842	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	1	ID:	843	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								

2 - 36 Stairwell

Priority:	2	ID:	844	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	845	Floor:	2nd	Cost:	$6,000	Duration:	20 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 12" maneuvering clearance on latch side of interior door not provided (push side,								
Recommendation:	Provide minimum 12" maneuvering clearance								
Priority:	2	ID:	846	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	847	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

Priority:	1	ID:	848	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

2 - 37 Brief Room

Priority:	1	ID:	849	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	850	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	851	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	852	Floor:	2nd	Cost:	$5,000	Duration:	40 hrs
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	1	ID:	853	Floor:	2nd	Cost:	$800	Duration:	4 hrs
Category:	Landings/Thresholds					State:	11B-404.2.5	Federal:	404.2.5
Issue:	Landing over 1/2" lower than top of threshold at doorway								
Recommendation:	Remove and replace affected concrete landing for compliance								
Priority:	1	ID:	854	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	855	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	856	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	857	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								
Priority:	1	ID:	858	Floor:	2nd	Cost:	$6,000	Duration:	20 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, r								
Recommendation:	Provide minimum 12" maneuvering clearance								

2 - 38 Detention Support

Priority:	1	ID:	859	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	860	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								
Priority:	1	ID:	861	Floor:	2nd	Cost:	$2,000	Duration:	10 hrs
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	862	Floor:	2nd	Cost:	$2,000	Duration:	10 hrs
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	863	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								

2 - 39 Lieutenant Office

Priority:	1	ID:	864	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	865	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	866	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	1	ID:	867	Floor:	2nd	Cost:	$6,000	Duration:	20 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								
Priority:	1	ID:	868	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								
Priority:	1	ID:	869	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

Priority:	1	ID:	870	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	871	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	872	Floor:	2nd	Cost:	$6,000	Duration:	20 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								

2 - 40 Distribution Room

Priority:	1	ID:	873	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	4	ID:	874	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Sinks (ADULT)					State:	11B-606.3	Federal:	606.3
Issue:	Height of rim or counter measured over 34" AFF								
Recommendation:	Reset sink/or provide maximum 34" AFF counter								
Priority:	4	ID:	875	Floor:	2nd	Cost:	$50	Duration:	.25 hrs
Category:	Sinks (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate piping as required to protect against contact								
Priority:	2	ID:	876	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.3.2	Federal:	308.3.2
Issue:	Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is betwee								
Recommendation:	Provide required reach range								
Priority:	2	ID:	877	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.3.2	Federal:	308.3.2
Issue:	Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is betwee								
Recommendation:	Provide required reach range								
Priority:	1	ID:	878	Floor:	2nd	Cost:	$6,000	Duration:	18 hrs
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	1	ID:	879	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 12" maneuvering clearance on latch side of interior door not provided (push side,								
Recommendation:	Provide minimum 12" maneuvering clearance								

2 - 41 Administration Office

Priority:	1	ID:	880	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								
Priority:	1	ID:	881	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	882	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	883	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	1	ID:	884	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								

2 - 42 Staff Restroom

Priority:	1	ID:	885	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.1	Federal:	703.5.1
Issue:	Toilet door sign not contrasting colors								
Recommendation:	Remove and replace sign per current standards								
Priority:	1	ID:	886	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	3	ID:	887	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	888	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	889	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	890	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser not located min. 7" from edge of toilet								
Recommendation:	Relocate TPD with 7" minimum from edge of toilet								

Priority:	3	ID:	891	Floor:	2nd	Cost:	$2,000	Duration:	10 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	3	ID:	892	Floor:	2nd	Cost:	$3,000	Duration:	20 hrs
Category:	Urinals					State:	11B-605.3	Federal:	605.3
Issue:	Clear floor space in front of urinal not provided								
Recommendation:	Provide 30" X 48" clearance								
Priority:	2	ID:	893	Floor:	2nd	Cost:	$50	Duration:	.25 hrs
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	2	ID:	894	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Detention Facility Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	3	ID:	895	Floor:	2nd	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	896	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	897	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	2	ID:	898	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	1	ID:	899	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								

2 - 43 Staff Restroom

Priority:	1	ID:	900	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	901	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	3	ID:	902	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								

Priority:	3	ID:	903	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	904	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	905	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser not located min. 7" from edge of toilet								
Recommendation:	Relocate TPD with 7" minimum from edge of toilet								
Priority:	3	ID:	906	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	907	Floor:	2nd	Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	908	Floor:	2nd	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	909	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	910	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	3	ID:	911	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	1	ID:	912	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								

2 - 44 Conference Room

Priority:	1	ID:	913	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								
Priority:	1	ID:	914	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

Priority:	1	ID:	915	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	916	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	917	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

2 - 45 Staff Restroom

Priority:	1	ID:	918	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	919	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	920	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	3	ID:	921	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Urinals					State:	11B-605.2	Federal:	605.2
Issue:	Urinal rim measured over 17" AFF								
Recommendation:	Adjust as required								
Priority:	3	ID:	922	Floor:	2nd	Cost:	$2,000	Duration:	10 hrs
Category:	Urinals					State:	11B-605.4	Federal:	605.4
Issue:	Flush control measured over 44" AFF								
Recommendation:	Adjust as required								
Priority:	3	ID:	923	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								
Priority:	3	ID:	924	Floor:	2nd	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	925	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	926	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								

Priority:	3	ID:	927	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Water Closet Compartments (GENERAL)					State:	11B-604.8.2.2	Federal:	604.8.2.2
Issue:	Lever, pull or push type handle on inside face near latch of door not provided								
Recommendation:	Provide required handle per current standards								
Priority:	3	ID:	928	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured over 19" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	3	ID:	929	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	930	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	931	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser not located min. 7" from edge of toilet								
Recommendation:	Relocate TPD with 7" minimum from edge of toilet								

2 - 46 Staff Restroom

Priority:	1	ID:	932	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	933	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								
Priority:	1	ID:	934	Floor:	2nd	Cost:	$6,000	Duration:	16 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Level area in direction of door swing (pull side) not 60" minimum length/maneuvering clearа								
Recommendation:	Provide required clearance area								
Priority:	3	ID:	935	Floor:	2nd	Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	936	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	937	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	938	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.6	Federal:	N/A
Issue:	Lavatory not 18" minimum to centerline from side wall or partition								
Recommendation:	Relocate Lavatory as required; modification maybe required								

Priority:	3	ID:	939	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Water Closet Compartments (GENERAL)					State:	11B-604.8.2.2	Federal:	604.8.2.2
Issue:	Lever, pull or push type handle on inside face near latch of door not provided								
Recommendation:	Provide required handle per current standards								
Priority:	3	ID:	940	Floor:	2nd	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured over 19" AFF								
Recommendation:	Remove and replace water closet per current standards								
Priority:	3	ID:	941	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	942	Floor:	2nd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	943	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser not located min. 7" from edge of toilet								
Recommendation:	Relocate TPD with 7" minimum from edge of toilet								
Priority:	2	ID:	944	Floor:	2nd	Cost:	$500	Duration:	1 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								

2 - 47 Break Room

Priority:	1	ID:	945	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	946	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	947	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								
Priority:	2	ID:	948	Floor:	2nd	Cost:	See *12	Duration:	See *12
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	949	Floor:	2nd	Cost:	See *12	Duration:	See *12
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	950	Floor:	2nd	Cost:	See *12	Duration:	See *12
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	951	Floor:	2nd	Cost:	See *12	Duration:	See *12
Category:	Reach Range					State:	11B-308.3.1	Federal:	308.3.1
Issue:	Maximum 48" AFF side unobstructed reach range exceeded								
Recommendation:	Provide required reach range								
Priority:	2	ID:	952	Floor:	2nd	Cost:	See *12	Duration:	See *12
Category:	Reach Range					State:	11B-308.3.1	Federal:	308.3.1
Issue:	Maximum 48" AFF side unobstructed reach range exceeded								
Recommendation:	Provide required reach range								
Priority:	2	ID:	953	Floor:	2nd	Cost:	$2,000	Duration:	10 hrs
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible16 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	954	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								

2 - 48 Stairwell

Priority:	2	ID:	955	Floor:	2nd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	956	Floor:	2nd	Cost:	$5,000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	957	Floor:	2nd	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	958	Floor:	2nd	Cost:	$1,500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.2	Federal:	505.10.2
Issue:	Extension of handrail at top stairs not 12" minimum of level distance (parallel with floor) bey								
Recommendation:	Modify handrail(s) to provide required 12" extensions or replace per current standards								

2 - 49 Conference Room

Priority:	1	ID:	959	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum								
Recommendation:	Remove and replace sign per current standards								
Priority:	1	ID:	960	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	961	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								

2 - 50 Dental Room

Priority:	4	ID:	962	Floor:	2nd	Cost:	$1,000	Duration:	8 hrs
Category:	Sinks (ADULT)					State:	11B-606.3	Federal:	606.3
Issue:	Height of rim or counter measured over 34" AFF								
Recommendation:	Reset sink/or provide maximum 34" AFF counter								
Priority:	2	ID:	963	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	964	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	965	Floor:	2nd	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	966	Floor:	2nd	Cost:	$200	Duration:	2 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior doo								
Recommendation:	Provide minimum 18" maneuvering clearance								
Priority:	1	ID:	967	Floor:	2nd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	968	Floor:	2nd	Cost:	$6,000	Duration:	20 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, f								
Recommendation:	Provide minimum 12" maneuvering clearance								
Priority:	1	ID:	969	Floor:	2nd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

Main Annex Jail

3 - 1 Stairwell

Priority:	1	ID:	970	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	2	ID:	971	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

3 - 2 Storage

Priority:	2	ID:	972	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	1	ID:	973	Floor:	3rd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								

3 - 3 Corridor

Priority:	1	ID:	974	Floor:	3rd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

3 - 4 Cell FF

Priority:	4	ID:	975	Floor:	3rd	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								
Priority:	2	ID:	976	Floor:	3rd	Cost:	$2,000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	977	Floor:	3rd	Cost:	See *10	Duration:	See *10
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	978	Floor:	3rd	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	979	Floor:	3rd	Cost:	See *10	Duration:	See *10
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								

Priority:	2	ID:	980	Floor:	3rd	Cost:	See *10	Duration:	See *10
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	981	Floor:	3rd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	982	Floor:	3rd	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	983	Floor:	3rd	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	984	Floor:	3rd	Cost:	See *10	Duration:	See *10
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	2	ID:	985	Floor:	3rd	Cost:	See *10	Duration:	See *10
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	986	Floor:	3rd	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	987	Floor:	3rd	Cost:	See *10	Duration:	See *10
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	999	Floor:	3rd	Cost:	See *10	Duration:	See *10
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								

3 - 5 Shower

Priority:	1	ID:	988	Floor:	3rd	Cost:	See *11	Duration:	See *11
Category:	Reach Range					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	1	ID:	989	Floor:	3rd	Cost:	See *11	Duration:	See *11
Category:	Reach Range					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.								
Priority:	2	ID:	990	Floor:	3rd	Cost:	See *11	Duration:	See *11
Category:	Doors / Gates					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								

Priority:	2	ID:	991	Floor:	3rd	Cost:	See *11	Duration:	See *11
Category:	Interior Signage					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	992	Floor:	3rd	Cost:	See *11	Duration:	See *11
Category:	Alarms					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	993	Floor:	3rd	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Water Closets (ADULT)					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	994	Floor:	3rd	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Accessories					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	995	Floor:	3rd	Cost:	See *11	Duration:	See *11
Category:	Reach Range					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	996	Floor:	3rd	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Water Closets (GENERA					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	997	Floor:	3rd	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Water Closets (GENERA					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	2	ID:	998	Floor:	3rd	Cost:	See *11	Duration:	See *11
Category:	Lavatories (ADULT)					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

3 - 6 Storage

Priority:	1	ID:	1000	Floor:	3rd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	1001	Floor:	3rd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

3 - 7 Stairwell

Priority:	1	ID:	1002	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1003	Floor:	3rd	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	2	ID:	1004	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1005	Floor:	3rd	Cost:	$2,000	Duration:	8 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

3 - 8 Staff Restroom

Priority:	1	ID:	1006	Floor:	3rd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	3	ID:	1007	Floor:	3rd	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								
Priority:	3	ID:	1008	Floor:	3rd	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	3	ID:	1009	Floor:	3rd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	1010	Floor:	3rd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1011	Floor:	3rd	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1012	Floor:	3rd	Cost:	$500	Duration:	1 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								

Priority:	3	ID:	1013	Floor:	3rd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	1014	Floor:	3rd	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	1015	Floor:	3rd	Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	1016	Floor:	3rd	Cost:	$3,000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	3	ID:	1017	Floor:	3rd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	2	ID:	1018	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	1019	Floor:	3rd	Cost:	$50	Duration:	.5 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	1	ID:	1020	Floor:	3rd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

3 - 9 Conference Room

Priority:	2	ID:	1021	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1022	Floor:	3rd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

3 - 10 Janitor

Priority:	1	ID:	1023	Floor:	3rd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	1024	Floor:	3rd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	2	ID:	1025	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

3 - 11 Scullery

Priority:	2	ID:	1026	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	1	ID:	1027	Floor:	3rd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	1028	Floor:	3rd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

3 - 12 Classroom

Priority:	4	ID:	1029	Floor:	3rd	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								
Priority:	2	ID:	1030	Floor:	3rd	Cost:	$1,000	Duration:	1 hr
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Minimum 27" high x 8" deep clearance under counter not provided								
Recommendation:	Provide minimum 27" high X 8" deep clearance under counter								
Priority:	2	ID:	1031	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

3 - 13 Corridor

Priority:	4	ID:	1032	Floor:	3rd	Cost:	$2,000	Duration:	8 hrs
Category:	Drinking Fountains					State:	11B-211.3	Federal:	211.3
Issue:	50% of all drinking fountains are not standing accessible								
Recommendation:	Install for standing persons drinking fountain(s)								
Priority:	4	ID:	1033	Floor:	3rd	Cost:	$1,000	Duration:	8 hrs
Category:	Drinking Fountains					State:	11B-602.2	Federal:	602.2
Issue:	Knee clearance space under drinking fountain not provided/8" deep at 27" tall and 11" deep								
Recommendation:	Reset fountain for compliance; replace if required								

3 - 14 Conference Room

Priority:	1	ID:	1034	Floor:	3rd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	1035	Floor:	3rd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	1036	Floor:	3rd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	2	ID:	1037	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1038	Floor:	3rd	Cost:	$1,000	Duration:	5 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Level area in direction of door swing (pull side) not 60" minimum length/maneuvering cleara								
Recommendation:	Provide required clearance area								

3 - 15 Infirmary

Priority:	1	ID:	1039	Floor:	3rd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	1040	Floor:	3rd	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	1041	Floor:	3rd	Cost:	$500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	2	ID:	1042	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	1043	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1044	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	4	ID:	1045	Floor:	3rd	Cost:	$4,000	Duration:	20 hrs
Category:	Sinks (GENERAL)					State:	11B-606.2	Federal:	606.2
Issue:	30" x 48" clear floor space not provided for front approach								
Recommendation:	Provide 30" X 48" clearance for front approach								
Priority:	4	ID:	1046	Floor:	3rd	Cost:	$50	Duration:	.25 hrs
Category:	Sinks (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate piping as required to protect against contact								
Priority:	4	ID:	1047	Floor:	3rd	Cost:	$1,000	Duration:	8 hrs
Category:	Sinks (ADULT)					State:	11B-606.3	Federal:	606.3
Issue:	Height of rim or counter measured over 34" AFF								
Recommendation:	Reset sink/or provide maximum 34" AFF counter								
Priority:	2	ID:	1048	Floor:	3rd	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.3.2	Federal:	308.3.2
Issue:	Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is betwee								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1049	Floor:	3rd	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.3.2	Federal:	308.3.2
Issue:	Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is betwee								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1050	Floor:	3rd	Cost:	$50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.3.2	Federal:	308.3.2
Issue:	Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is betwee								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1051	Floor:	3rd	Cost:	$6,000	Duration:	18 hrs
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	1	ID:	1052	Floor:	3rd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	1053	Floor:	3rd	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.7.2.6	Federal:	N/A
Issue:	Unisex toilet door sign not 1/4" thick of contrasting circle and triangle symbols with the circle								
Recommendation:	Provide sign per current standards								
Priority:	3	ID:	1054	Floor:	3rd	Cost:	$2,000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	3	ID:	1055	Floor:	3rd	Cost:	$100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror (not over lavatory) measured over 35" AFF to the bottom edge of the reflecting surfac								
Recommendation:	Reset mirror to maximum 35" AFF to reflecting surface								
Priority:	3	ID:	1056	Floor:	3rd	Cost:	$50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								

Priority:	3	ID:	1057	Floor:	3rd	Cost:	$50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	2	ID:	1058	Floor:	3rd	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	3	ID:	1059	Floor:	3rd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1060	Floor:	3rd	Cost:	$300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								

3 - 16 Gym

Priority:	4	ID:	1061	Floor:	3rd	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								

3 - 17 Pod A

Priority:	2	ID:	1062	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1063	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	1064	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1065	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1066	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1067	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								

Priority:	2	ID:	1068	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	1069	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	4	ID:	1070	Floor:	3rd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	1071	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1072	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1073	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1074	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1075	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible32 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1076	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	1077	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1078	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1079	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	1	ID:	1080	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1081	Floor:	3rd	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1082	Floor:	3rd	Cost:	$6,000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1083	Floor:	3rd	Cost:	$1,500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	1084	Floor:	3rd	Cost:	$10,000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1085	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1086	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1087	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	1088	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1089	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1090	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1091	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								

Priority:	2	ID:	1092	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1093	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1094	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

3 - 18 Pod B

Priority:	2	ID:	1095	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1096	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	1097	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1098	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1099	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1100	Floor:	3rd	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1101	Floor:	3rd	Cost:	$1,500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	1102	Floor:	3rd	Cost:	$6,000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1103	Floor:	3rd	Cost:	$10,000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								

Priority:	4	ID:	1104	Floor:	3rd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	1105	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1106	Floor:	3rd	Cost:	$1,000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1107	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1108	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1109	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1110	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1111	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1112	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1113	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	3	ID:	1114	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	1	ID:	1115	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	2	ID:	1116	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1117	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1118	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1119	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1120	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	1121	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1122	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1123	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1124	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1125	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1126	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1127	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

Priority:	2	ID:	1128	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1129	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	1130	Floor:	3rd	Cost:	$6,000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1131	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1132	Floor:	3rd	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1133	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1134	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1135	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1136	Floor:	3rd	Cost:	$1,000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1137	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1138	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1139	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	1140	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1141	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1142	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1143	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1144	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1145	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1146	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1147	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1148	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1149	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1150	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	1151	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								

Priority:	2	ID:	1152	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1153	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1154	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1155	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1156	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	1157	Floor:	3rd	Cost:	$200	Duration:	2 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	1158	Floor:	3rd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	1159	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

3 - 20 Pod D

Priority:	2	ID:	1160	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1161	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	4	ID:	1162	Floor:	3rd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	4	ID:	1163	Floor:	3rd	Cost:	$3,000	Duration:	15 hrs
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								

Priority:	1	ID:	1164	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1165	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1166	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1167	Floor:	3rd	Cost:	$1,000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1168	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1169	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1170	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	1171	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1172	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1173	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1174	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1175	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								

Priority:	2	ID:	1176	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1177	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1178	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1179	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1180	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1181	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1182	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1183	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1184	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1185	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	1	ID:	1186	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1187	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	1	ID:	1188	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1189	Floor:	3rd	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1190	Floor:	3rd	Cost:	$6,000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1191	Floor:	3rd	Cost:	$10,000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	1192	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

3 - 21 Pod E

Priority:	2	ID:	1193	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1194	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	2	ID:	1195	Floor:	3rd	Cost:	$200	Duration:	2 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	1196	Floor:	3rd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	1197	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1198	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1199	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	2	ID:	1200	Floor:	3rd	Cost:	$1,000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1201	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1202	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	2	ID:	1203	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1204	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1205	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1206	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1207	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1208	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1209	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1210	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1211	Floor:	3rd	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								

Priority:	1	ID:	1212	Floor:	3rd	Cost:	$6,000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1213	Floor:	3rd	Cost:	$10,000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	1214	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								
Priority:	2	ID:	1215	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1216	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1217	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	3	ID:	1218	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1219	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1220	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1221	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1222	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	1	ID:	1223	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	2	ID:	1224	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1225	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
3 - 22									Pod F
Priority:	2	ID:	1226	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1227	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	4	ID:	1228	Floor:	3rd	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	1229	Floor:	3rd	Cost:	$5,000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1230	Floor:	3rd	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1231	Floor:	3rd	Cost:	$6,000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1232	Floor:	3rd	Cost:	$10,000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	1233	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1234	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1235	Floor:	3rd	Cost:	$500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	2	ID:	1236	Floor:	3rd	Cost:	$1,000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1237	Floor:	3rd	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								
Priority:	2	ID:	1238	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1239	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	1240	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1241	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1242	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1243	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1244	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1245	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	1246	Floor:	3rd	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	1	ID:	1247	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								

Priority:	2	ID:	1248	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1249	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1250	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	1251	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1252	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1253	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1254	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	1255	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1256	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1257	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1258	Floor:	3rd	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Main Annex Jail

4 - 1 Cell FF

Priority:	1	ID:	1259	Floor:	4th	Cost:	See *10	Duration:	See *10
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1260	Floor:	4th	Cost:	2000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1261	Floor:	4th	Cost:	See *10	Duration:	See *10
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1262	Floor:	4th	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1263	Floor:	4th	Cost:	See *10	Duration:	See *10
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1264	Floor:	4th	Cost:	See *10	Duration:	See *10
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1265	Floor:	4th	Cost:	3000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	4	ID:	1266	Floor:	4th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	4	ID:	1267	Floor:	4th	Cost:	See *10	Duration:	See *10
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	2	ID:	1268	Floor:	4th	Cost:	See *10	Duration:	See *10
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1269	Floor:	4th	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	1270	Floor:	4th	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1271	Floor:	4th	Cost:	See *10	Duration:	See *10
Category:	Dining/Bar Facilities					State:	11B-226.2	Federal:	226.2
Issue:	Accessible seating not dispersed within each functional dining area								
Recommendation:	Disperse accessible seating per current standards								
Priority:	1	ID:	1272	Floor:	4th	Cost:	See *11	Duration:	See *11
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	1	ID:	1273	Floor:	4th	Cost:	See *11	Duration:	See *11
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Remove and replace concrete walk with maximum 2.0% slope cross slope where cross slop								
Priority:	2	ID:	1274	Floor:	4th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1275	Floor:	4th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1276	Floor:	4th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1277	Floor:	4th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	2	ID:	1278	Floor:	4th	Cost:	See *11	Duration:	See *11
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1279	Floor:	4th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1280	Floor:	4th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1281	Floor:	4th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								

Priority:	2	ID:	1282	Floor:	4th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1283	Floor:	4th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								

4 - 2 Corridor

Priority:	4	ID:	1284	Floor:	4th	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								
Priority:	1	ID:	1285	Floor:	4th	Cost:	2000	Duration:	8 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

4 - 3 Stairwell

Priority:	1	ID:	1286	Floor:	4th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	2	ID:	1287	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1288	Floor:	4th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								

4 - 4 Storage

Priority:	2	ID:	1289	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	1	ID:	1290	Floor:	4th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	1291	Floor:	4th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

4 - 5 Conference Room

Priority:	2	ID:	1292	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1293	Floor:	4th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	1294	Floor:	4th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	1295	Floor:	4th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

4 - 6 Janitor

Priority:	1	ID:	1296	Floor:	4th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	1297	Floor:	4th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	2	ID:	1298	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

4 - 7 Scullery

Priority:	1	ID:	1299	Floor:	4th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	2	ID:	1300	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	1	ID:	1301	Floor:	4th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	1302	Floor:	4th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

4 - 8 Conference Room

Priority:	2	ID:	1303	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

4 - 9 Gym

Priority:	4	ID:	1304	Floor:	4th	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								

4 - 10 Staff Restroom

Priority:	3	ID:	1305	Floor:	4th	Cost:	2000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	3	ID:	1306	Floor:	4th	Cost:	2000	Duration:	16 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								
Priority:	3	ID:	1307	Floor:	4th	Cost:	300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	1308	Floor:	4th	Cost:	300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1309	Floor:	4th	Cost:	50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1310	Floor:	4th	Cost:	500	Duration:	1 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	3	ID:	1311	Floor:	4th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	1312	Floor:	4th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser not located min. 7" from edge of toilet								
Recommendation:	Relocate TPD with 7" minimum from edge of toilet								
Priority:	3	ID:	1313	Floor:	4th	Cost:	2000	Duration:	10 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								

Priority:	3	ID:	1314	Floor:	4th	Cost:	50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	1315	Floor:	4th	Cost:	3000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	3	ID:	1316	Floor:	4th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	1317	Floor:	4th	Cost:	100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	1318	Floor:	4th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	2	ID:	1319	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	1320	Floor:	4th	Cost:	50	Duration:	.5 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	1	ID:	1321	Floor:	4th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	1322	Floor:	4th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

4 - 11 Storage

Priority:	1	ID:	1323	Floor:	4th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	1324	Floor:	4th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	2	ID:	1325	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

4 - 12 Stairwell

Priority:	1	ID:	1326	Floor:	4th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1327	Floor:	4th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	2	ID:	1328	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

4 - 13 Conference Room

Priority:	1	ID:	1329	Floor:	4th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	1330	Floor:	4th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	2	ID:	1331	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1332	Floor:	4th	Cost:	1000	Duration:	5 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Level area in direction of door swing (pull side) not 60" minimum length/maneuvering clearа								
Recommendation:	Provide required clearance area								
Priority:	1	ID:	1333	Floor:	4th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

4 - 14 Infirmary

Priority:	2	ID:	1334	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	1335	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1336	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	1	ID:	1337	Floor:	4th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign over 40"-70" AFF (to bottom) not 5/8" minimum								
Recommendation:	Remove and replace sign per current standards								
Priority:	3	ID:	1338	Floor:	4th	Cost:	2000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	1	ID:	1339	Floor:	4th	Cost:	6000	Duration:	18 hrs
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	3	ID:	1340	Floor:	4th	Cost:	2000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	3	ID:	1341	Floor:	4th	Cost:	50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	1342	Floor:	4th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	1343	Floor:	4th	Cost:	100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	1344	Floor:	4th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	4	ID:	1345	Floor:	4th	Cost:	10000	Duration:	50 hrs
Category:	Accessible Clearance					State:	11B-304.3	Federal:	304.3
Issue:	Required 60" diameter circle or 'T'-shaped clear floor space not provided within room								
Recommendation:	Provide required clearance								
Priority:	1	ID:	1346	Floor:	4th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.7.2.6	Federal:	N/A
Issue:	Unisex toilet door sign not 1/4" thick of contrasting circle and triangle symbols with the circle								
Recommendation:	Provide sign per current standards								
Priority:	4	ID:	1347	Floor:	4th	Cost:	1000	Duration:	8 hrs
Category:	Sinks (ADULT)					State:	11B-606.3	Federal:	606.3
Issue:	Height of rim or counter measured over 34" AFF								
Recommendation:	Reset sink/or provide maximum 34" AFF counter								
Priority:	4	ID:	1348	Floor:	4th	Cost:	50	Duration:	.25 hrs
Category:	Sinks (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate piping as required to protect against contact								

Priority:	2	ID:	1349	Floor:	4th	Cost:	50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.2.2	Federal:	308.2.2
Issue:	Maximum 44" AFF front obstructed reach range exceeded when obstruction depth is betwe								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1350	Floor:	4th	Cost:	50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.2.2	Federal:	308.2.2
Issue:	Maximum 44" AFF front obstructed reach range exceeded when obstruction depth is betwe								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1351	Floor:	4th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	1352	Floor:	4th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	1353	Floor:	4th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	1354	Floor:	4th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	2	ID:	1355	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1356	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1357	Floor:	4th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

4 - 15 Corridor

Priority:	4	ID:	1358	Floor:	4th	Cost:	1000	Duration:	8 hrs
Category:	Drinking Fountains					State:	11B-602.2	Federal:	602.2
Issue:	Knee clearance space under drinking fountain not provided/8" deep at 27" tall and 11" deep								
Recommendation:	Reset fountain for compliance; replace if required								
Priority:	4	ID:	1359	Floor:	4th	Cost:	2000	Duration:	8 hrs
Category:	Drinking Fountains					State:	11B-211.3	Federal:	211.3
Issue:	50% of all drinking fountains are not standing accessible								
Recommendation:	Install for standing persons drinking fountain(s)								

4 - 16 Classroom

Priority:	2	ID:	1360	Floor:	4th	Cost:	1000	Duration:	1 hr
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Minimum 27" high x 8" deep clearance under counter not provided								
Recommendation:	Provide minimum 27" high X 8" deep clearance under counter								
Priority:	4	ID:	1361	Floor:	4th	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								
Priority:	2	ID:	1362	Floor:	4th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

4 - 17 Pod-A

Priority:	2	ID:	1363	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1364	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	1365	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1366	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1367	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1368	Floor:	4th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1369	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1370	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								

Priority:	2	ID:	1371	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	1372	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1373	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	2	ID:	1374	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1375	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1376	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1377	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1378	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1379	Floor:	4th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1380	Floor:	4th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1381	Floor:	4th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1382	Floor:	4th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								

Priority:	1	ID:	1383	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								
Priority:	1	ID:	1384	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1385	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1386	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1387	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	3	ID:	1388	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1389	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1390	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	4	ID:	1391	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	4	ID:	1392	Floor:	4th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	1393	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1394	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	1	ID:	1395	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1396	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

4 - 18 Pod-B

Priority:	2	ID:	1397	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible40 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1398	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	1399	Floor:	4th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1400	Floor:	4th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1401	Floor:	4th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1402	Floor:	4th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	4	ID:	1403	Floor:	4th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	1404	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1405	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1406	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	2	ID:	1407	Floor:	4th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1408	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1409	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	1410	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1411	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	2	ID:	1412	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1413	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1414	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1415	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1416	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	1417	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	1	ID:	1418	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

Priority:	1	ID:	1419	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1420	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1421	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1422	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1423	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1424	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1425	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1426	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1427	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1428	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1429	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	1430	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1431	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	1432	Floor:	4th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1433	Floor:	4th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1434	Floor:	4th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1435	Floor:	4th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	1436	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								
Priority:	1	ID:	1437	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1438	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1439	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1440	Floor:	4th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1441	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								

Priority:	2	ID:	1442	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1443	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	1	ID:	1444	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1445	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	2	ID:	1446	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1447	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1448	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1449	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1450	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1451	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1452	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1453	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								

Priority:	2	ID:	1454	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1455	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1456	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1457	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1458	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	1	ID:	1459	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1460	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	1461	Floor:	4th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								

4 - 20 Visitation

Priority:	4	ID:	1462	Floor:	4th	Cost:	3000	Duration:	15 hrs
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	4	ID:	1463	Floor:	4th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								

Priority:	2	ID:	1464	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	4	ID:	1465	Floor:	4th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	1466	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	1467	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1468	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1469	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1470	Floor:	4th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1471	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1472	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	1	ID:	1473	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1474	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	2	ID:	1475	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								

Priority:	2	ID:	1476	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1477	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1478	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1479	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	1480	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	1	ID:	1481	Floor:	4th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1482	Floor:	4th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1483	Floor:	4th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	1484	Floor:	4th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1485	Floor:	4th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	1486	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1487	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								

Priority:	2	ID:	1488	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1489	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1490	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1491	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1492	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1493	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1494	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	1	ID:	1495	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1496	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1497	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

Priority:	2	ID:	1498	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1499	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	4	ID:	1500	Floor:	4th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	1501	Floor:	4th	Cost:	200	Duration:	2 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1502	Floor:	4th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1503	Floor:	4th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1504	Floor:	4th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1505	Floor:	4th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	1506	Floor:	4th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	1507	Floor:	4th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								
Priority:	1	ID:	1508	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1509	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	1	ID:	1510	Floor:	4th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1511	Floor:	4th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1512	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1513	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1514	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1515	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	1	ID:	1516	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1517	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1518	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1519	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1520	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1521	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								

Priority:	1	ID:	1522	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1523	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1524	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1525	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1526	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1527	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1528	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1529	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1530	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	1	ID:	1531	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1532	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	1533	Floor:	4th	Cost: See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State: 11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats							
Recommendation:	Provide accessible seating spaces as required							
Priority:	1	ID:	1534	Floor:	4th	Cost: See *8	Duration:	See *8
Category:	Corridors/Hallways					State: 11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10							
Recommendation:	Provide 44" width							
Priority:	4	ID:	1535	Floor:	4th	Cost: See *5	Duration:	See *5
Category:	Telephones					State: 11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo							
Recommendation:	Provide accessible TTY per current standards							
Priority:	1	ID:	1536	Floor:	4th	Cost: 5000	Duration:	20 hrs
Category:	Stairs					State: 11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads							
Recommendation:	Provide handrails per current standards							
Priority:	1	ID:	1537	Floor:	4th	Cost: N/A	Duration:	N/A
Category:	Stairs					State: 1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum							
Recommendation:	Provide stairs with minimum 44" width							
Priority:	1	ID:	1538	Floor:	4th	Cost: 1500	Duration:	2 hrs
Category:	Stairs					State: 11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott							
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards							
Priority:	1	ID:	1539	Floor:	4th	Cost: 6000	Duration:	30 hrs
Category:	Stairs					State: 11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only							
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance							
Priority:	1	ID:	1540	Floor:	4th	Cost: 10000	Duration:	50 hrs
Category:	Protruding Objects					State: 11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum							
Recommendation:	Provide required vertical clearance							
Priority:	1	ID:	1541	Floor:	4th	Cost: 500	Duration:	5 hrs
Category:	Protruding Objects					State: 11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi							
Recommendation:	Provide required clearance/adjust as required							
Priority:	1	ID:	1542	Floor:	4th	Cost: 500	Duration:	5 hrs
Category:	Protruding Objects					State: 11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi							
Recommendation:	Provide required clearance/adjust as required							
Priority:	1	ID:	1543	Floor:	4th	Cost: 500	Duration:	5 hrs
Category:	Protruding Objects					State: 11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi							
Recommendation:	Provide required clearance/adjust as required							
Priority:	2	ID:	1544	Floor:	4th	Cost: 1000	Duration:	5 hrs
Category:	Reach Range					State: 11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac							
Recommendation:	Provide required reach range							

Priority:	2	ID:	1545	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1546	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1547	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1548	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	1	ID:	1549	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1550	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1551	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1552	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1553	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1554	Floor:	4th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1555	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1556	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								

Priority:	2	ID:	1557	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1558	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1559	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1560	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1561	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1562	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1563	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1564	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1565	Floor:	4th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Main Annex Jail

5 - 1 Cell FF

Priority:	1	ID:	1566	Floor:	5th	Cost:	See *11	Duration:	See *11
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Remove and replace concrete walk with maximum 2.0% slope cross slope where cross slop								
Priority:	2	ID:	1567	Floor:	5th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1568	Floor:	5th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1569	Floor:	5th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	1570	Floor:	5th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1571	Floor:	5th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1572	Floor:	5th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1573	Floor:	5th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1574	Floor:	5th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	1575	Floor:	5th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	1	ID:	1576	Floor:	5th	Cost:	See *11	Duration:	See *11
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								

Priority:	2	ID:	1577	Floor:	5th	Cost:	See *11	Duration:	See *11
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1578	Floor:	5th	Cost:	See *10	Duration:	See *10
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1579	Floor:	5th	Cost:	2000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1580	Floor:	5th	Cost:	See *10	Duration:	See *10
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1581	Floor:	5th	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1582	Floor:	5th	Cost:	See *10	Duration:	See *10
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1583	Floor:	5th	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1584	Floor:	5th	Cost:	See *10	Duration:	See *10
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1585	Floor:	5th	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	1586	Floor:	5th	Cost:	See *10	Duration:	See *10
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	4	ID:	1587	Floor:	5th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	1588	Floor:	5th	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	1589	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible								
Recommendation:	Provide accessible seating spaces as required								
Priority:	4	ID:	1590	Floor:	5th	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								

5 - 2 Corridor

Priority:	1	ID:	1591	Floor:	5th	Cost:	2000	Duration:	8 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

5 - 3 Storage

Priority:	1	ID:	1592	Floor:	5th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	1593	Floor:	5th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	2	ID:	1594	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

5 - 4 Stairwell

Priority:	1	ID:	1595	Floor:	5th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1596	Floor:	5th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1597	Floor:	5th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.2	Federal:	505.10.2
Issue:	Extension of handrail at top stairs not 12" minimum of level distance (parallel with floor) bey								
Recommendation:	Modify handrail(s) to provide required 12" extensions or replace per current standards								
Priority:	2	ID:	1598	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

5 - 5 Conference

Priority:	1	ID:	1599	Floor:	5th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	2	ID:	1600	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1601	Floor:	5th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

5 - 6 Janitor

Priority:	1	ID:	1602	Floor:	5th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	1603	Floor:	5th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	2	ID:	1604	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

5 - 7 Scullery

Priority:	1	ID:	1605	Floor:	5th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	2	ID:	1606	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

5 - 8 Gym

Priority:	4	ID:	1607	Floor:	5th	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								
Priority:	2	ID:	1608	Floor:	5th	Cost:	1000	Duration:	1 hr
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Minimum 17" deep toe clearance under counter not provided								
Recommendation:	Provide required toe clearance								

5 - 9 Staff Restroom

Priority:	1	ID:	1609	Floor:	5th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	2	ID:	1610	Floor:	5th	Cost:	2000	Duration:	16 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								
Priority:	2	ID:	1611	Floor:	5th	Cost:	2000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1612	Floor:	5th	Cost:	300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1613	Floor:	5th	Cost:	300	Duration:	1.5
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	1614	Floor:	5th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser not located min. 7" from edge of toilet								
Recommendation:	Relocate TPD with 7" minimum from edge of toilet								
Priority:	2	ID:	1615	Floor:	5th	Cost:	50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1616	Floor:	5th	Cost:	500	Duration:	1 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	3	ID:	1617	Floor:	5th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	1618	Floor:	5th	Cost:	50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	1619	Floor:	5th	Cost:	3000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	3	ID:	1620	Floor:	5th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								

Priority:	3	ID:	1621	Floor:	5th	Cost:	100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	1622	Floor:	5th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	1623	Floor:	5th	Cost:	2000	Duration:	10 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	2	ID:	1624	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	1625	Floor:	5th	Cost:	50	Duration:	.5 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								

5 - 10 Conference

Priority:	1	ID:	1626	Floor:	5th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	1627	Floor:	5th	Cost:	1000	Duration:	5 hrs
Category:	Landings/Thresholds					State:	11B-404.2.4.1	Federal:	404.2.4.1
Issue:	Level area in direction of door swing (pull side) not 60" minimum length/maneuvering cleara								
Recommendation:	Provide required clearance area								
Priority:	1	ID:	1628	Floor:	5th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	2	ID:	1629	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	1	ID:	1630	Floor:	5th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	1631	Floor:	5th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	1632	Floor:	5th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	2	ID:	1633	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1634	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	1635	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1636	Floor:	5th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign over 40"-70" AFF (to bottom) not 5/8" minimum								
Recommendation:	Remove and replace sign per current standards								
Priority:	4	ID:	1637	Floor:	5th	Cost:	1000	Duration:	8 hrs
Category:	Sinks (ADULT)					State:	11B-606.3	Federal:	606.3
Issue:	Height of rim or counter measured over 34" AFF								
Recommendation:	Reset sink/or provide maximum 34" AFF counter								
Priority:	4	ID:	1638	Floor:	5th	Cost:	50	Duration:	.25 hrs
Category:	Sinks (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate piping as required to protect against contact								
Priority:	3	ID:	1639	Floor:	5th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	1640	Floor:	5th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	1	ID:	1641	Floor:	5th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.7.2.6	Federal:	N/A
Issue:	Unisex toilet door sign not 1/4" thick of contrasting circle and triangle symbols with the circle								
Recommendation:	Provide sign per current standards								

Priority:	1	ID:	1642	Floor:	5th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	1643	Floor:	5th	Cost:	6000	Duration:	18 hrs
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1644	Floor:	5th	Cost:	2000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1645	Floor:	5th	Cost:	2000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	3	ID:	1646	Floor:	5th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	1647	Floor:	5th	Cost:	50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	1648	Floor:	5th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	1649	Floor:	5th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	1650	Floor:	5th	Cost:	100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror (not over lavatory) measured over 35" AFF to the bottom edge of the reflecting surfac								
Recommendation:	Reset mirror to maximum 35" AFF to reflecting surface								
Priority:	4	ID:	1651	Floor:	5th	Cost:	10000	Duration:	50 hrs
Category:	Accessible Clearance					State:	11B-304.3	Federal:	304.3
Issue:	Required 60" diameter circle or 'T'-shaped clear floor space not provided within room								
Recommendation:	Provide required clearance								
Priority:	2	ID:	1652	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1653	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	1	ID:	1654	Floor:	5th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								

5 - 12 Storage

Priority:	1	ID:	1655	Floor:	5th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	1656	Floor:	5th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	2	ID:	1657	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

5 - 13 Stairwell

Priority:	1	ID:	1658	Floor:	5th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1659	Floor:	5th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	2	ID:	1660	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

5 - 14 Classroom

Priority:	4	ID:	1661	Floor:	5th	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								
Priority:	2	ID:	1662	Floor:	5th	Cost:	1000	Duration:	1 hr
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Minimum 27" high x 8" deep clearance under counter not provided								
Recommendation:	Provide minimum 27" high X 8" deep clearance under counter								
Priority:	2	ID:	1663	Floor:	5th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

5 - 15									Corridor
Priority:	4	ID:	1664	Floor:	5th	Cost:	2000	Duration:	8 hrs
Category:	Drinking Fountains					State:	11B-211.3	Federal:	211.3
Issue:	50% of all drinking fountains are not standing accessible								
Recommendation:	Install for standing persons drinking fountain(s)								
Priority:	4	ID:	1665	Floor:	5th	Cost:	1000	Duration:	8 hrs
Category:	Drinking Fountains					State:	11B-602.2	Federal:	602.2
Issue:	Knee clearance space under drinking fountain not provided/8" deep at 27" tall and 11" deep								
Recommendation:	Remove and reset fountain for compliance; replace if required								
5 - 16									Pod-A
Priority:	2	ID:	1666	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible32 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1667	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	1668	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1669	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1670	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1671	Floor:	5th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1672	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1673	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	1674	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								

Priority:	2	ID:	1675	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1676	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1677	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1678	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1679	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1680	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1681	Floor:	5th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1682	Floor:	5th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1683	Floor:	5th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1684	Floor:	5th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	1685	Floor:	5th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	1686	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

Priority:	1	ID:	1687	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1688	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1689	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1690	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1691	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1692	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1693	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	1694	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Accessible Clearance					State:	11B-304.3	Federal:	304.3
Issue:	Required 60" diameter circle or 'T'-shaped clear floor space not provided within room								
Recommendation:	Provide required clearance								
Priority:	2	ID:	1695	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1696	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	4	ID:	1697	Floor:	5th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	4	ID:	1698	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								

Priority:	1	ID:	1699	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1700	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

5 - 17 Pod-B

Priority:	2	ID:	1701	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1702	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	1703	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1704	Floor:	5th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1705	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1706	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1707	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1708	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	1709	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1710	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								

Priority:	2	ID:	1711	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1712	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1713	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1714	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1715	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1716	Floor:	5th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1717	Floor:	5th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1718	Floor:	5th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	1719	Floor:	5th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1720	Floor:	5th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	4	ID:	1721	Floor:	5th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	1722	Floor:	5th	Cost:	200	Duration:	2 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide assistance placard								

Priority:	1	ID:	1723	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1724	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1725	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1726	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1727	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1728	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1729	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1730	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1731	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	1	ID:	1732	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1733	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1734	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

Priority:	2	ID:	1735	Floor:	5th	Cost: See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State: 11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats							
Recommendation:	Provide accessible seating spaces as required							
Priority:	1	ID:	1736	Floor:	5th	Cost: See *8	Duration:	See *8
Category:	Corridors/Hallways					State: 11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10							
Recommendation:	Provide 44" width							
Priority:	1	ID:	1737	Floor:	5th	Cost: 500	Duration:	5 hrs
Category:	Protruding Objects					State: 11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi							
Recommendation:	Provide required clearance/adjust as required							
Priority:	1	ID:	1738	Floor:	5th	Cost: 500	Duration:	5 hrs
Category:	Protruding Objects					State: 11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi							
Recommendation:	Provide required clearance/adjust as required							
Priority:	1	ID:	1739	Floor:	5th	Cost: 500	Duration:	5 hrs
Category:	Protruding Objects					State: 11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi							
Recommendation:	Provide required clearance/adjust as required							
Priority:	2	ID:	1740	Floor:	5th	Cost: 1000	Duration:	5 hrs
Category:	Reach Range					State: 11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac							
Recommendation:	Provide required reach range							
Priority:	2	ID:	1741	Floor:	5th	Cost: See *7	Duration:	See *7
Category:	Detention Facility Showers					State: 11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height							
Recommendation:	Provide transition into shower							
Priority:	2	ID:	1742	Floor:	5th	Cost: See *7	Duration:	See *7
Category:	Detention Facility Showers					State: 11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent							
Recommendation:	Provide accessible shower							
Priority:	1	ID:	1743	Floor:	5th	Cost: See *7	Duration:	See *7
Category:	Protruding Objects					State: 11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum							
Recommendation:	Provide required vertical clearance							
Priority:	2	ID:	1744	Floor:	5th	Cost: See *7	Duration:	See *7
Category:	Detention Facility Showers					State: 11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4							
Recommendation:	Adjust as required							
Priority:	2	ID:	1745	Floor:	5th	Cost: See *7	Duration:	See *7
Category:	Detention Facility Showers					State: 11B-610.5	Federal:	N/A
Issue:	Folding seat not provided							
Recommendation:	Provide folding seat							
Priority:	2	ID:	1746	Floor:	5th	Cost: See *7	Duration:	See *7
Category:	Detention Facility Showers					State: 11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower							
Recommendation:	Provide new bar per current standards							

Priority:	2	ID:	1747	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1748	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1749	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1750	Floor:	5th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	1751	Floor:	5th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1752	Floor:	5th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1753	Floor:	5th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1754	Floor:	5th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	1755	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1756	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1757	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1758	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	1759	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	1760	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1761	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1762	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1763	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1764	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1765	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1766	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1767	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								
Priority:	4	ID:	1768	Floor:	5th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	1769	Floor:	5th	Cost:	200	Duration:	2 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	1770	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1771	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	4	ID:	1772	Floor:	5th	Cost:	3000	Duration:	15 hrs
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	4	ID:	1773	Floor:	5th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	1774	Floor:	5th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1775	Floor:	5th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1776	Floor:	5th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	1777	Floor:	5th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1778	Floor:	5th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1779	Floor:	5th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	1780	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1781	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	1	ID:	1782	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1783	Floor:	5th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1784	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1785	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	1786	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1787	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1788	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1789	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1790	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1791	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1792	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1793	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								

Priority:	2	ID:	1794	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	3	ID:	1795	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1796	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1797	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	1798	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1799	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1800	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1801	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1802	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1803	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1804	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1805	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

Priority:	2	ID:	1806	Floor:	5th	Cost: See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State: 11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats							
Recommendation:	Provide accessible seating spaces as required							
Priority:	1	ID:	1807	Floor:	5th	Cost: See *8	Duration:	See *8
Category:	Corridors/Hallways					State: 11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10							
Recommendation:	Provide 44" width							
Priority:	1	ID:	1808	Floor:	5th	Cost: 1500	Duration:	2 hrs
Category:	Stairs					State: 11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott							
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards							
Priority:	1	ID:	1809	Floor:	5th	Cost: N/A	Duration:	N/A
Category:	Stairs					State: 1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum							
Recommendation:	Provide stairs with minimum 44" width							
Priority:	1	ID:	1810	Floor:	5th	Cost: 5000	Duration:	20 hrs
Category:	Stairs					State: 11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads							
Recommendation:	Provide handrails per current standards							
Priority:	1	ID:	1811	Floor:	5th	Cost: 6000	Duration:	30 hrs
Category:	Stairs					State: 11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only							
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance							
Priority:	1	ID:	1812	Floor:	5th	Cost: 10000	Duration:	50 hrs
Category:	Protruding Objects					State: 11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum							
Recommendation:	Provide required vertical clearance							
Priority:	4	ID:	1813	Floor:	5th	Cost: See *5	Duration:	See *5
Category:	Telephones					State: 11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo							
Recommendation:	Provide accessible TTY per current standards							
Priority:	2	ID:	1814	Floor:	5th	Cost: 1000	Duration:	5 hrs
Category:	Reach Range					State: 11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac							
Recommendation:	Provide assistance placard							
Priority:	1	ID:	1815	Floor:	5th	Cost: 500	Duration:	5 hrs
Category:	Protruding Objects					State: 11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi							
Recommendation:	Provide required clearance/adjust as required							
Priority:	1	ID:	1816	Floor:	5th	Cost: 500	Duration:	5 hrs
Category:	Protruding Objects					State: 11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi							
Recommendation:	Provide required clearance/adjust as required							
Priority:	1	ID:	1817	Floor:	5th	Cost: 500	Duration:	5 hrs
Category:	Protruding Objects					State: 11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi							
Recommendation:	Provide required clearance/adjust as required							

Priority:	2	ID:	1818	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1819	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	1820	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1821	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1822	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1823	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1824	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1825	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1826	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1827	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1828	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1829	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								

Priority:	2	ID:	1830	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	3	ID:	1831	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1832	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1833	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1834	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	1835	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1836	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1837	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1838	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1839	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

Priority:	2	ID:	1840	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1841	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	1842	Floor:	5th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	1843	Floor:	5th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1844	Floor:	5th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1845	Floor:	5th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1846	Floor:	5th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	4	ID:	1847	Floor:	5th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	1848	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1849	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1850	Floor:	5th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1851	Floor:	5th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	2	ID:	1852	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1853	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	1854	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1855	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1856	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1857	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1858	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1859	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1860	Floor:	5th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1861	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1862	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1863	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								

Priority:	2	ID:	1864	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1865	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1866	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1867	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1868	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1869	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1870	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1871	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1872	Floor:	5th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1873	Floor:	5th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

Priority:	4	ID:	1874	Floor:	5th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								

Main Annex Jail

6 - 1 Pod-A

Priority:	2	ID:	1875	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible32 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1876	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	1	ID:	1877	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1878	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1879	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1880	Floor:	6th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1881	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1882	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	1883	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1884	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1885	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								

Priority:	2	ID:	1886	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1887	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1888	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1889	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1890	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	1	ID:	1891	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1892	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1893	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	1894	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1895	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1896	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1897	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								

Priority:	3	ID:	1898	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1899	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1900	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	1901	Floor:	6th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	4	ID:	1902	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	1	ID:	1903	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1904	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1905	Floor:	6th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	1906	Floor:	6th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1907	Floor:	6th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1908	Floor:	6th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	1909	Floor:	6th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								

Priority:	1	ID:	1910	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

6 - 2 Pod-B

Priority:	2	ID:	1911	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1912	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	2	ID:	1913	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Dining/Bar Facilities					State:	11B-902.3	Federal:	902.3
Issue:	Height of tables over 34" AFF								
Recommendation:	Provide table(s) with required clearance per current standards								
Priority:	2	ID:	1914	Floor:	6th	Cost:	200	Duration:	2 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	1915	Floor:	6th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	1916	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1917	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1918	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1919	Floor:	6th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1920	Floor:	6th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1921	Floor:	6th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								

Priority:	1	ID:	1922	Floor:	6th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	1923	Floor:	6th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1924	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1925	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	1926	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1927	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1928	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1929	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1930	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1931	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1932	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	1933	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								

Priority:	1	ID:	1934	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1935	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1936	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1937	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1938	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	1939	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1940	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1941	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1942	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1943	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	1944	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	1	ID:	1945	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	2	ID:	1946	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1947	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

6 - 3 Pod-C

Priority:	2	ID:	1948	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1949	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	2	ID:	1950	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Minimum 27" high x 8" deep clearance under counter not provided								
Recommendation:	Provide minimum 27" high X 8" deep clearance under counter								
Priority:	4	ID:	1951	Floor:	6th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	1952	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1953	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1954	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1955	Floor:	6th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1956	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1957	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								

Priority:	1	ID:	1958	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1959	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1960	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	1961	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1962	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	1963	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	1964	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	1965	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	1	ID:	1966	Floor:	6th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	1967	Floor:	6th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	1968	Floor:	6th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	1969	Floor:	6th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								

Priority:	1	ID:	1970	Floor:	6th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	1971	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	1972	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	1973	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	1974	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	1975	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1976	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	1977	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	1978	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	1979	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	1980	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	1981	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								

Priority:	4	ID:	1982	Floor:	6th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	1	ID:	1983	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1984	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	1985	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

6 - 4 Visitation

Priority:	4	ID:	1986	Floor:	6th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								

6 - 5 Pod-D

Priority:	2	ID:	1987	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	1988	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	4	ID:	1989	Floor:	6th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	1990	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Minimum 27" high x 8" deep clearance under counter not provided								
Recommendation:	Provide minimum 27" high X 8" deep clearance under counter								
Priority:	1	ID:	1991	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	1992	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	1	ID:	1993	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	1994	Floor:	6th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	1995	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	1996	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	1997	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	1998	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	1999	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	2000	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	2001	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	2002	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	2003	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	2004	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								

Priority:	1	ID:	2005	Floor:	6th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	2006	Floor:	6th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	2007	Floor:	6th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	2008	Floor:	6th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	2009	Floor:	6th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	2010	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	2011	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	2012	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	2013	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	2014	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	2015	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	2016	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								

Priority:	2	ID:	2017	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	2018	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	2019	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	2020	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	2021	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	2022	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

6 - 6 Pod-F

Priority:	2	ID:	2023	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible48 Seats								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	2024	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	4	ID:	2025	Floor:	6th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	2026	Floor:	6th	Cost:	200	Duration:	2 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	2027	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Minimum 27" high x 8" deep clearance under counter not provided								
Recommendation:	Provide minimum 27" high X 8" deep clearance under counter								
Priority:	1	ID:	2028	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	1	ID:	2029	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	2030	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	2031	Floor:	6th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	2032	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	2033	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	2034	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	2035	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	2036	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	2037	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	2038	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	2039	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	2040	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								

Priority:	2	ID:	2041	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	1	ID:	2042	Floor:	6th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	2043	Floor:	6th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	2044	Floor:	6th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	2045	Floor:	6th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	2046	Floor:	6th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	2047	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	2048	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	2049	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	2050	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	3	ID:	2051	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	2052	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								

Priority:	2	ID:	2053	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	2054	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	2055	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	2	ID:	2056	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	2057	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	1	ID:	2058	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	2059	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	2060	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

6 - 7 Pod-E

Priority:	2	ID:	2061	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible								
Recommendation:	Provide accessible seating spaces as required								
Priority:	1	ID:	2062	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	N/A
Issue:	Minimum 44" width not provided/where serving occupant load over 10								
Recommendation:	Provide 44" width								
Priority:	4	ID:	2063	Floor:	6th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	2064	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Minimum 27" high x 8" deep clearance under counter not provided								
Recommendation:	Provide minimum 27" high X 8" deep clearance under counter								

Priority:	1	ID:	2065	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	2066	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	1	ID:	2067	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	2068	Floor:	6th	Cost:	1000	Duration:	5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	2069	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	2070	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	1	ID:	2071	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	2	ID:	2072	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	2073	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	2074	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	2075	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	2076	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								

Priority:	2	ID:	2077	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								
Priority:	2	ID:	2078	Floor:	6th	Cost:	See *7	Duration:	See *7
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	1	ID:	2079	Floor:	6th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	2080	Floor:	6th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	2081	Floor:	6th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.3	Federal:	505.10.3
Issue:	Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bott								
Recommendation:	Modify handrail(s) to provide required extensions or replace per current standards								
Priority:	1	ID:	2082	Floor:	6th	Cost:	6000	Duration:	30 hrs
Category:	Stairs					State:	11B-504.3	Federal:	504.3
Issue:	Open risers provided interior stairways only								
Recommendation:	Install closer strip at open risers or remove and replace stairs for compliance								
Priority:	1	ID:	2083	Floor:	6th	Cost:	10000	Duration:	50 hrs
Category:	Protruding Objects					State:	11B-307.4	Federal:	307.4
Issue:	Vertical clearance not 80" high minimum								
Recommendation:	Provide required vertical clearance								
Priority:	1	ID:	2084	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	2085	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	2086	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	2087	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	2088	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								

Priority:	2	ID:	2089	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	2090	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	2091	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	2092	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	2093	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	1	ID:	2094	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	2	ID:	2095	Floor:	6th	Cost:	See *9	Duration:	See *9
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	2096	Floor:	6th	Cost:	See *8	Duration:	See *8
Category:	Accessible Path of Travel					State:	11B-206.2.2	Federal:	206.2.2
Issue:	Accessible path of travel not provided								
Recommendation:	Provide accessible path of travel								

6 - 8 Gym

Priority:	4	ID:	2097	Floor:	6th	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								
Priority:	2	ID:	2098	Floor:	6th	Cost:	1000	Duration:	1 hr
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Minimum 17" deep toe clearance under counter not provided								
Recommendation:	Provide required toe clearance								
Priority:	2	ID:	2099	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	1	ID:	2100	Floor:	6th	Cost:	See *10	Duration:	See *10
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	2	ID:	2101	Floor:	6th	Cost:	2000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	2102	Floor:	6th	Cost:	See *10	Duration:	See *10
Category:	Detention Facility Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	2	ID:	2103	Floor:	6th	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	2104	Floor:	6th	Cost:	See *10	Duration:	See *10
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	2105	Floor:	6th	Cost:	See *10	Duration:	See *10
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	3	ID:	2106	Floor:	6th	Cost:	3000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	4	ID:	2107	Floor:	6th	Cost:	See *10	Duration:	See *10
Category:	Telephones					State:	11B-704.2.1	Federal:	704.2.1
Issue:	Clear floor space not provided for wheelchair accessible telephone								
Recommendation:	Reconfigure telephone location to provide required clear floor space								
Priority:	4	ID:	2108	Floor:	6th	Cost:	See *5	Duration:	See *5
Category:	Telephones					State:	11B-217.4.8	Federal:	217.4.8
Issue:	At least one TTY not provided in a secured area of a correctional facility if a public phone fo								
Recommendation:	Provide accessible TTY per current standards								
Priority:	2	ID:	2109	Floor:	6th	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	2110	Floor:	6th	Cost:	See *10	Duration:	See *10
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	2111	Floor:	6th	Cost:	See *10	Duration:	See *10
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								

Priority:	2	ID:	2112	Floor:	6th	Cost:	See *10	Duration:	See *10
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Required 30" by 48" clear floor space not provided at accessible seating spaces								
Recommendation:	Provide required clear floor space at accessible seating								
Priority:	1	ID:	2113	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Doors / Gates					State:	11B-404.2.3	Federal:	404.2.3
Issue:	Minimum 32" wide clear width not provided								
Recommendation:	Provide 32" wide clear width								
Priority:	1	ID:	2114	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Walks					State:	11B-403.3	Federal:	403.3
Issue:	Cross slope of walk over 2.083% (1:48)								
Recommendation:	Remove and replace concrete walk with maximum 2.0% slope cross slope where cross slop								
Priority:	2	ID:	2115	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.7	Federal:	608.7
Issue:	Threshold into shower greater than 1/2" height								
Recommendation:	Provide transition into shower								
Priority:	2	ID:	2116	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.5.2	Federal:	N/A
Issue:	Centerline of water control not 39"-41" above shower floor and top of unit not greater than 4								
Recommendation:	Adjust as required								
Priority:	2	ID:	2117	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Accessories					State:	11B-603.4	Federal:	603.4
Issue:	Coat hook measured over 48" AFF								
Recommendation:	Reset hook to maximum 48" AFF								
Priority:	2	ID:	2118	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.9	Federal:	N/A
Issue:	Shower floor slope greater that 2.083 percent								
Recommendation:	Provide accessible shower								
Priority:	2	ID:	2119	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-610.5	Federal:	N/A
Issue:	Folding seat not provided								
Recommendation:	Provide folding seat								
Priority:	2	ID:	2120	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on back wall for standard or alternate shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	2121	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.3.3	Federal:	608.3.3
Issue:	Grab bar not provided on side wall opposite of entry in alternate shower								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	2122	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.3.2	Federal:	608.3.2
Issue:	Grab bar not provided on side wall opposite of seat in standard shower								
Recommendation:	Provide new bar per current standards								
Priority:	2	ID:	2123	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Detention Facility Showers					State:	11B-608.6	Federal:	608.6
Issue:	Minimum 59" long hose not provided								
Recommendation:	Provide required hose and/or adjust height per current standards								

Priority:	2	ID:	2124	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	4	ID:	2125	Floor:	6th	Cost:	See *11	Duration:	See *11
Category:	Accessible Clearance					State:	11B-304.3	Federal:	304.3
Issue:	Required 60" diameter circle or 'T'-shaped clear floor space not provided within room								
Recommendation:	Provide required clearance								
Priority:	2	ID:	2126	Floor:	6th	Cost:	500	Duration:	5 hrs
Category:	Dining/Bar Facilities					State:	11B-226.1	Federal:	226.1
Issue:	At least 5% of total seating is not accessible								
Recommendation:	Provide accessible seating spaces as required								
Priority:	4	ID:	2127	Floor:	6th	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								

6 - 10 Corridor

Priority:	2	ID:	2128	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	2129	Floor:	6th	Cost:	2000	Duration:	8 hrs
Category:	Protruding Objects					State:	11B-307.2	Federal:	307.2
Issue:	Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maxi								
Recommendation:	Provide required clearance/adjust as required								
Priority:	4	ID:	2130	Floor:	6th	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								

6 - 11 Conference

Priority:	2	ID:	2131	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	2132	Floor:	6th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	2133	Floor:	6th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								

6 - 12 Janitor

Priority:	1	ID:	2134	Floor:	6th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	2135	Floor:	6th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	2	ID:	2136	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

6 - 13 Scullery

Priority:	1	ID:	2137	Floor:	6th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	2138	Floor:	6th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	2139	Floor:	6th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	2	ID:	2140	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

6 - 14 Storage

Priority:	1	ID:	2141	Floor:	6th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	2142	Floor:	6th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	2	ID:	2143	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

6 - 15 Stairwell

Priority:	1	ID:	2144	Floor:	6th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	2145	Floor:	6th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	2146	Floor:	6th	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.2	Federal:	505.10.2
Issue:	Extension of handrail at top stairs not 12" minimum of level distance (parallel with floor) bey								
Recommendation:	Modify handrail(s) to provide required 12" extensions or replace per current standards								
Priority:	2	ID:	2147	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

6 - 16 Staff Restroom

Priority:	1	ID:	2148	Floor:	6th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	2149	Floor:	6th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	2150	Floor:	6th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	2	ID:	2151	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								
Priority:	2	ID:	2152	Floor:	6th	Cost:	50	Duration:	.5 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	3	ID:	2153	Floor:	6th	Cost:	2000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	3	ID:	2154	Floor:	6th	Cost:	2000	Duration:	16 hrs
Category:	Water Closets (GENERAL)					State:	11B-604.6	Federal:	604.6
Issue:	Flush controls not on open side of fixture (non-ambulatory accessible compartments)								
Recommendation:	Remove and replace water closet per current standards								

Priority:	3	ID:	2155	Floor:	6th	Cost:	300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	2156	Floor:	6th	Cost:	300	Duration:	1.5
Category:	Water Closets (GENERAL)					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	3	ID:	2157	Floor:	6th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	2158	Floor:	6th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	604.7
Issue:	Toilet paper dispenser not located min. 7" from edge of toilet								
Recommendation:	Relocate TPD with 7" minimum from edge of toilet								
Priority:	2	ID:	2159	Floor:	6th	Cost:	50	Duration:	.5 hrs
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide assistance placard								
Priority:	2	ID:	2160	Floor:	6th	Cost:	500	Duration:	1 hr
Category:	Operable parts					State:	11B-309.4	Federal:	309.4
Issue:	Operable part requires tight grasping, pinching or twisting of the wrist								
Recommendation:	Remove and replace operable part								
Priority:	3	ID:	2161	Floor:	6th	Cost:	50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	3	ID:	2162	Floor:	6th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	2163	Floor:	6th	Cost:	100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecti								
Recommendation:	Reset mirror to maximum 40" AFF to reflecting surface								
Priority:	3	ID:	2164	Floor:	6th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								

6 - 17 Storage

Priority:	1	ID:	2165	Floor:	6th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	1	ID:	2166	Floor:	6th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	2	ID:	2167	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

6 - 18 Stairwell

Priority:	1	ID:	2168	Floor:	6th	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	2169	Floor:	6th	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	2	ID:	2170	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

6 - 19 Conference

Priority:	1	ID:	2171	Floor:	6th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								
Priority:	1	ID:	2172	Floor:	6th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	1	ID:	2173	Floor:	6th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille								
Recommendation:	Provide sign per current standards								
Priority:	2	ID:	2174	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Priority:	1	ID:	2175	Floor:	6th	Cost: See *2	Duration:	See *2
Category:	Doors / Gates					State: 11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open							
Recommendation:	Adjust closing device							
Priority:	1	ID:	2176	Floor:	6th	Cost: See *1	Duration:	See *1
Category:	Interior Signage					State: 11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille							
Recommendation:	Provide sign per current standards							
Priority:	1	ID:	2177	Floor:	6th	Cost: 500	Duration:	1 hr
Category:	Doors / Gates					State: 11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided							
Recommendation:	Remove and replace with lever-type hardware							
Priority:	2	ID:	2178	Floor:	6th	Cost: See *6	Duration:	See *6
Category:	Reach Range					State: 11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac							
Recommendation:	Provide required reach range							
Priority:	2	ID:	2179	Floor:	6th	Cost: See *6	Duration:	See *6
Category:	Reach Range					State: 11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box							
Recommendation:	Provide occupancy room sensor or lower switch							
Priority:	2	ID:	2180	Floor:	6th	Cost: See *6	Duration:	See *6
Category:	Reach Range					State: 11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac							
Recommendation:	Provide required reach range							
Priority:	1	ID:	2181	Floor:	6th	Cost: See *1	Duration:	See *1
Category:	Interior Signage					State: 11B-703.5.5	Federal:	703.5.5
Issue:	Lettering height on sign over 40"-70" AFF (to bottom) not 5/8" minimum							
Recommendation:	Remove and replace sign per current standards							
Priority:	4	ID:	2182	Floor:	6th	Cost: 50	Duration:	.25 hrs
Category:	Sinks (GENERAL)					State: 11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)							
Recommendation:	Insulate piping as required to protect against contact							
Priority:	4	ID:	2183	Floor:	6th	Cost: 1000	Duration:	8 hrs
Category:	Sinks (ADULT)					State: 11B-606.3	Federal:	606.3
Issue:	Height of rim or counter measured over 34" AFF							
Recommendation:	Reset sink/or provide maximum 34" AFF counter							
Priority:	2	ID:	2184	Floor:	6th	Cost: 50	Duration:	.5 hrs
Category:	Reach Range					State: 11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac							
Recommendation:	Provide assistance placard							
Priority:	1	ID:	2185	Floor:	6th	Cost: 500	Duration:	1 hr
Category:	Doors / Gates					State: 11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided							
Recommendation:	Remove and replace with lever-type hardware							
Priority:	1	ID:	2186	Floor:	6th	Cost: See *1	Duration:	See *1
Category:	Interior Signage					State: 11B-703.3	Federal:	703.3
Issue:	Room identification sign not provided in Braille							
Recommendation:	Provide sign per current standards							

Priority:	1	ID:	2187	Floor:	6th	Cost:	See *1	Duration:	See *1
Category:	Interior Signage					State:	11B-703.7.2.6	Federal:	N/A
Issue:	Unisex toilet door sign not 1/4" thick of contrasting circle and triangle symbols with the circle								
Recommendation:	Provide sign per current standards								
Priority:	3	ID:	2188	Floor:	6th	Cost:	2000	Duration:	16 hrs
Category:	Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	3	ID:	2189	Floor:	6th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-604.7	Federal:	N/A
Issue:	Toilet paper dispenser not located on sidewall below grab bar								
Recommendation:	Relocate TPD below sidewall grab bar								
Priority:	3	ID:	2190	Floor:	6th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Toilet seat dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	2191	Floor:	6th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Soap dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	2192	Floor:	6th	Cost:	100	Duration:	1 hr
Category:	Accessories					State:	11B-603.3	Federal:	603.3
Issue:	Mirror (not over lavatory) measured over 35" AFF to the bottom edge of the reflecting surfac								
Recommendation:	Reset mirror to maximum 35" AFF to reflecting surface								
Priority:	3	ID:	2193	Floor:	6th	Cost:	50	Duration:	.5 hrs
Category:	Accessories					State:	11B-603.5	Federal:	N/A
Issue:	Towel dispenser measured over 40" AFF to operable part								
Recommendation:	Reset accessories to maximum 40" AFF to operating controls								
Priority:	3	ID:	2194	Floor:	6th	Cost:	50	Duration:	.25 hrs
Category:	Lavatories (GENERAL)					State:	11B-606.5	Federal:	606.5
Issue:	Drain and/or hot water piping not insulated (wrapped)								
Recommendation:	Insulate as required to protect against contact								
Priority:	4	ID:	2195	Floor:	6th	Cost:	10000	Duration:	50 hrs
Category:	Accessible Clearance					State:	11B-304.3	Federal:	304.3
Issue:	Required 60" diameter circle or 'T'-shaped clear floor space not provided within room								
Recommendation:	Provide required clearance								
Priority:	2	ID:	2196	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	2197	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	2198	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Switch measured over 48" AFF / measure to top of switch box								
Recommendation:	Provide occupancy room sensor or lower switch								

Priority:	1	ID:	2199	Floor:	6th	Cost:	See *2	Duration:	See *2
Category:	Doors / Gates					State:	11B-404.2.9	Federal:	404.2.9
Issue:	Door requires over 5 lbs force to open								
Recommendation:	Adjust closing device								

6 - 21 Classroom

Priority:	1	ID:	2200	Floor:	6th	Cost:	500	Duration:	1 hr
Category:	Doors / Gates					State:	11B-404.2.7	Federal:	404.2.7
Issue:	Lever-type hardware not provided								
Recommendation:	Remove and replace with lever-type hardware								
Priority:	4	ID:	2201	Floor:	6th	Cost:	See *4	Duration:	See *4
Category:	Alarms					State:	11B-215.2	Federal:	215.2
Issue:	Audible Fire Alarm not provided in public or common use areas								
Recommendation:	Provide audible and visual fire alarm per current standards								
Priority:	2	ID:	2202	Floor:	6th	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	2	ID:	2203	Floor:	6th	Cost:	1000	Duration:	1 hr
Category:	Dining/Bar Facilities					State:	11B-902.2	Federal:	902.2
Issue:	Minimum 27" high x 8" deep clearance under counter not provided								
Recommendation:	Provide minimum 27" high X 8" deep clearance under counter								

6 - 22 Corridor

Priority:	4	ID:	2204	Floor:	6th	Cost:	2000	Duration:	8 hrs
Category:	Drinking Fountains					State:	11B-211.3	Federal:	211.3
Issue:	50% of all drinking fountains are not standing accessible								
Recommendation:	Install for standing persons drinking fountain(s)								
Priority:	4	ID:	2205	Floor:	6th	Cost:	1000	Duration:	8 hrs
Category:	Drinking Fountains					State:	11B-602.2	Federal:	602.2
Issue:	Knee clearance space under drinking fountain not provided/8" deep at 27" tall and 11" deep								
Recommendation:	Reset fountain for compliance; replace if required								

Main Annex Jail

Yard-1 — Roof - Yard

Priority:	3	ID:	2206	Floor:	Roof	Cost:	3000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	2207	Floor:	Roof	Cost:	2000	Duration:	10 hrs
Category:	Detention Facility Urinals					State:	11B-605.2	Federal:	605.2
Issue:	Urinal rim measured over 17" AFF								
Recommendation:	Adjust as required								
Priority:	1	ID:	2208	Floor:	Roof	Cost:	2000	Duration:	8 hrs
Category:	Corridors/Hallways					State:	11B-403.5.1	Federal:	403.5.1
Issue:	Minimum 36" clear width not provided/where serving occupant load less than 10								
Recommendation:	Provide 36" clear width								
Priority:	2	ID:	2209	Floor:	Roof	Cost:	2000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	2210	Floor:	Roof	Cost:	2000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.2	Federal:	N/A
Issue:	Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet com								
Recommendation:	Relocate/adjust as required								
Priority:	2	ID:	2211	Floor:	Roof	Cost:	800	Duration:	1 hr
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on rear wall								
Recommendation:	Provide required grab bar								
Priority:	2	ID:	2212	Floor:	Roof	Cost:	800	Duration:	1 hr
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5	Federal:	604.5
Issue:	Grab bars not provided on sidewall								
Recommendation:	Provide required grab bar								
Priority:	4	ID:	2213	Floor:	Roof	Cost:	2000	Duration:	8 hrs
Category:	Drinking Fountains					State:	11B-211.3	Federal:	211.3
Issue:	50% of all drinking fountains are not wheel chair accessible								
Recommendation:	Install wheel chair accessible drinking fountain(s)								
Priority:	3	ID:	2214	Floor:	Roof	Cost:	3000	Duration:	16 hrs
Category:	Lavatories (ADULT)					State:	11B-606.2	Federal:	N/A
Issue:	Minimum 29" clearance under lavatory apron not provided (measured at front edge)								
Recommendation:	Reset lavatory as required								
Priority:	2	ID:	2215	Floor:	Roof	Cost:	2000	Duration:	16 hrs
Category:	Detention Facility Water Closets (ADULT)					State:	11B-604.4	Federal:	604.4
Issue:	Seat height measured less than 17" AFF								
Recommendation:	Provide water closet per current standards								
Priority:	2	ID:	2216	Floor:	Roof	Cost:	500	Duration:	1 hr
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.1	Federal:	604.5.1
Issue:	Sidewall grab bar minimum extension 54" from rear wall								
Recommendation:	Adjust as required and/or provide new bar per current standards								

Priority:	2	ID:	2217	Floor:	Roof	Cost:	500	Duration:	1 hr
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.5.2	Federal:	604.5.2
Issue:	Rear wall grab bar not 24" minimum length from C/L of toilet towards open side								
Recommendation:	Adjust as required and/or provide new bar per current standards								
Priority:	2	ID:	2218	Floor:	Roof	Cost:	8000	Duration:	40 hrs
Category:	Detention Facility Water Closets (GENERA					State:	11B-604.3.1	Federal:	604.3.1
Issue:	Water closet clearance not 60" wide measured perpendicular from the side wall								
Recommendation:	Provide required clearance or provide alternative accessible water closet								
Priority:	1	ID:	2219	Floor:	Roof	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.2	Federal:	505.10.2
Issue:	Extension of handrail at top stairs not 12" minimum of level distance (parallel with floor) beye								
Recommendation:	Modify handrail(s) to provide required 12" extensions or replace per current standards								
Priority:	1	ID:	2220	Floor:	Roof	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	2221	Floor:	Roof	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	2	ID:	2222	Floor:	Roof	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								
Priority:	1	ID:	2223	Floor:	Roof	Cost:	N/A	Duration:	N/A
Category:	Stairs					State:	1009.4	Federal:	N/A
Issue:	Width of stairs not 44" minimum								
Recommendation:	Provide stairs with minimum 44" width								
Priority:	1	ID:	2224	Floor:	Roof	Cost:	5000	Duration:	20 hrs
Category:	Stairs					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" above nosing of threads								
Recommendation:	Provide handrails per current standards								
Priority:	1	ID:	2225	Floor:	Roof	Cost:	1500	Duration:	2 hrs
Category:	Stairs					State:	11B-505.10.2	Federal:	505.10.2
Issue:	Extension of handrail at top stairs not 12" minimum of level distance (parallel with floor) beye								
Recommendation:	Modify handrail(s) to provide required 12" extensions or replace per current standards								
Priority:	2	ID:	2226	Floor:	Roof	Cost:	See *6	Duration:	See *6
Category:	Reach Range					State:	11B-308.2.1	Federal:	308.2.1
Issue:	Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reac								
Recommendation:	Provide required reach range								

Main Annex Jail

O - 1 — Outdoor

Priority:	1	ID:	2227	Floor:	Outdoor	Cost:	6000	Duration:	30 hrs
Category:	Pedestrian Ramps					State:	11B-405.7.1	Federal:	405.7.1
Issue:	Slope of top landing exceeds 2.083% (1:48) in all directions								
Recommendation:	Provide landing with maximum 2.0% slope in all directions								
Priority:	1	ID:	2228	Floor:	Outdoor	Cost:	1500	Duration:	8 hrs
Category:	Pedestrian Ramps					State:	11B-505.10.1	Federal:	505.10.1
Issue:	Extension of handrail at top of ramp not 12" minimum of level distance beyond ramp								
Recommendation:	Provide handrails to current standards with required extensions								
Priority:	1	ID:	2229	Floor:	Outdoor	Cost:	5000	Duration:	25 hrs
Category:	Pedestrian Ramps					State:	11B-505.3	Federal:	505.3
Issue:	Handrail(s) not continuous for full length of ramp								
Recommendation:	Remove and replace handrails to current standards								
Priority:	1	ID:	2230	Floor:	Outdoor	Cost:	15000	Duration:	80 hrs
Category:	Pedestrian Ramps					State:	11B-405.2	Federal:	405.2
Issue:	Directional slope of ramp exceeds 8.33%								
Recommendation:	Provide ramp per current standards								
Priority:	1	ID:	2231	Floor:	Outdoor	Cost:	15000	Duration:	80 hrs
Category:	Pedestrian Ramps					State:	11B-405.2	Federal:	405.2
Issue:	Directional slope of ramp exceeds 8.33%								
Recommendation:	Provide ramp per current standards								
Priority:	1	ID:	2232	Floor:	Outdoor	Cost:	1500	Duration:	8 hrs
Category:	Pedestrian Ramps					State:	11B-505.10.1	Federal:	505.10.1
Issue:	Extension of handrail at bottom of ramp not 12" minimum of level distance beyond ramp								
Recommendation:	Provide handrails to current standards with required extensions								
Priority:	1	ID:	2233	Floor:	Outdoor	Cost:	5000	Duration:	25 hrs
Category:	Pedestrian Ramps					State:	11B-505.4	Federal:	505.4
Issue:	Height of handrail(s) less than 34" to top (above ramp surface)								
Recommendation:	Provide handrails to current standards								

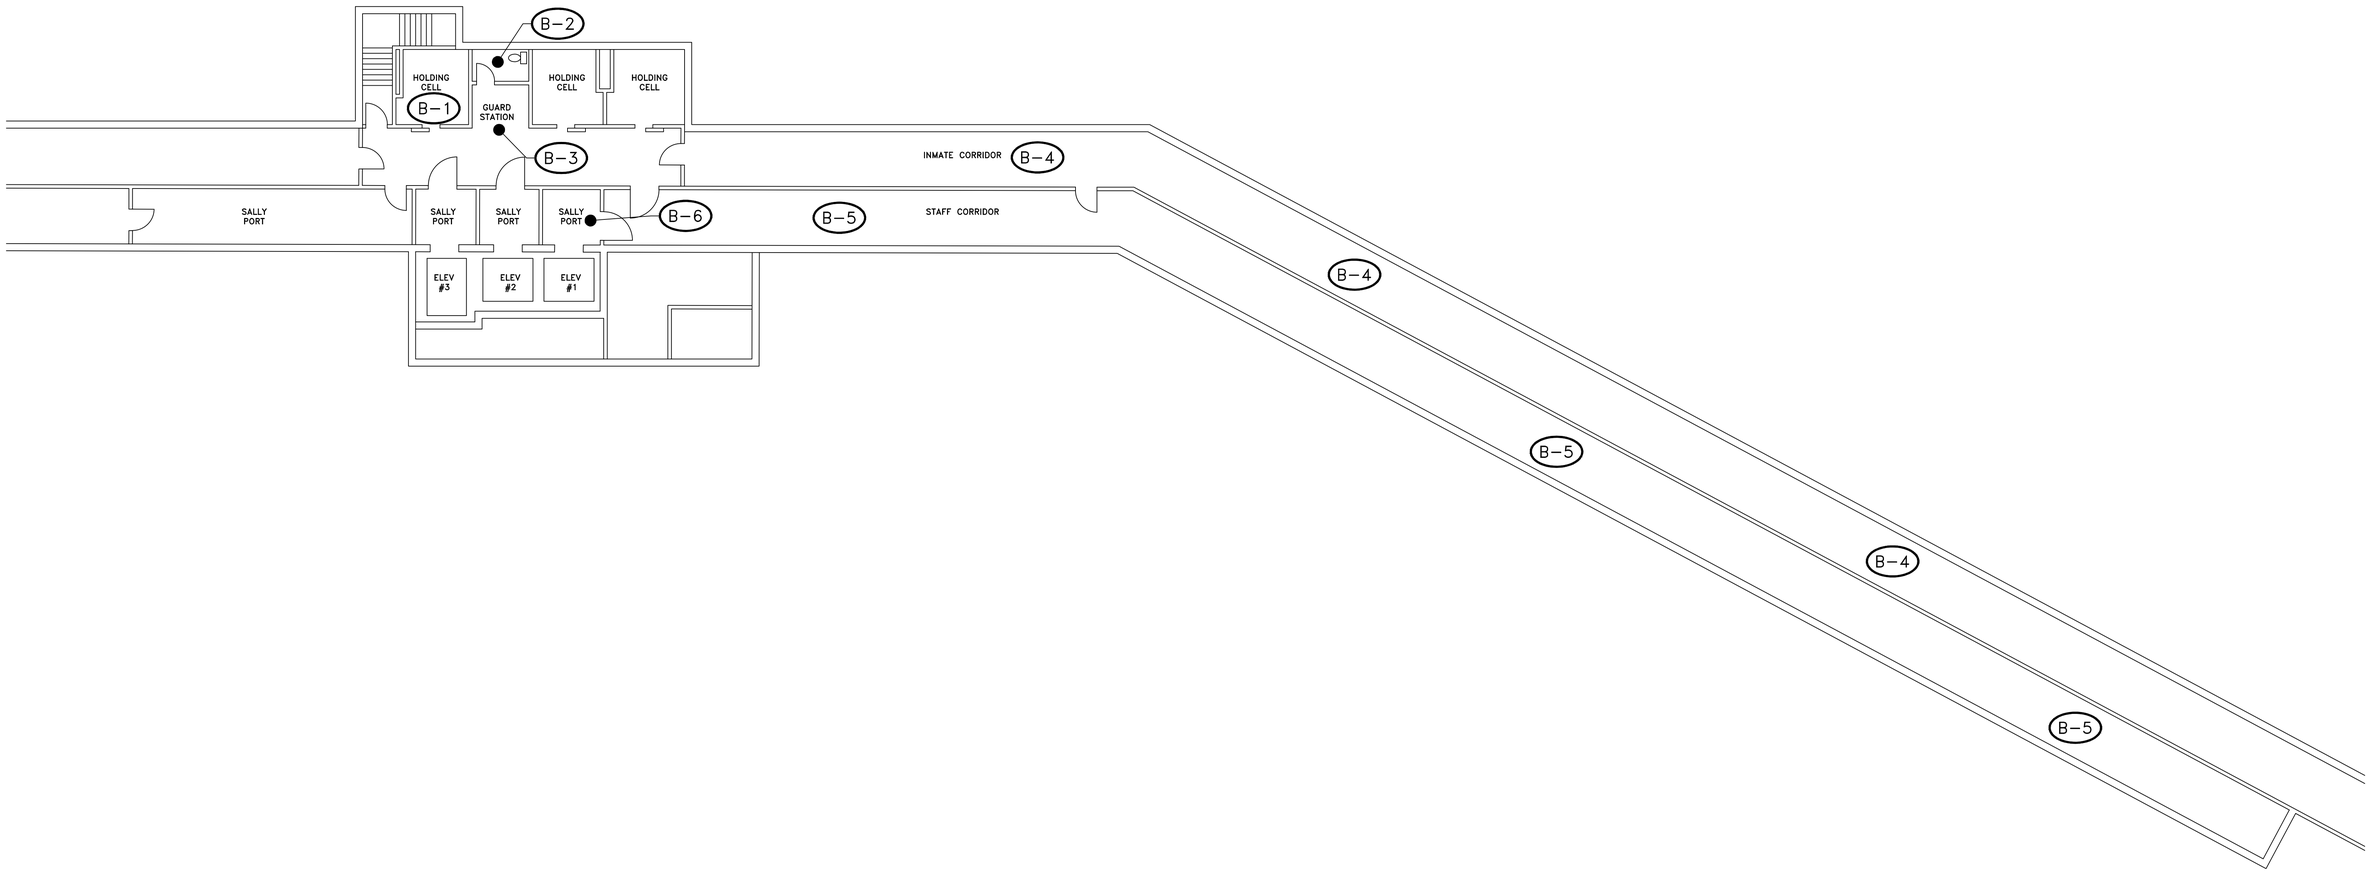

THE COUNTY OF FRESNO 1856

MAIN ANNEX JAIL - BASEMENT

LOCATION MAP

LARS ANDERSEN & ASSOCIATES, INC.
CIVIL ENGINEERS - LAND SURVEYORS - PLANNERS
4694 WEST JACQUELYN AVENUE, FRESNO CALIFORNIA 93722
TEL: 559 276-2790 FAX: 559 276-0850 WWW.LARSANDERSEN.COM

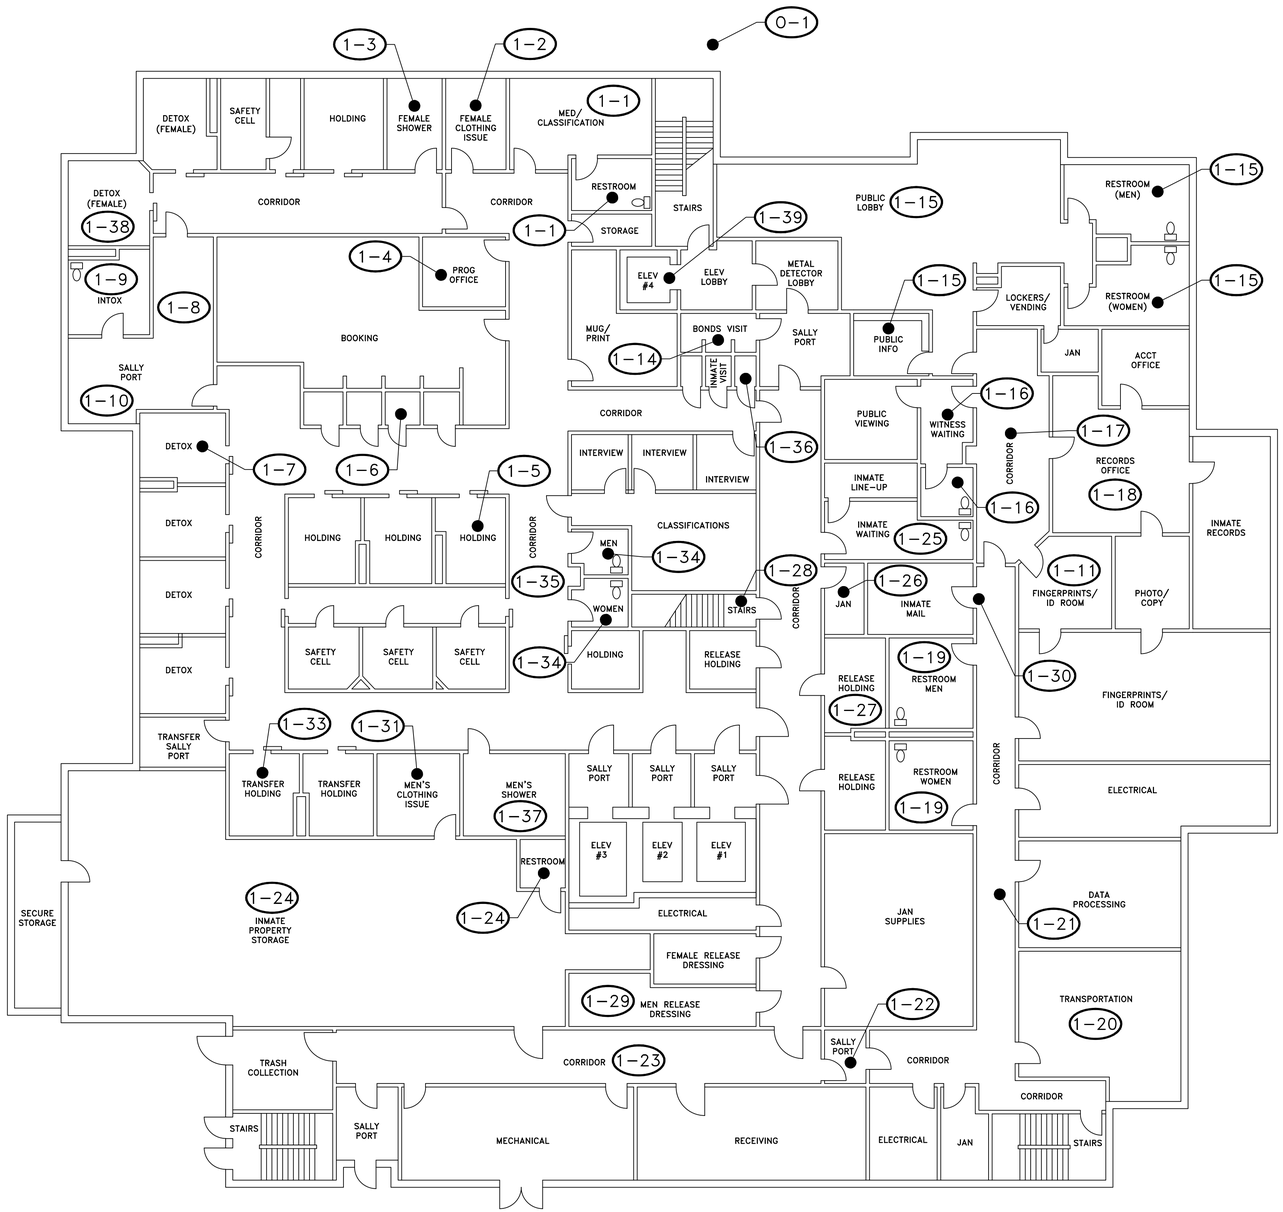

MAIN ANNEX JAIL - FIRST FLOOR

LOCATION MAP

LARS ANDERSEN & ASSOCIATES, INC.
CIVIL ENGINEERS - LAND SURVEYORS - PLANNERS
4694 WEST JACQUELYN AVENUE, FRESNO CALIFORNIA 93722
TEL: 559 276-2790 FAX: 559 276-0850 WWW.LARSANDERSEN.COM

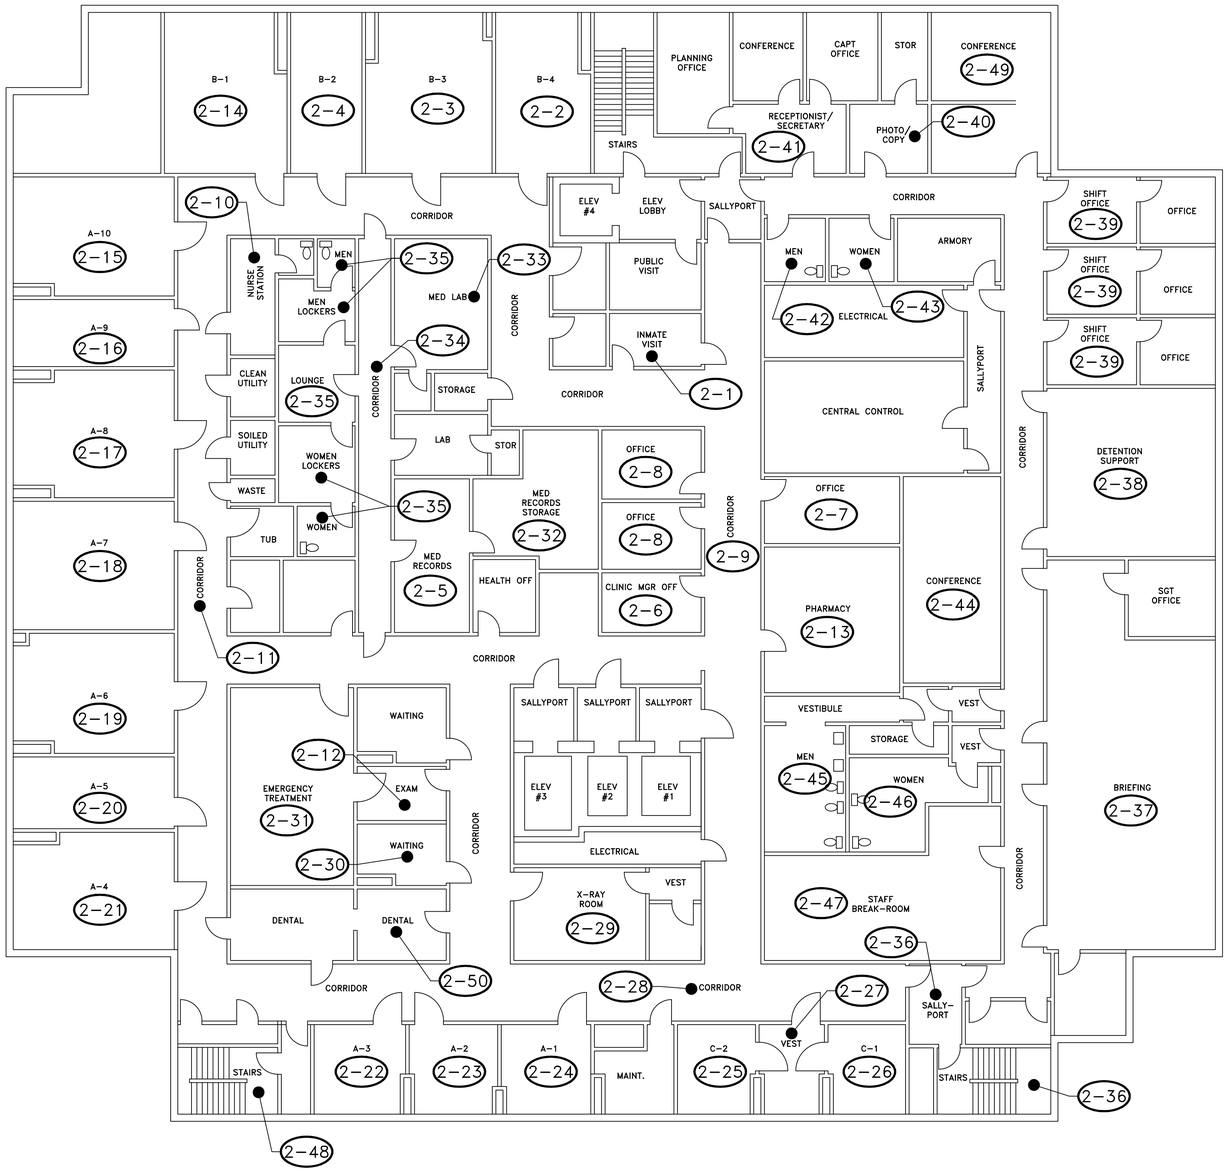

MAIN ANNEX JAIL - SECOND FLOOR

LOCATION MAP

LARS ANDERSEN & ASSOCIATES, INC.
CIVIL ENGINEERS - LAND SURVEYORS - PLANNERS
4694 WEST JACQUELYN AVENUE, FRESNO CALIFORNIA 93722
TEL: 559 276-2790 FAX: 559 276-0850 WWW.LARSANDERSEN.COM

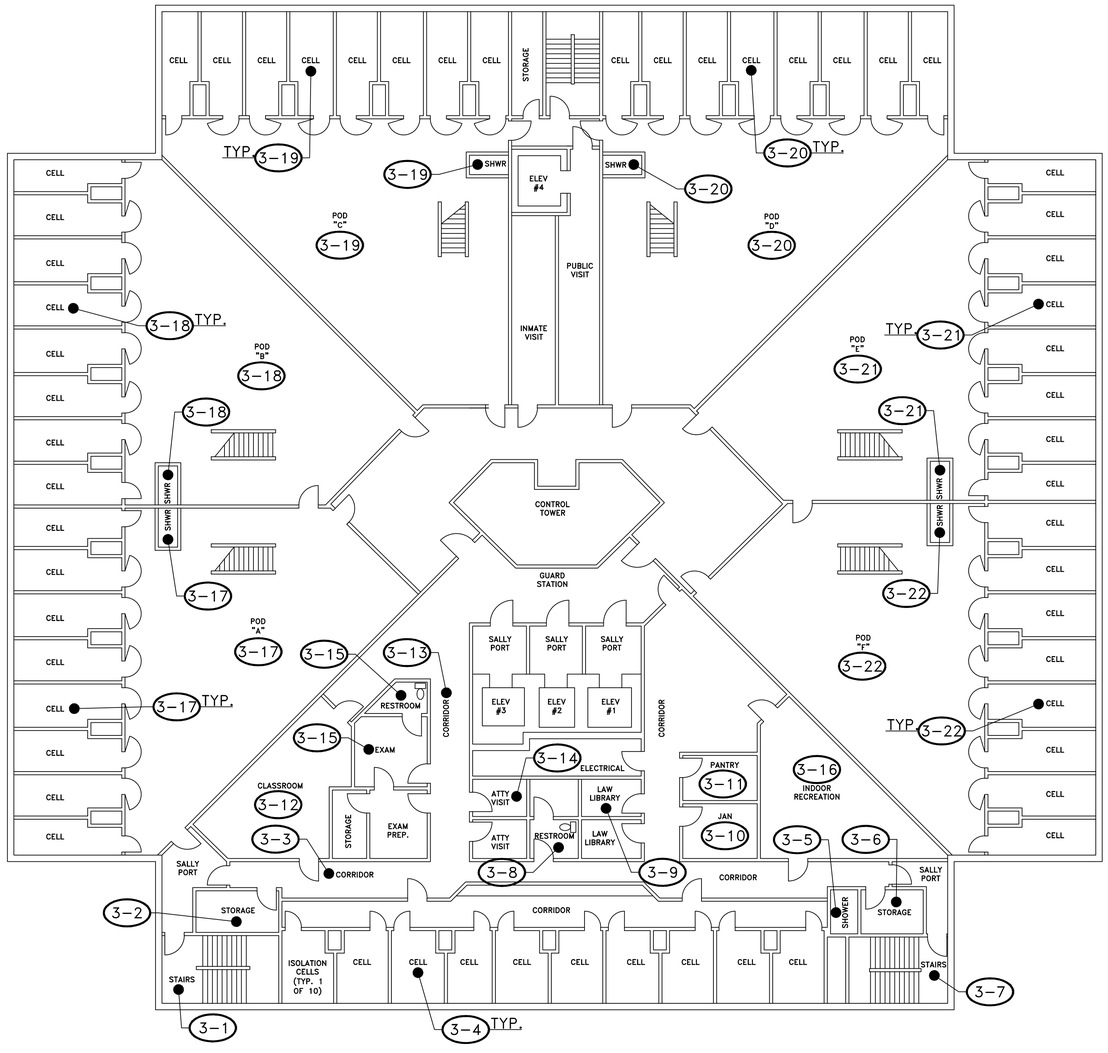

MAIN FLOOR HOUSING

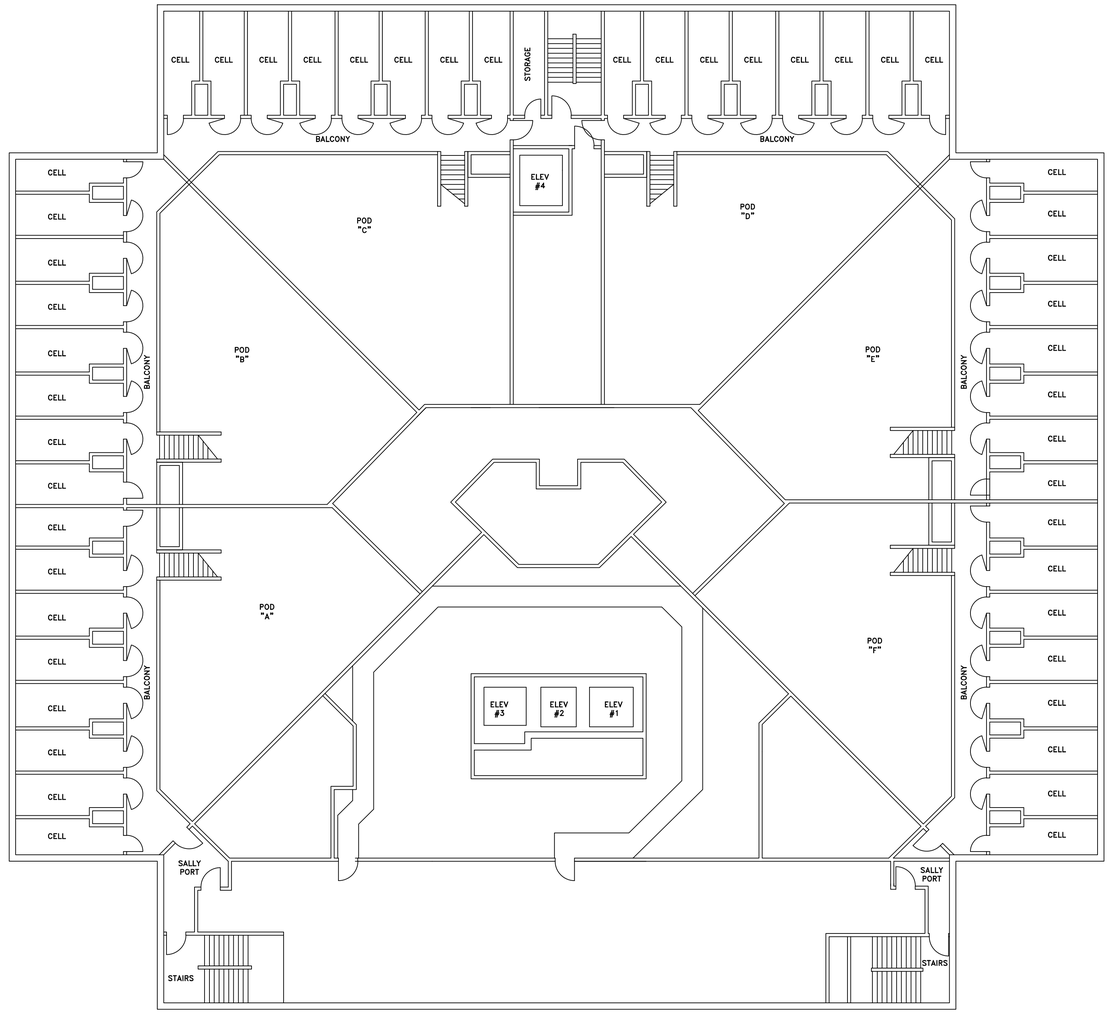

TOP FLOOR HOUSING

MAIN ANNEX JAIL - THIRD FLOOR

LOCATION MAP

LARS ANDERSEN & ASSOCIATES, INC.
CIVIL ENGINEERS - LAND SURVEYORS - PLANNERS
4694 WEST JACQUELYN AVENUE, FRESNO CALIFORNIA 93722
TEL: 559 276-2790 FAX: 559 276-0850 WWW.LARSANDERSEN.COM

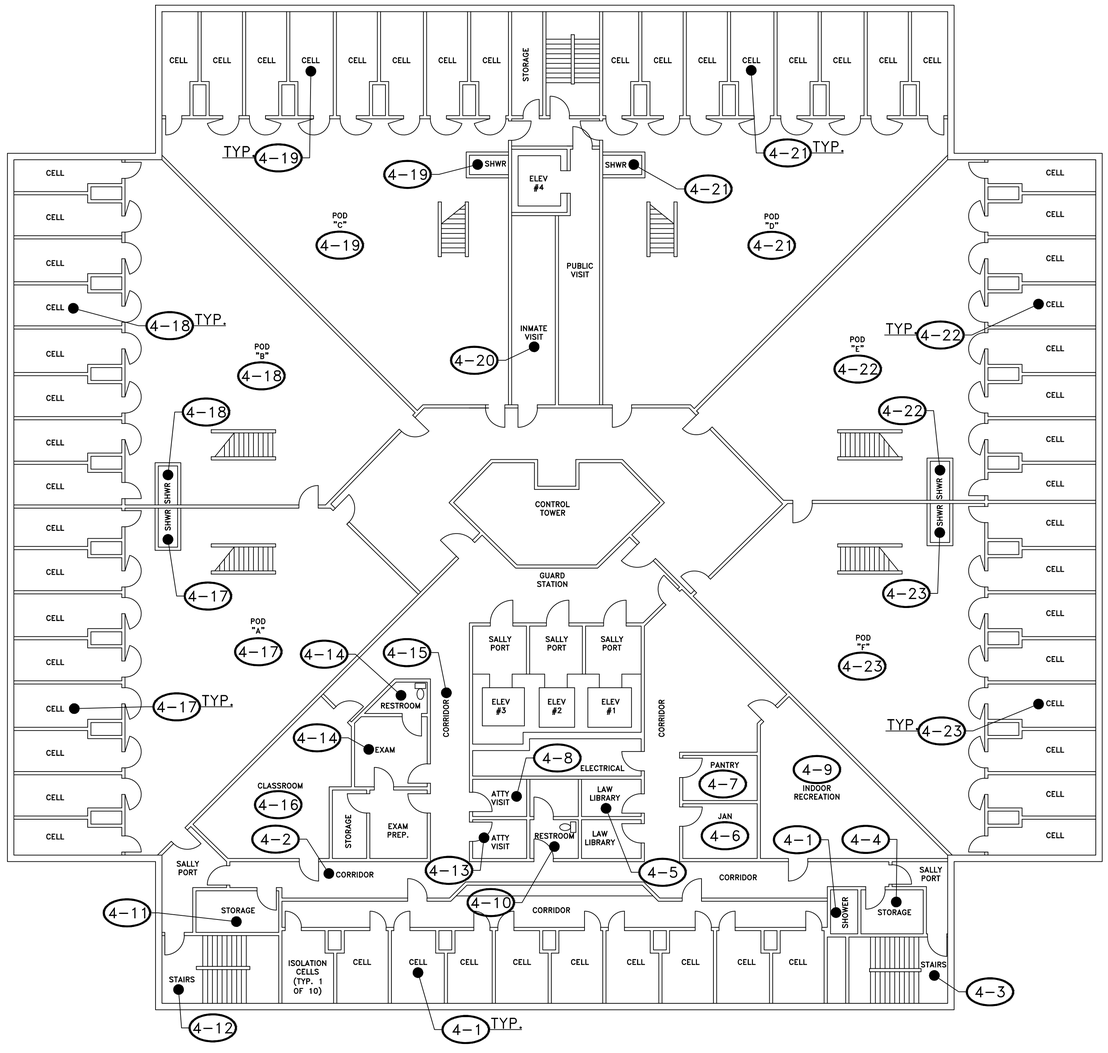

MAIN FLOOR HOUSING

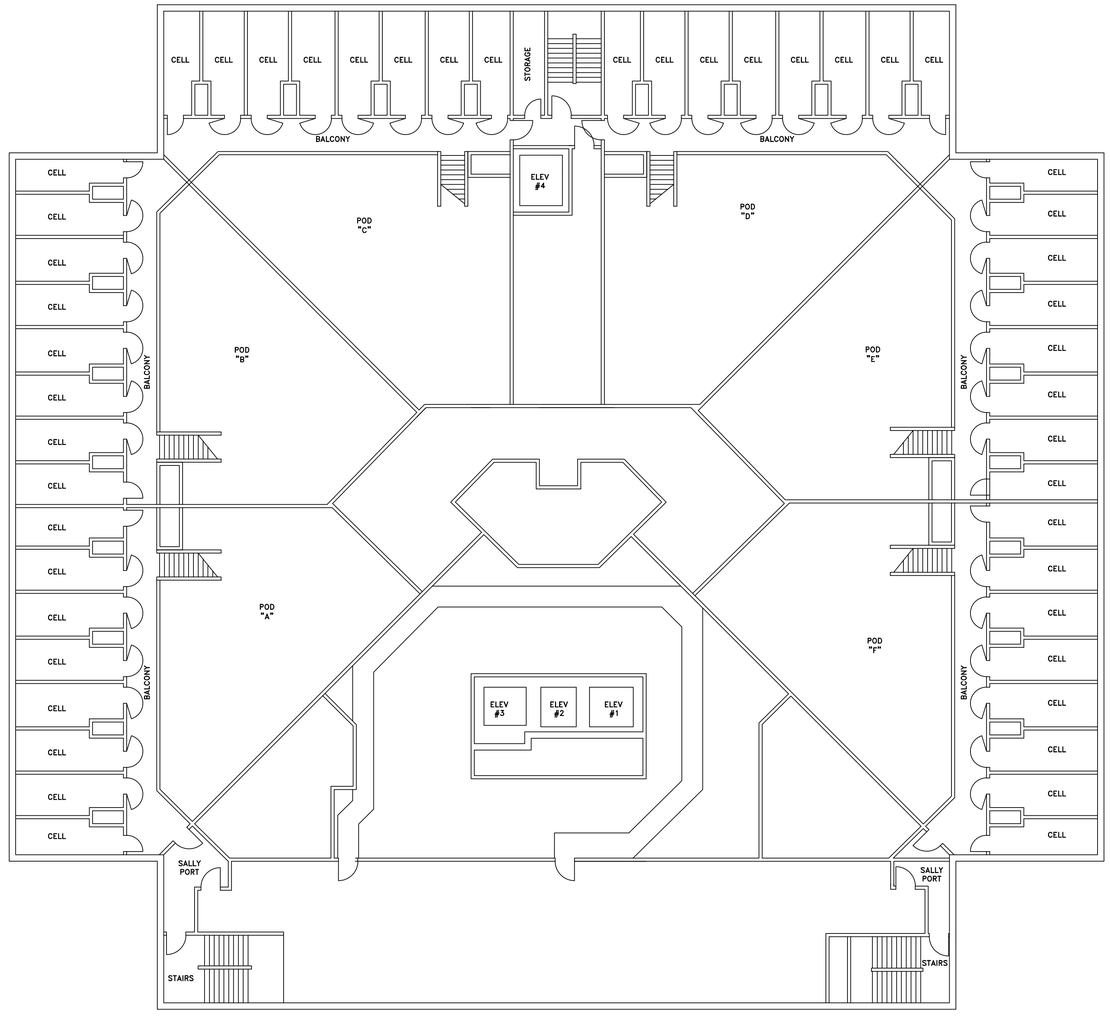

TOP FLOOR HOUSING

MAIN ANNEX JAIL - FOURTH FLOOR

LOCATION MAP

LARS ANDERSEN & ASSOCIATES, INC.
CIVIL ENGINEERS - LAND SURVEYORS - PLANNERS
4694 WEST JACQUELYN AVENUE, FRESNO CALIFORNIA 93722
TEL: 559 276-2790 FAX: 559 276-0850 WWW.LARSANDERSEN.COM

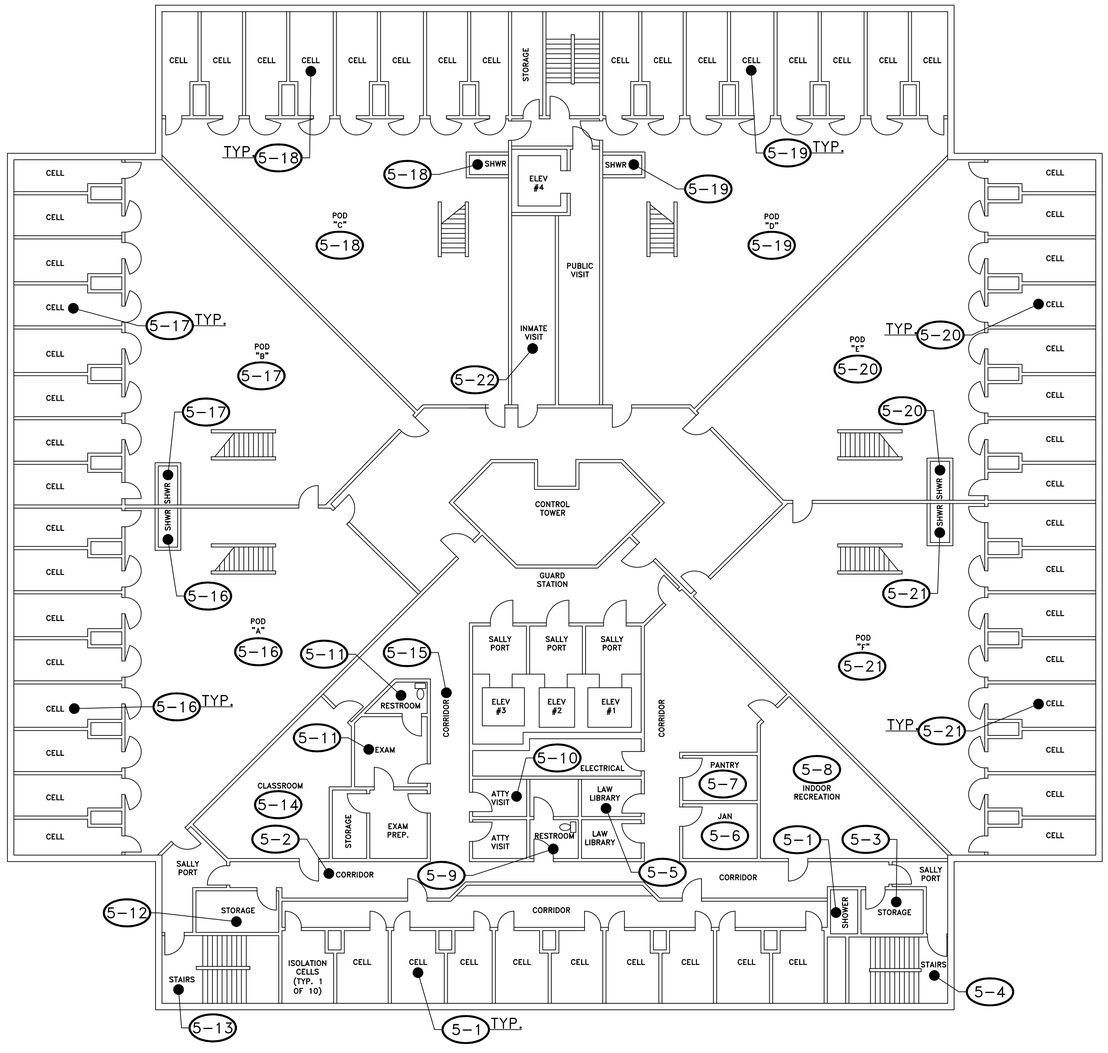

MAIN FLOOR HOUSING

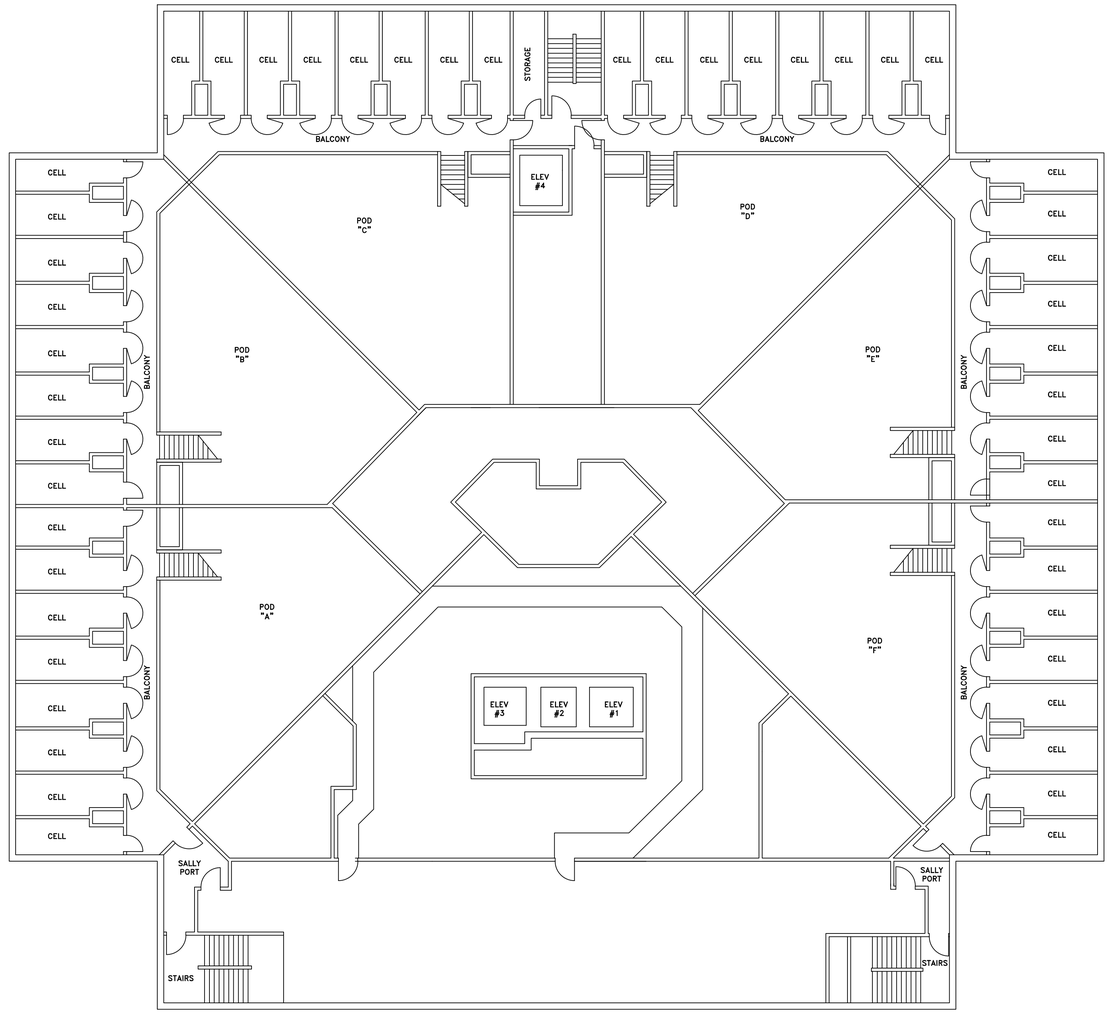

TOP FLOOR HOUSING

MAIN ANNEX JAIL - FIFTH FLOOR

LOCATION MAP

LARS ANDERSEN & ASSOCIATES, INC.
CIVIL ENGINEERS - LAND SURVEYORS - PLANNERS
4694 WEST JACQUELYN AVENUE, FRESNO CALIFORNIA 93722
TEL: 559 276-2790 FAX: 559 276-0850 WWW.LARSANDERSEN.COM

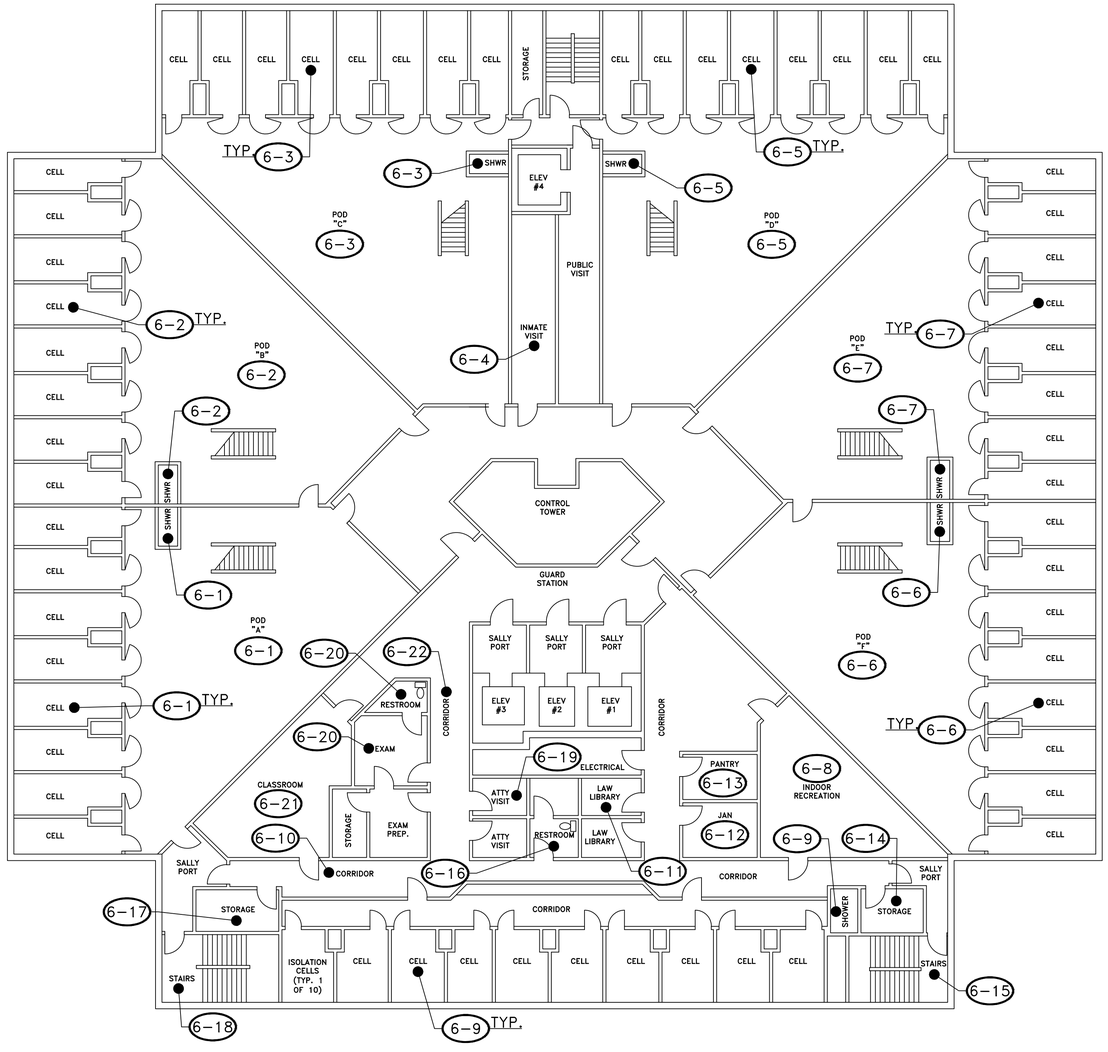

MAIN FLOOR HOUSING

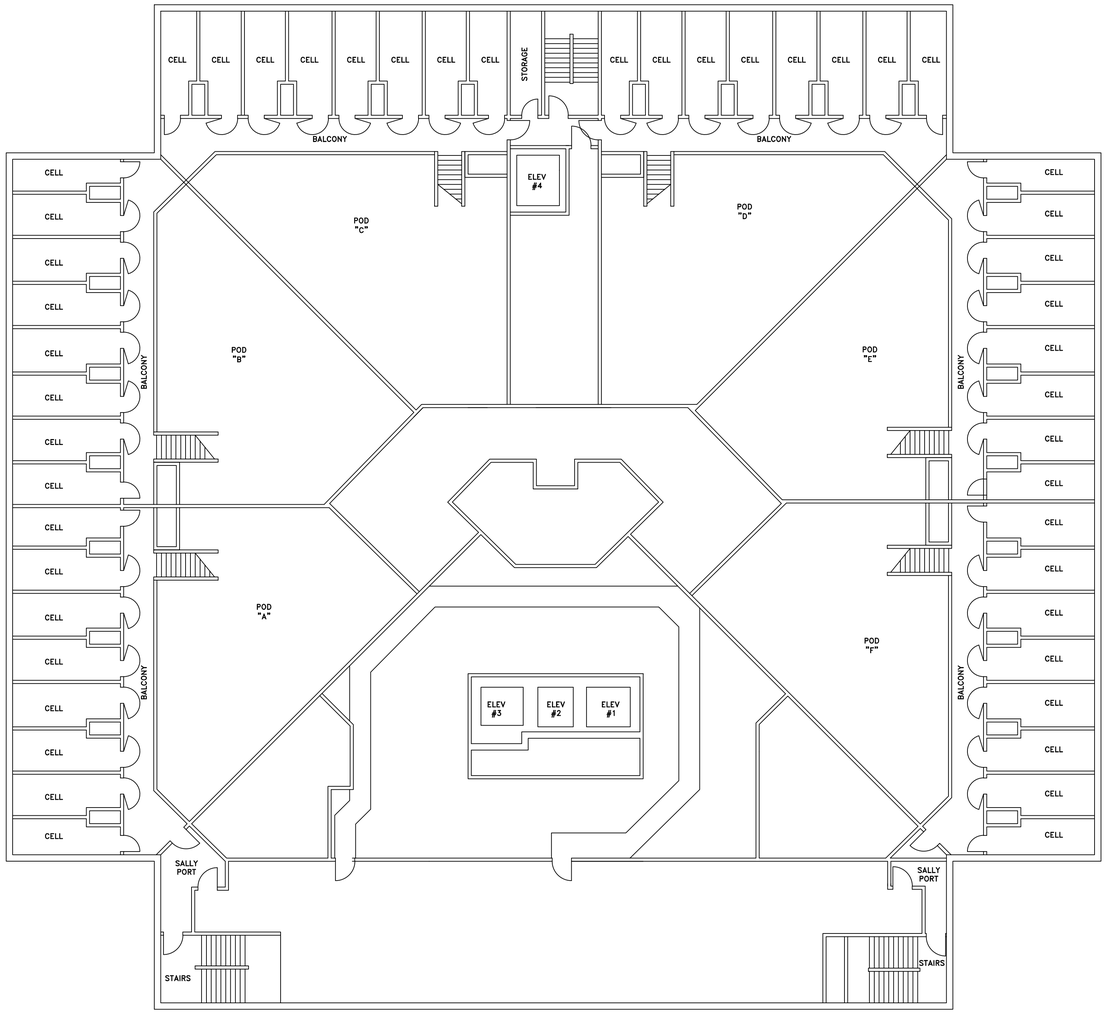

TOP FLOOR HOUSING

MAIN ANNEX JAIL - SIXTH FLOOR

LOCATION MAP

LARS ANDERSEN & ASSOCIATES, INC.
CIVIL ENGINEERS - LAND SURVEYORS - PLANNERS
4694 WEST JACQUELYN AVENUE, FRESNO CALIFORNIA 93722
TEL: 559 276-2790 FAX: 559 276-0850 WWW.LARSANDERSEN.COM

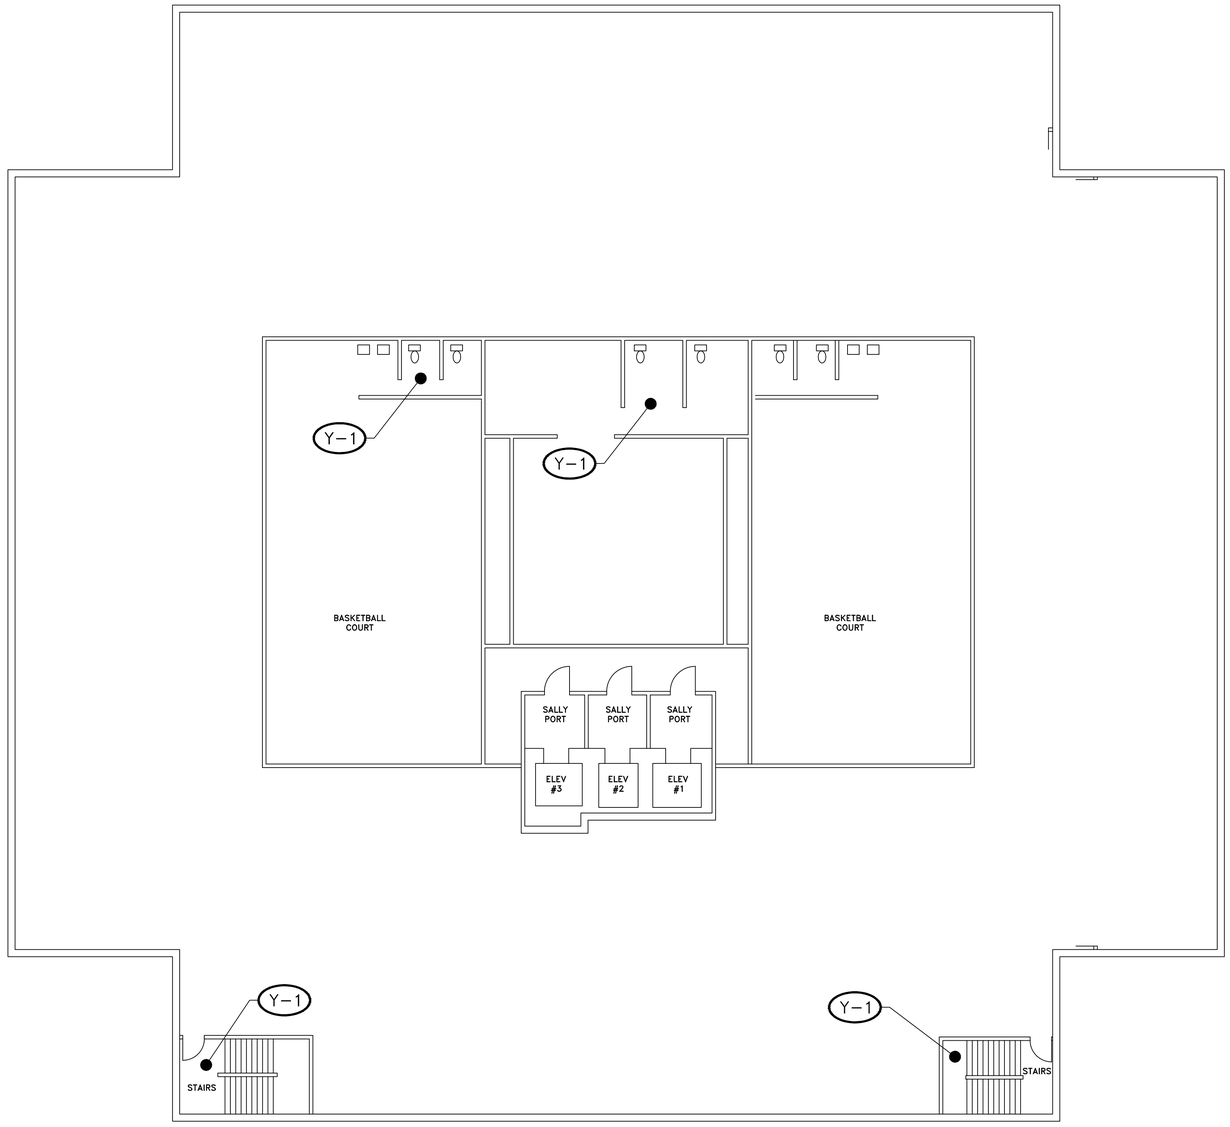

MAIN ANNEX JAIL - YARD/ROOF

LOCATION MAP

LARS ANDERSEN & ASSOCIATES, INC.
CIVIL ENGINEERS - LAND SURVEYORS - PLANNERS
4694 WEST JACQUELYN AVENUE, FRESNO CALIFORNIA 93722
TEL: 559 276-2790 FAX: 559 276-0850 WWW.LARSANDERSEN.COM

1	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	Basement
Room:	Holding Cell
Location:	
Cost:	3000
Duration:	16 hrs

2	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	Basement
Room:	Holding Cell
Location:	
Cost:	300
Duration:	1.5

3	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	Basement
Room:	Holding Cell
Location:	
Cost:	300
Duration:	1.5

4	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	Basement
Room:	Holding Cell
Location:	
Cost:	2000
Duration:	16 hrs

5	Main Annex Jail	**Priority:**	2

Category	Detention Facility Water Closets (GENERAL)

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	Basement
Room:	Holding Cell
Location:	
Cost:	8000
Duration:	40 hrs

6	Main Annex Jail	**Priority:**	4

Category	Accessible Clearance

Issue	**Recommendation**
Required 60" diameter circle or 'T'-shaped clear floor space not provided within room	Provide required clearance

ADA Reference:	
304.3	
CBC Reference:	
11B-304.3	
Floor:	Basement
Room:	Staff Restroom
Location:	
Cost:	10000
Duration:	50 hrs

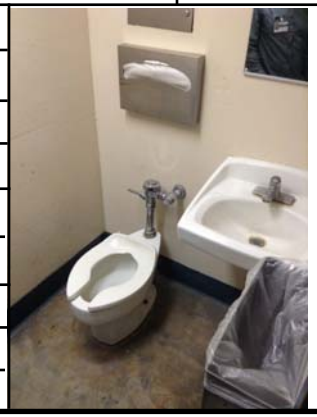

7	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	Basement
Room:	Staff Restroom
Location:	
Cost:	6000
Duration:	18 hrs

8	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	Basement
Room:	Staff Restroom
Location:	
Cost:	See *1
Duration:	See *1

9	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Toilet door sign not contrasting colors	Remove and replace sign per current standards

ADA Reference:
703.5.1
CBC Reference:
11B-703.5.1

Floor:	Basement
Room:	Staff Restroom
Location:	
Cost:	See *1
Duration:	See *1

10	Main Annex Jail	**Priority:**	3

Category	Water Closets (ADULT)

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:
604.4
CBC Reference:
11B-604.4

Floor:	Basement
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	16 hrs

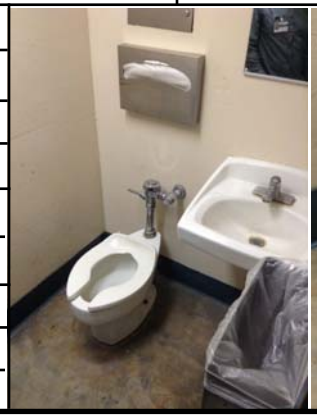

11	Main Annex Jail	**Priority:**	3

Category	Water Closets (GENERAL)

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:
604.6
CBC Reference:
11B-604.6

Floor:	Basement
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	16 hrs

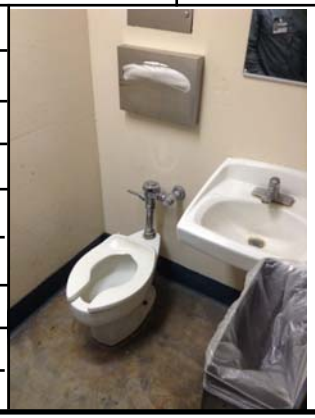

12	Main Annex Jail	**Priority:**	3

Category	Lavatories (ADULT)

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:
N/A
CBC Reference:
11B-606.2

Floor:	Basement
Room:	Staff Restroom
Location:	
Cost:	3000
Duration:	16 hrs

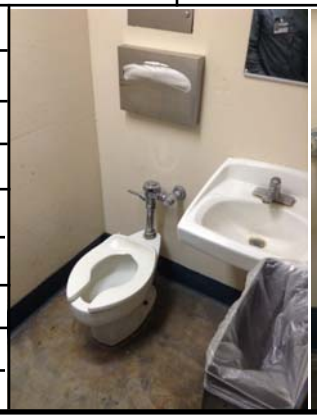

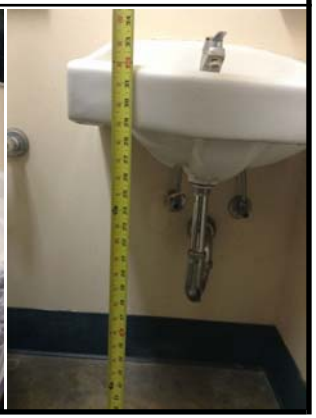

13	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	Basement
Room:	Staff Restroom
Location:	
Cost:	1000
Duration:	8 hrs

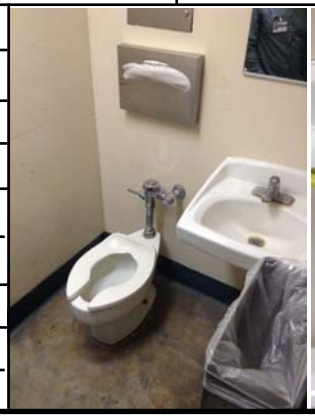

14	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	Basement
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

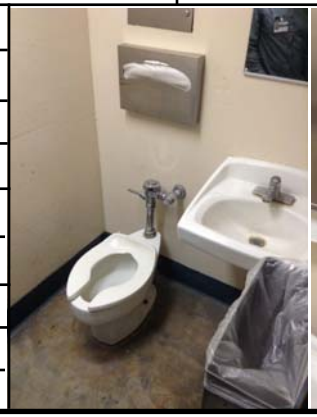

15	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	Basement
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

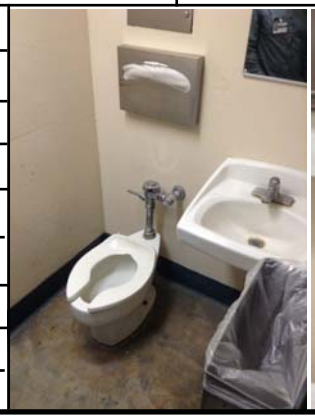

16	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	Basement
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

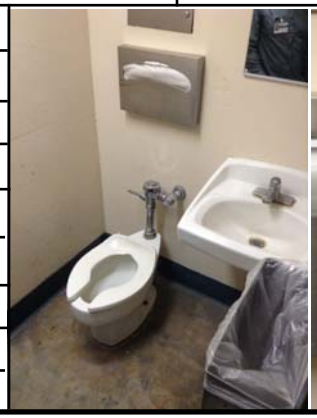

17	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	Basement
Room:	Staff Restroom
Location:	
Cost:	500
Duration:	1 hr

18	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	Basement
Room:	Guard Station
Location:	
Cost:	4000
Duration:	20 hrs

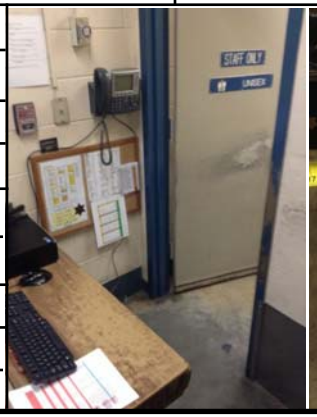

19	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	Basement
Room:	Guard Station
Location:	
Cost:	See *6
Duration:	See *6

20	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	Basement
Room:	Tunnel
Location:	To South
Cost:	See *4
Duration:	See *4

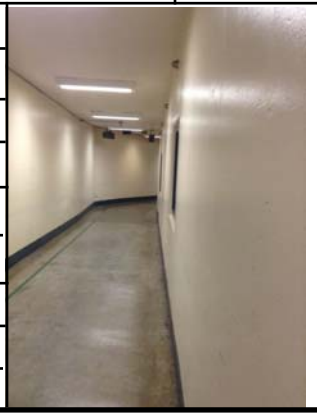

21	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	Basement
Room:	Tunnel
Location:	To South
Cost:	See *4
Duration:	See *4

22	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Directional slope of walk over 5.0%	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with handrails

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	Basement
Room:	Tunnel
Location:	To South
Cost:	10000
Duration:	50 hrs

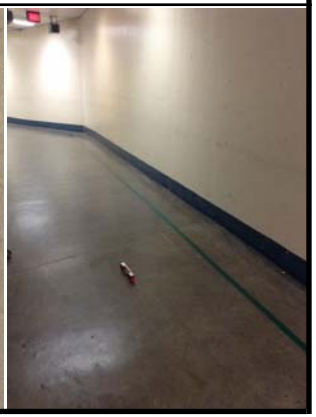

23	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Directional slope of walk over 5.0%	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with handrails

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	Basement
Room:	Tunnel
Location:	To South
Cost:	10000
Duration:	50 hrs

24	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Directional slope of walk over 5.0%	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with handrails

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	Basement
Room:	Tunnel
Location:	To South
Cost:	10000
Duration:	50 hrs

25	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Directional slope of walk over 5.0%	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with handrails

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	Basement
Room:	Tunnel
Location:	To South
Cost:	10000
Duration:	50 hrs

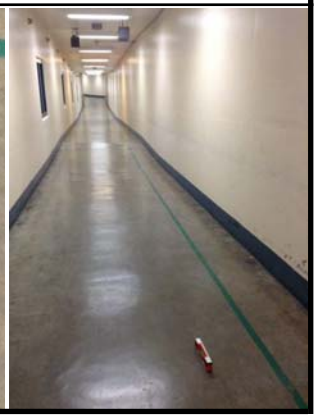

26	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Directional slope of walk over 5.0%	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with handrails

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	Basement
Room:	Staff Tunnel
Location:	To South
Cost:	10000
Duration:	50 hrs

27	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Directional slope of walk over 5.0%	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with handrails

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	Basement
Room:	Staff Tunnel
Location:	To South
Cost:	10000
Duration:	50 hrs

28	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Directional slope of walk over 5.0%	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with handrails

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	Basement
Room:	Staff Tunnel
Location:	To South
Cost:	10000
Duration:	50 hrs

29	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Directional slope of walk over 5.0%	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with handrails

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	Basement
Room:	Staff Tunnel
Location:	To South
Cost:	10000
Duration:	50 hrs

30	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Directional slope of walk over 5.0%	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with handrails

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	Basement
Room:	Staff Tunnel
Location:	To South
Cost:	10000
Duration:	50 hrs

31	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	Basement
Room:	Staff Tunnel
Location:	To South
Cost:	10000
Duration:	50 hrs

32	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	Basement
Room:	Elevator
Location:	
Cost:	See *6
Duration:	See *6

33	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Exam room
Location:	
Cost:	See *1
Duration:	See *1

34	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	1st
Room:	Exam room
Location:	
Cost:	See *2
Duration:	See *2

35	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	1st
Room:	Exam room
Location:	
Cost:	500
Duration:	1 hr

36	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Exam room
Location:	
Cost:	See *6
Duration:	See *6

37	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Exam room
Location:	
Cost:	See *6
Duration:	See *6

38	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Exam room
Location:	
Cost:	See *6
Duration:	See *6

39	Main Annex Jail	**Priority:**	4

Category	Sinks (GENERAL)

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate piping as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	1st
Room:	Exam room
Location:	
Cost:	50
Duration:	.25 hrs

40	Main Annex Jail	**Priority:**	4

Category	Sinks (ADULT)

Issue	**Recommendation**
Height of rim or counter measured over 34" AFF	Reset sink/or provide maximum 34" AFF counter

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	1st
Room:	Exam room
Location:	
Cost:	1000
Duration:	8 hrs

41	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Exam room
Location:	
Cost:	50
Duration:	.5 hrs

42	Main Annex Jail	**Priority:**	3

Category	Lavatories (GENERAL)

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Exam room
Location:	
Cost:	1000
Duration:	8 hrs

43	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	See *1
Duration:	See *1

44	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Toilet door sign not contrasting colors no sign	Remove and replace sign per current standards

ADA Reference:	
703.5.1	
CBC Reference:	
11B-703.5.1	
Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	See *1
Duration:	See *1

45	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:
404.2.7
CBC Reference:
11B-404.2.7

Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	500
Duration:	1 hr

46	Main Annex Jail	**Priority:**	3

Category	Water Closets (GENERAL)

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:
604.5.1
CBC Reference:
11B-604.5.1

Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	300
Duration:	1.5

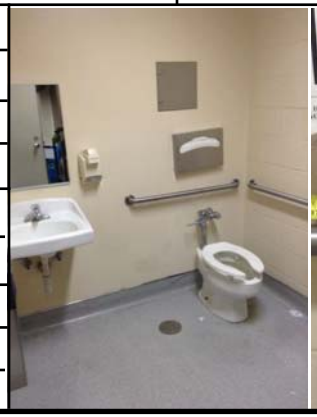

47	Main Annex Jail	**Priority:**	3

Category	Water Closets (GENERAL)

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:
604.5.2
CBC Reference:
11B-604.5.2

Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	300
Duration:	1.5

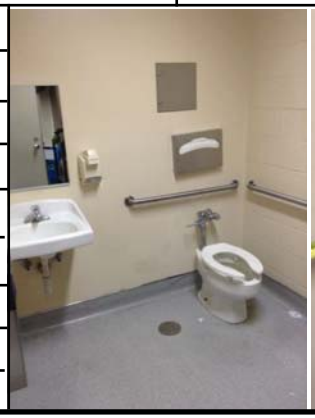

48	Main Annex Jail	**Priority:**	3

Category	Water Closets (GENERAL)

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:
604.3.1
CBC Reference:
11B-604.3.1

Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	2000
Duration:	10 hrs

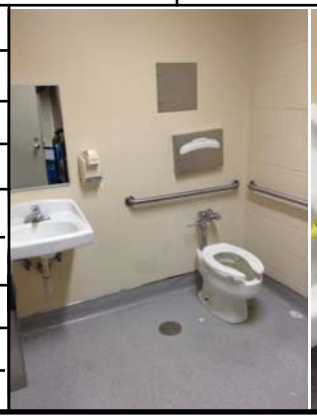

49	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	50
Duration:	.25 hrs

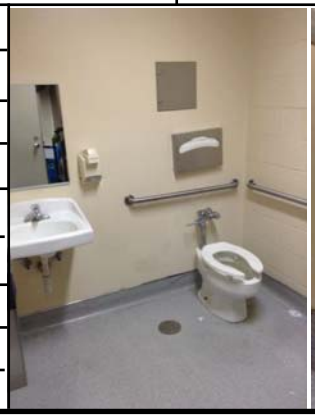

50	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	1000
Duration:	8 hrs

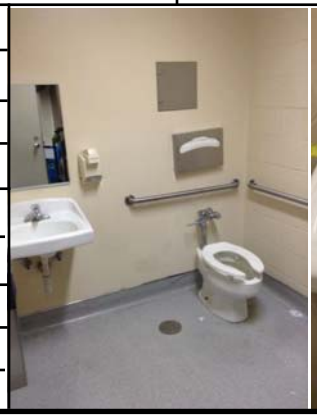

51	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	100
Duration:	1 hr

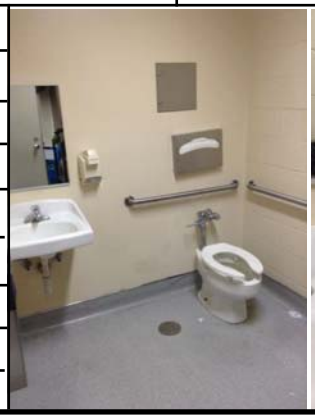

52	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	50
Duration:	.5 hrs

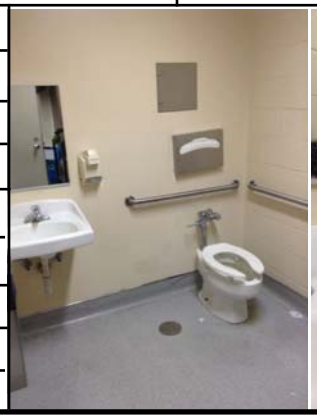

53	Main Annex Jail	**Priority:**	3

Category	Accessories

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	50
Duration:	.5 hrs

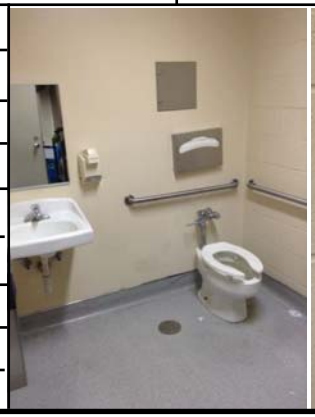

54	Main Annex Jail	**Priority:**	3

Category	Lavatories (GENERAL)

Issue	**Recommendation**
Minimum 30" x 48" clear floor space not provided	Provide 30" X 48" clearance

ADA Reference:	
606.2	
CBC Reference:	
11B-606.2	
Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	500
Duration:	2 hrs

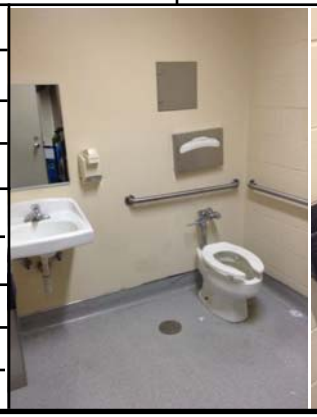

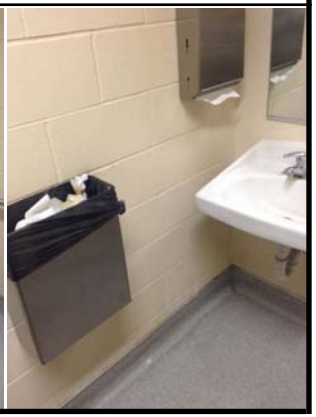

55	Main Annex Jail	**Priority:**	1

Category	Protruding Objects

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	1000
Duration:	4 hrs

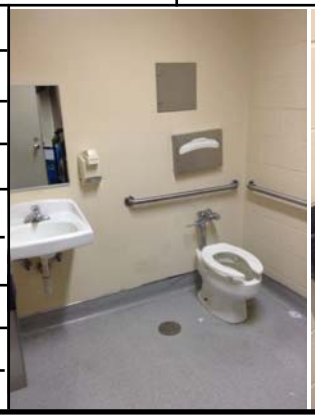

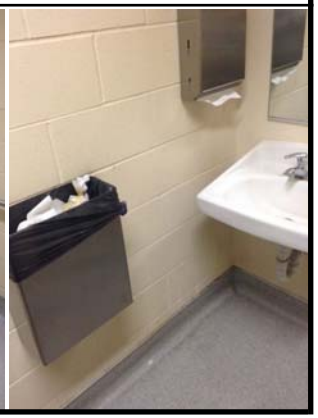

56	Main Annex Jail	**Priority:**	4

Category	Accessible Clearance

Issue	**Recommendation**
Required 60" diameter circle or 'T'-shaped clear floor space not provided within room	Provide required clearance

ADA Reference:	
304.3	
CBC Reference:	
11B-304.3	
Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	10000
Duration:	50 hrs

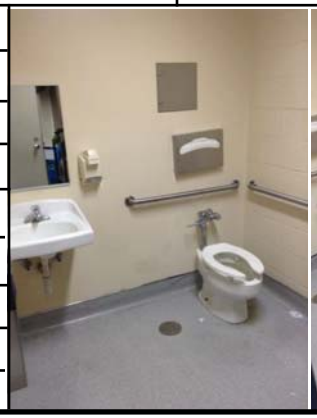

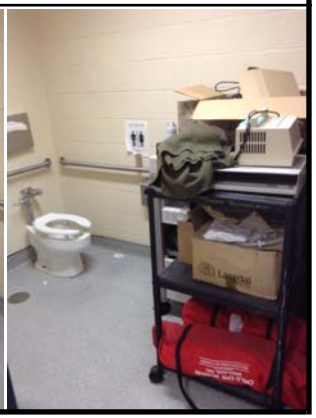

57	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Exam room
Location:	Restroom
Cost:	See *6
Duration:	See *6

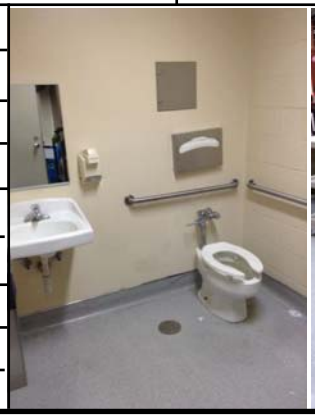

58	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Exam room
Location:	
Cost:	See *6
Duration:	See *6

59	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Exam room
Location:	
Cost:	See *6
Duration:	See *6

60	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Exam room
Location:	
Cost:	See *6
Duration:	See *6

61	Main Annex Jail	Priority:	1
Category	Doors / Gates		

Issue	Recommendation
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	1st
Room:	Female
Location:	Officer side
Cost:	500
Duration:	1 hr

62	Main Annex Jail	Priority:	1
Category	Doors / Gates		

Issue	Recommendation
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	1st
Room:	Female
Location:	Officer side
Cost:	See *2
Duration:	See *2

63	Main Annex Jail	Priority:	3
Category	Accessories		

Issue	Recommendation
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Female
Location:	Officer side
Cost:	50
Duration:	.5 hrs

64	Main Annex Jail	Priority:	2
Category	Reach Range		

Issue	Recommendation
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Female
Location:	Officer side
Cost:	See *6
Duration:	See *6

65	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Strip room
Location:	
Cost:	See *1
Duration:	See *1

66	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Srgnt Office
Location:	
Cost:	See *1
Duration:	See *1

67	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	1st
Room:	Srgnt Office
Location:	
Cost:	See *2
Duration:	See *2

68	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Finger Prints /
Location:	
Cost:	See *1
Duration:	See *1

69	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	1st
Room:	Pre-book - 1
Location:	
Cost:	2000
Duration:	16 hrs

70	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	1st
Room:	Pre-book - 1
Location:	
Cost:	300
Duration:	1.5

71	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Pre-book - 1
Location:	
Cost:	300
Duration:	1.5

72	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Pre-book - 1
Location:	
Cost:	8000
Duration:	40 hrs

73	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	1st
Room:	Pre-book - 1
Location:	
Cost:	5000
Duration:	40 hrs

74	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	1st
Room:	Pre-book - 1
Location:	
Cost:	3000
Duration:	16 hrs

75	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Pre-book - 1
Location:	
Cost:	See ID #74
Duration:	See ID #74

76	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	1st
Room:	Pre-book - 1
Location:	
Cost:	See *5
Duration:	See ID #85

77	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Pre-book - 1
Location:	
Cost:	See *6
Duration:	See *6

78	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	1st
Room:	Pre-book - 1
Location:	
Cost:	See *1
Duration:	See *1

79	Main Annex Jail	**Priority:**	2
Category	Counters		

Issue	**Recommendation**
Counter height measured over 34" AFF (parallel approach)	Recess a portion of the counter to be 34" maximum AFF

ADA Reference:	
N/A	
CBC Reference:	
11B-904.4.1	
Floor:	1st
Room:	Booking
Location:	
Cost:	4000
Duration:	20 hrs

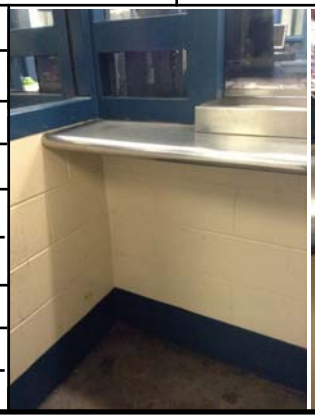

80	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Changes in level along route exceeds 1/4" maximum height	Provide affected concrete walk where level changes occur of 1/4" high

ADA Reference:	
303.2	
CBC Reference:	
11B-303.2	
Floor:	1st
Room:	Detox
Location:	
Cost:	5000
Duration:	30 hrs

81	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	1st
Room:	Detox
Location:	
Cost:	2000
Duration:	16 hrs

82	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Detox
Location:	
Cost:	300
Duration:	1.5

83	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	1st
Room:	Detox
Location:	
Cost:	300
Duration:	1.5

84	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Detox
Location:	
Cost:	8000
Duration:	40 hrs

85	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	1st
Room:	Detox
Location:	
Cost:	3000
Duration:	16 hrs

86	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	1st
Room:	Detox
Location:	
Cost:	5000
Duration:	40 hrs

87	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Detox
Location:	
Cost:	See ID #85
Duration:	See ID #85

88	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	1st
Room:	Detox
Location:	
Cost:	See *5
Duration:	See *5

89	Main Annex Jail	**Priority:**	2
Category	Counters		

Issue	**Recommendation**
Counter height measured over 34" AFF (parallel approach)	Recess a portion of the counter to be 34" maximum AFF

ADA Reference:	
N/A	
CBC Reference:	
11B-904.4.1	
Floor:	1st
Room:	Main Booking
Location:	
Cost:	4000
Duration:	20 hrs

90	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide assistance placard

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Main Booking
Location:	
Cost:	200
Duration:	2 hrs

91	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	See *1
Duration:	See *1

92	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	5000
Duration:	40 hrs

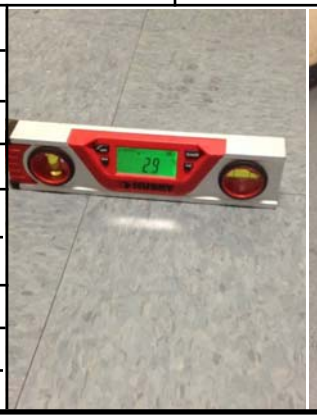

93	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	8000
Duration:	40 hrs

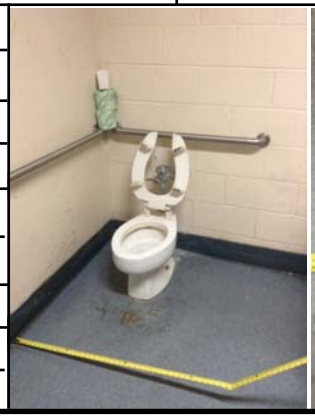

94	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:	
604.6	
CBC Reference:	
11B-604.6	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	2000
Duration:	16 hrs

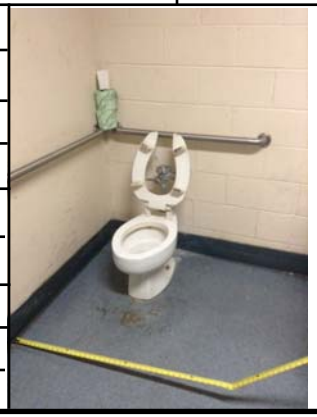

95	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	2000
Duration:	16 hrs

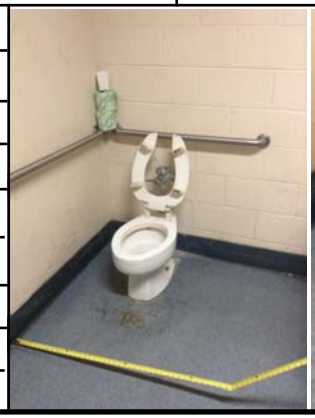

96	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	300
Duration:	1.5

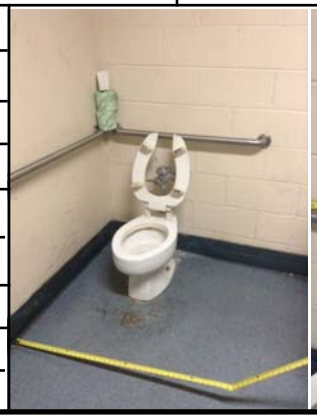

97	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	300
Duration:	1.5

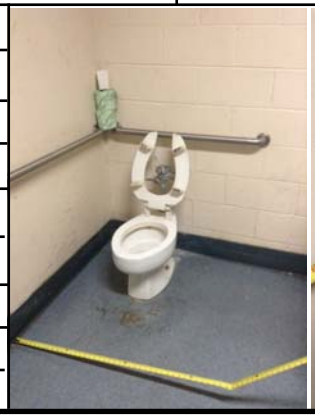

98	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	50
Duration:	.25 hrs

99	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	800
Duration:	4 hrs

100	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	50
Duration:	.5 hrs

101	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	50
Duration:	.5 hrs

102	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	See *6
Duration:	See *6

103	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Intoxilizer
Location:	
Cost:	See *6
Duration:	See *6

104	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	1st
Room:	Booking
Location:	
Cost:	See *1
Duration:	See *1

105	Main Annex Jail	**Priority:**	1

Category	Landings/Thresholds

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	1st
Room:	Finger Prints /
Location:	
Cost:	200
Duration:	2 hrs

106	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Finger Prints /
Location:	
Cost:	See *6
Duration:	See *6

107	Main Annex Jail	**Priority:**	4

Category	Sinks (ADULT)

Issue	**Recommendation**
Height of rim or counter measured over 34" AFF	Reset sink/or provide maximum 34" AFF counter

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	1st
Room:	Finger Prints /
Location:	
Cost:	1000
Duration:	8 hrs

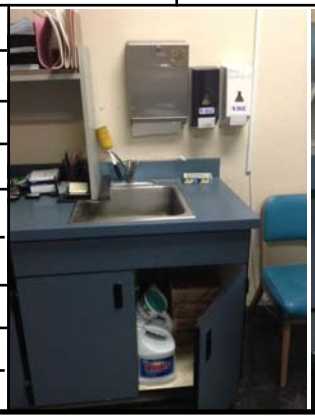

108	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is between 10"-24" & 34" max height	Provide required reach range

ADA Reference:	
308.3.2	
CBC Reference:	
11B-308.3.2	
Floor:	1st
Room:	Finger Prints /
Location:	
Cost:	50
Duration:	.5 hrs

109	Main Annex Jail	**Priority:**	4
Category	Sinks (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate piping as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	1st
Room:	Finger Prints /
Location:	
Cost:	50
Duration:	.25 hrs

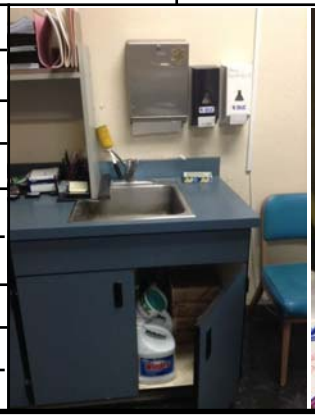

110	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign over 40"-70" AFF (to bottom) not 5/8" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	1st
Room:	Finger Prints /
Location:	
Cost:	See *1
Duration:	See *1

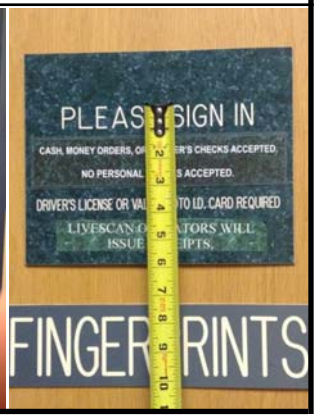

111	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Finger Prints /
Location:	
Cost:	See *1
Duration:	See *1

112	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Services Unit
Location:	
Cost:	See *6
Duration:	See *6

113	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Services Unit
Location:	
Cost:	See *6
Duration:	See *6

114	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Services Unit
Location:	Sargent
Cost:	See *6
Duration:	See *6

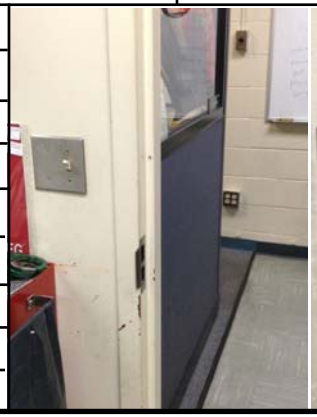

115	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Services Unit
Location:	Office
Cost:	See *6
Duration:	See *6

116	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Services Unit
Location:	
Cost:	See *6
Duration:	See *6

117	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	1st
Room:	Elevator
Location:	
Cost:	See *2
Duration:	See *2

118	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Elevator
Location:	
Cost:	See *1
Duration:	See *1

119	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	1st
Room:	Elevator
Location:	Booking
Cost:	See *2
Duration:	See *2

120	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Elevator
Location:	Booking
Cost:	See *6
Duration:	See *6

121	Main Annex Jail	Priority:	4
Category	Telephones		

Issue	Recommendation
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	1st
Room:	Visitation
Location:	Visitor
Cost:	See *5
Duration:	See *5

122	Main Annex Jail	Priority:	2
Category	Reach Range		

Issue	Recommendation
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Visitation
Location:	Visitor
Cost:	See *6
Duration:	See *6

123	Main Annex Jail	Priority:	2
Category	Reach Range		

Issue	Recommendation
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Lobby
Location:	
Cost:	See *12
Duration:	See *12

124	Main Annex Jail	Priority:	1
Category	Landings/Thresholds		

Issue	Recommendation
Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, front approach)	Provide minimum 12" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	6000
Duration:	20 hrs

125	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	See *1
Duration:	See *1

126	Main Annex Jail	**Priority:**	3

Category	Accessories

Issue	**Recommendation**
Automatic hand dryer measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	100
Duration:	1 hr

127	Main Annex Jail	**Priority:**	3

Category	Lavatories (GENERAL)

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	50
Duration:	.25 hrs

128	Main Annex Jail	**Priority:**	3

Category	Accessories

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	50
Duration:	.5 hrs

129	Main Annex Jail	**Priority:**	3
Category	Water Closet Compartments (GENERAL)		

Issue	**Recommendation**
Lever, pull or push type handle on inside face near latch of door not provided	Provide required handle per current standards

ADA Reference:	
604.8.2.2	
CBC Reference:	
11B-604.8.2.2	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	500
Duration:	1 hr

130	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	2000
Duration:	16 hrs

131	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	300
Duration:	1.5

132	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	300
Duration:	1.5

133	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser located over 9" from edge of toilet	Relocate TPD with 9" maximum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	50
Duration:	.5 hrs

134	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	2000
Duration:	10 hrs

135	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	50
Duration:	.5 hrs

136	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:	
604.6	
CBC Reference:	
11B-604.6	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	2000
Duration:	16 hrs

137	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 48" long measured from front of toilet to front wall or door	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
N/A	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	4000
Duration:	20 hrs

138	Main Annex Jail	**Priority:**	3
Category	Water Closet Compartments (GENERAL)		

Issue	**Recommendation**
Automatic closing device not provided on accessible compartment door	Provide required closing device

ADA Reference:	
604.8.1.2	
CBC Reference:	
11B-604.8.1.2	
Floor:	1st
Room:	Lobby
Location:	Men - Restroom
Cost:	100
Duration:	.5

139	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	See *1
Duration:	See *1

140	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, front approach)	Provide minimum 12" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	6000
Duration:	20 hrs

141	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	50
Duration:	.25 hrs

142	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	50
Duration:	.5 hrs

143	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Automatic hand dryer measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	100
Duration:	1 hr

144	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	500
Duration:	1 hr

145	Main Annex Jail	**Priority:**	3
Category	Water Closet Compartments (GENERAL)		

Issue	**Recommendation**
Automatic closing device not provided on accessible compartment door	Provide required closing device

ADA Reference:	
604.8.1.2	
CBC Reference:	
11B-604.8.1.2	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	100
Duration:	.5

146	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	100
Duration:	1 hr

147	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	50
Duration:	.5 hr

148	Main Annex Jail	**Priority:**	3
Category	Water Closet Compartments (GENERAL)		

Issue	**Recommendation**
Lever, pull or push type handle on outside face near latch of door not provided	Provide required handle per current standards

ADA Reference:	
604.8.2.2	
CBC Reference:	
11B-604.8.2.2	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	500
Duration:	1 hr

149	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	2000
Duration:	16 hrs

150	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	2000
Duration:	16 hrs

151	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	300
Duration:	1.5

152	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	300
Duration:	1.5

153	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	50
Duration:	.5 hrs

154	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	2000
Duration:	10 hrs

155	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser not located min. 7" from edge of toilet	Relocate TPD with 7" minimum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	1st
Room:	Lobby
Location:	Women -
Cost:	50
Duration:	.5 hrs

156	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Lobby
Location:	
Cost:	See *12
Duration:	See *12

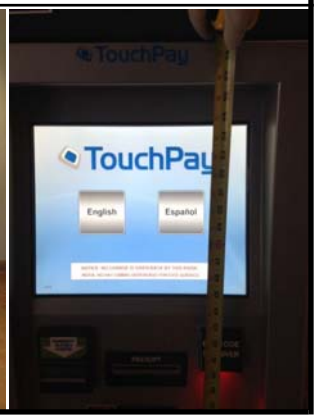

157	Main Annex Jail	**Priority:**	2
Category	Counters		

Issue	**Recommendation**
Counter height measured over 34" AFF (parallel approach)	Recess a portion of the counter to be 34" maximum AFF

ADA Reference:	
N/A	
CBC Reference:	
11B-904.4.1	
Floor:	1st
Room:	Lobby
Location:	
Cost:	4000
Duration:	20 hrs

158	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	1st
Room:	Line-Up
Location:	
Cost:	See *2
Duration:	See *2

159	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Line-Up
Location:	
Cost:	See *1
Duration:	See *1

160	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Line-Up
Location:	
Cost:	See *1
Duration:	See *1

161	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	1st
Room:	Line-Up
Location:	Restroom
Cost:	2000
Duration:	16 hrs

162	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	1st
Room:	Line-Up
Location:	Restroom
Cost:	300
Duration:	1.5

163	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Line-Up
Location:	Restroom
Cost:	300
Duration:	1.5

164	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser not located min. 7" from edge of toilet	Relocate TPD with 7" minimum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	1st
Room:	Line-Up
Location:	Restroom
Cost:	50
Duration:	.5 hrs

165	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	1st
Room:	Line-Up
Location:	Restroom
Cost:	500
Duration:	1 hr

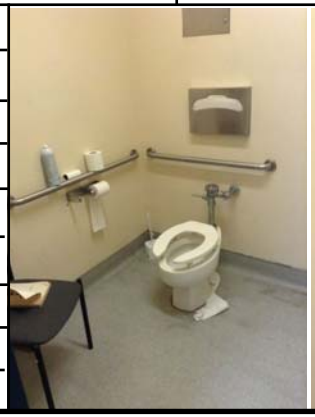

166	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 48" long measured from front of toilet to front wall or door	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
N/A	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Line-Up
Location:	Restroom
Cost:	4000
Duration:	20 hrs

167	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Line-Up
Location:	Restroom
Cost:	50
Duration:	.5 hrs

168	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	1st
Room:	Line-Up
Location:	Restroom
Cost:	100
Duration:	1 hr

169	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Line-Up
Location:	Restroom
Cost:	50
Duration:	.5 hrs

170	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	1st
Room:	Line-Up
Location:	Restroom
Cost:	50
Duration:	.5 hr

171	Main Annex Jail	**Priority:**	2
Category	Counters		

Issue	**Recommendation**
Counter height measured over 34" AFF (parallel approach)	Recess a portion of the counter to be 34" maximum AFF

ADA Reference:	
N/A	
CBC Reference:	
11B-904.4.1	
Floor:	1st
Room:	Corridor
Location:	
Cost:	4000
Duration:	20 hrs

172	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:	
604.6	
CBC Reference:	
11B-604.6	
Floor:	1st
Room:	Line-Up
Location:	Restroom
Cost:	2000
Duration:	16 hrs

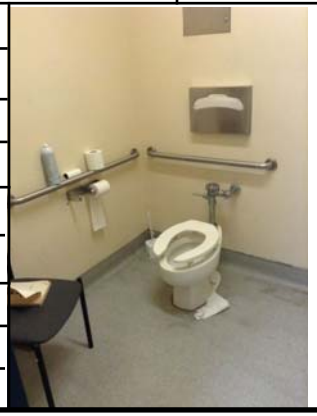

173	Main Annex Jail	**Priority:**	1

Category	Protruding Objects

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	1st
Room:	Corridoe
Location:	
Cost:	2000
Duration:	8 hrs

174	Main Annex Jail	**Priority:**	1

Category	Protruding Objects

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	1st
Room:	Corridor
Location:	
Cost:	2000
Duration:	8 hrs

175	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Records
Location:	
Cost:	See *1
Duration:	See *1

176	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	1st
Room:	Records
Location:	
Cost:	See *2
Duration:	See *2

177	Main Annex Jail	**Priority:**	1

Category	Landings/Thresholds

Issue	**Recommendation**
Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, front approach)	Provide minimum 12" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	1st
Room:	Records
Location:	
Cost:	200
Duration:	2 hrs

178	Main Annex Jail	**Priority:**	4

Category	Drinking Fountains

Issue	**Recommendation**
50% of all drinking fountains are not standing accessible	Install for standing persons drinking fountain(s)

ADA Reference:	
211.3	
CBC Reference:	
11B-211.3	
Floor:	1st
Room:	
Location:	
Cost:	2000
Duration:	8 hrs

179	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	See *1
Duration:	See *1

180	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	1st
Room:	Staff Restroom
Location:	Men
Cost:	See *2
Duration:	See *2

181	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	1st
Room:	Staff Restroom
Location:	Men
Cost:	50
Duration:	.25 hrs

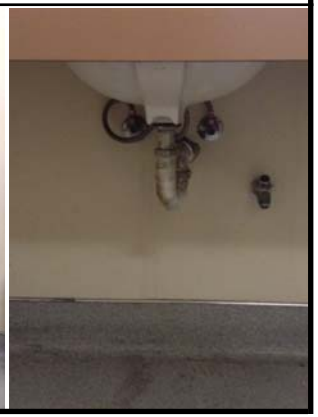

182	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Staff Restroom
Location:	Men
Cost:	50
Duration:	.5 hrs

183	Main Annex Jail	**Priority:**	3
Category	Water Closet Compartments (GENERAL)		

Issue	**Recommendation**
Lever, pull or push type handle on inside face near latch of door not provided	Provide required handle per current standards

ADA Reference:	
604.8.2.2	
CBC Reference:	
11B-604.8.2.2	
Floor:	1st
Room:	Staff Restroom
Location:	Men
Cost:	500
Duration:	1 hr

184	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	1st
Room:	Staff Restroom
Location:	Men
Cost:	100
Duration:	1 hr

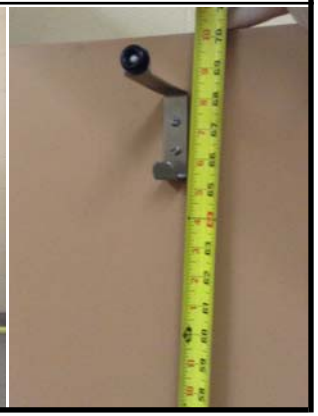

185	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Staff Restroom
Location:	Men
Cost:	300
Duration:	1.5

186	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	1st
Room:	Staff Restroom
Location:	Men
Cost:	300
Duration:	1.5

187	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Staff Restroom
Location:	Men
Cost:	50
Duration:	.5 hrs

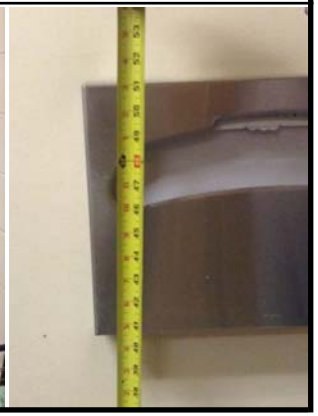

188	Main Annex Jail	**Priority:**	3
Category	Water Closet Compartments (GENERAL)		

Issue	**Recommendation**
Water closet compartment not 60" deep for maneuvering for side opening door in front of toilet	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
N/A	
CBC Reference:	
11B-604.8.1.1.2	
Floor:	1st
Room:	Staff Restroom
Location:	Men
Cost:	4000
Duration:	20 hrs

189	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	1st
Room:	Staff Restroom
Location:	Men
Cost:	2000
Duration:	16 hrs

190	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser not located min. 7" from edge of toilet	Relocate TPD with 7" minimum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	1st
Room:	Staff Restroom
Location:	Men
Cost:	50
Duration:	.5 hrs

191	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	See *1
Duration:	See *1

192	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.25 hrs

193	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

194	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

195	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	500
Duration:	1 hr

196	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	100
Duration:	1 hr

197	Main Annex Jail	**Priority:**	3
Category	Water Closet Compartments (GENERAL)		

Issue	**Recommendation**
Lever, pull or push type handle on inside face near latch of door not provided	Provide required handle per current standards

ADA Reference:	
604.8.2.2	
CBC Reference:	
11B-604.8.2.2	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	500
Duration:	1 hr

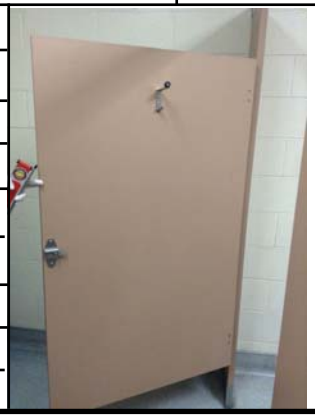

198	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:	
604.6	
CBC Reference:	
11B-604.6	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	2000
Duration:	16 hrs

199	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	2000
Duration:	16 hrs

200	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	300
Duration:	1.5

201	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser not located min. 7" from edge of toilet	Relocate TPD with 7" minimum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

202	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	1st
Room:	Transportation
Location:	
Cost:	200
Duration:	2 hrs

203	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	1st
Room:	Transportation
Location:	
Cost:	100
Duration:	1 hr

204	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Transportation
Location:	
Cost:	See *1
Duration:	See *1

205	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Storage
Location:	
Cost:	See *1
Duration:	See *1

206	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Storage
Location:	
Cost:	See *1
Duration:	See *1

207	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Storage
Location:	
Cost:	See *6
Duration:	See *6

208	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	
Location:	
Cost:	See *6
Duration:	See *6

209	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Corridor
Location:	Sally Port
Cost:	See *6
Duration:	See *6

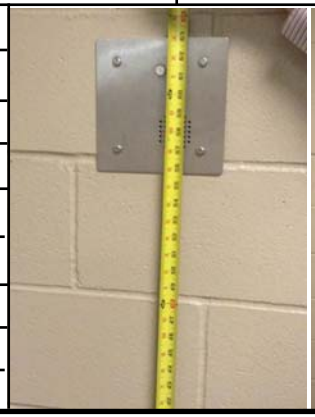

210	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Receiving
Location:	
Cost:	See *6
Duration:	See *6

211	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Unisex toilet door sign not 1/4" thick of contrasting circle and triangle symbols with the circle circumscribing the triangle	Provide sign per current standards

ADA Reference:	
N/A	
CBC Reference:	
11B-703.7.2.6.3	
Floor:	1st
Room:	Inmate Clothing
Location:	Restroom
Cost:	See *1
Duration:	See *1

212	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	1st
Room:	Inmate Clothing
Location:	Restroom
Cost:	6000
Duration:	18 hrs

213	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	1st
Room:	Inmate Clothing
Location:	Restroom
Cost:	2000
Duration:	16 hrs

214	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Inmate Clothing
Location:	Restroom
Cost:	300
Duration:	1.5

215	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar less than 24" from front of toilet to far edge	Adjust as required and/or provide new bar per current standards

ADA Reference:	
N/A	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Inmate Clothing
Location:	Restroom
Cost:	300
Duration:	1.5

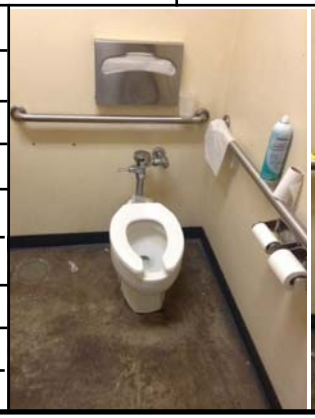

216	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Inmate Clothing
Location:	Restroom
Cost:	2000
Duration:	10 hrs

217	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	1st
Room:	Inmate Clothing
Location:	Restroom
Cost:	100
Duration:	1 hr

218	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Inmate Clothing
Location:	Restroom
Cost:	1000
Duration:	8 hrs

219	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Inmate Clothing
Location:	Restroom
Cost:	50
Duration:	.5 hrs

220	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Inmate Clothing
Location:	Restroom
Cost:	50
Duration:	.5 hrs

221	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Minimum 30" x 48" clear floor space not provided	Provide 30" X 48" clearance

ADA Reference:	
606.2	
CBC Reference:	
11B-606.2	
Floor:	1st
Room:	Inmate Clothing
Location:	Restroom
Cost:	500
Duration:	2 hrs

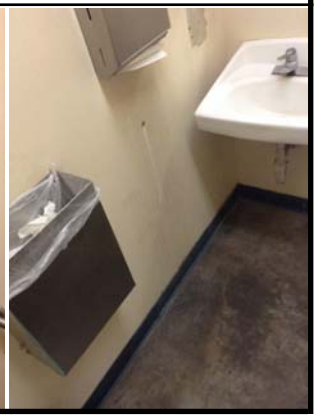

222	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Inmate Clothing
Location:	Restroom
Cost:	See *1
Duration:	See *1

223	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Inmate Clothing
Location:	
Cost:	See *6
Duration:	See *6

224	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	1st
Room:	Line-Up
Location:	
Cost:	300
Duration:	1.5

225	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	1st
Room:	Line-Up
Location:	
Cost:	300
Duration:	1.5

226	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Line-Up
Location:	
Cost:	8000
Duration:	40 hrs

227	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	1st
Room:	Line-Up
Location:	
Cost:	2000
Duration:	16 hrs

228	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 48" long measured from front of toilet to front wall or door	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
N/A	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Line-Up
Location:	
Cost:	4000
Duration:	20 hrs

229	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	1st
Room:	Line-Up
Location:	
Cost:	2000
Duration:	16 hrs

230	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	1st
Room:	Line-Up
Location:	
Cost:	3000
Duration:	16 hrs

231	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Line-Up
Location:	
Cost:	See ID #230
Duration:	See ID #230

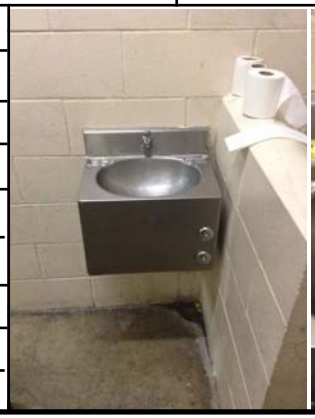
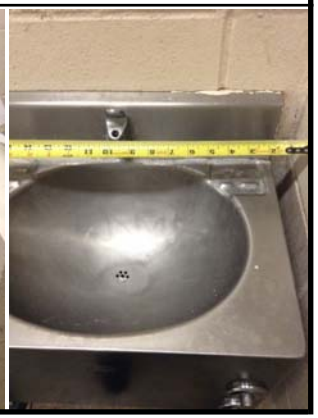

232	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	1st
Room:	Line-Up
Location:	
Cost:	800
Duration:	See ID #278

233	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Janitor
Location:	
Cost:	See *1
Duration:	See ID #330

234	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	1st
Room:	Janitor
Location:	
Cost:	500
Duration:	1 hr

235	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	1st
Room:	Pre-release - B
Location:	
Cost:	6000
Duration:	18 hrs

236	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	1st
Room:	Pre-release - B
Location:	
Cost:	300
Duration:	1.5

237	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	1st
Room:	Pre-release - B
Location:	
Cost:	300
Duration:	1.5

238	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Pre-release - B
Location:	
Cost:	8000
Duration:	40 hrs

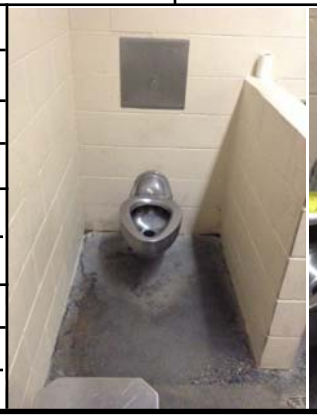

239	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	1st
Room:	Pre-release - B
Location:	
Cost:	800
Duration:	4 hrs

240	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	1st
Room:	Pre-release - B
Location:	
Cost:	2000
Duration:	16 hrs

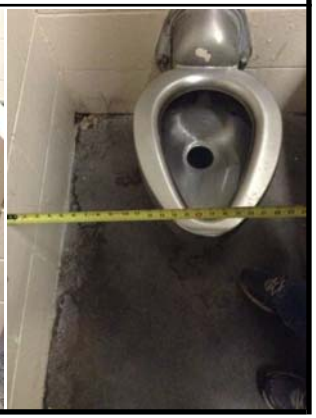

241	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	1st
Room:	Pre-release - B
Location:	
Cost:	2000
Duration:	16 hrs

242	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Height of lavatory rim or counter measured over 34" AFF	Reset lavatory as required

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	1st
Room:	Pre-release - B
Location:	
Cost:	3000
Duration:	16 hrs

243	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Pre-release - B
Location:	
Cost:	1000
Duration:	8 hrs

244	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Pre-release - B
Location:	
Cost:	See *6
Duration:	See *6

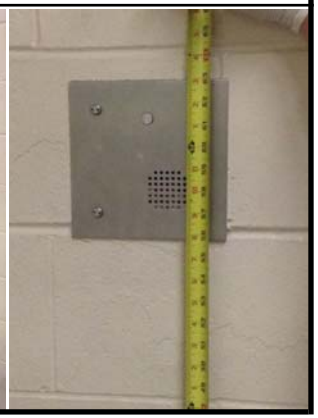

245	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	1st
Room:	Pre-release - B
Location:	
Cost:	5000
Duration:	40 hrs

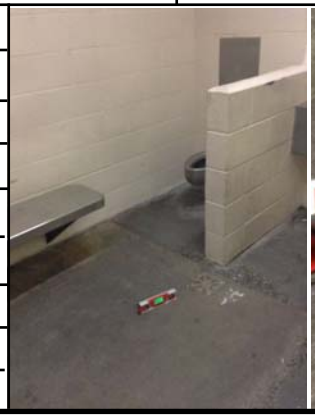

246	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	1st
Room:	Stairwell
Location:	Center
Cost:	5000
Duration:	20 hrs

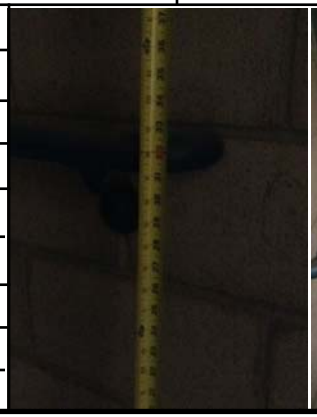

247	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Stairwell Center
Location:	
Cost:	See *6
Duration:	See *6

248	Main Annex Jail	**Priority:**	2
Category	Counters		

Issue	**Recommendation**
Counter height measured over 34" AFF (parallel approach)	Recess a portion of the counter to be 34" maximum AFF

ADA Reference:	
N/A	
CBC Reference:	
11B-904.4.1	
Floor:	1st
Room:	Dress out
Location:	
Cost:	4000
Duration:	20 hrs

249	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Mail room
Location:	
Cost:	See *1
Duration:	See *1

250	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	See *1
Duration:	See *1

251	Main Annex Jail	**Priority:**	2
Category	Counters		

Issue	**Recommendation**
Counter height measured over 34" AFF (parallel approach)	Recess a portion of the counter to be 34" maximum AFF

ADA Reference:	
N/A	
CBC Reference:	
11B-904.4.1	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	4000
Duration:	20 hrs

252	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	5000
Duration:	40 hrs

253	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	8000
Duration:	40 hrs

254	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	2000
Duration:	20 hrs

255	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	800
Duration:	1 hr

256	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	800
Duration:	1 hr

257	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	800
Duration:	1 hr

258	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	800
Duration:	1 hr

259	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	200
Duration:	1 hr

260	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	2000
Duration:	10 hrs

261	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	2000
Duration:	10 hrs

262	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	8000
Duration:	40 hrs

263	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	2000
Duration:	16 hrs

264	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-19" from sidewall or partition in ambulatory accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
604.2	
CBC Reference:	
11B-604.2	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	2000
Duration:	16 hrs

265	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	300
Duration:	1.5

266	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	300
Duration:	1.5

267	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	3000
Duration:	16 hrs

268	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Male Dress-In
Location:	
Cost:	1000
Duration:	8 hrs

269	Main Annex Jail	**Priority:**	1

Category	Protruding Objects

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	1st
Room:	Corridor
Location:	
Cost:	2000
Duration:	8 hrs

270	Main Annex Jail	**Priority:**	1

Category	Protruding Objects

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	1st
Room:	Corridor
Location:	
Cost:	2000
Duration:	10 hrs

271	Main Annex Jail	**Priority:**	4

Category	Alarms

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	1st
Room:	Corridor
Location:	
Cost:	See *4
Duration:	See *4

272	Main Annex Jail	**Priority:**	2

Category	Detention Facility Water Closets (GENERAL)

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	1st
Room:	Enroute
Location:	
Cost:	300
Duration:	1.5

273	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	1st
Room:	Enroute
Location:	
Cost:	300
Duration:	1.5

274	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	1st
Room:	Enroute
Location:	
Cost:	5000
Duration:	40 hrs

275	Main Annex Jail	**Priority:**	2
Category	Counters		

Issue	**Recommendation**
Counter height measured over 34" AFF (parallel approach)	Recess a portion of the counter to be 34" maximum AFF

ADA Reference:	
N/A	
CBC Reference:	
11B-904.4.1	
Floor:	1st
Room:	Enroute
Location:	
Cost:	4000
Duration:	20 hrs

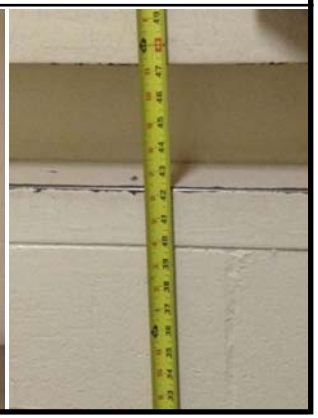

276	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Enroute
Location:	
Cost:	8000
Duration:	40 hrs

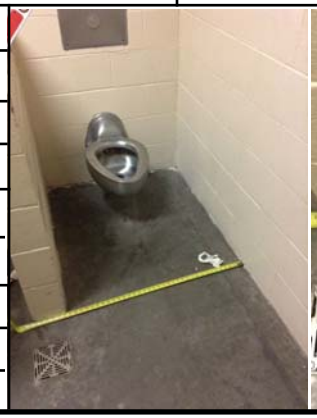

277	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	1st
Room:	Enroute
Location:	
Cost:	2000
Duration:	16 hrs

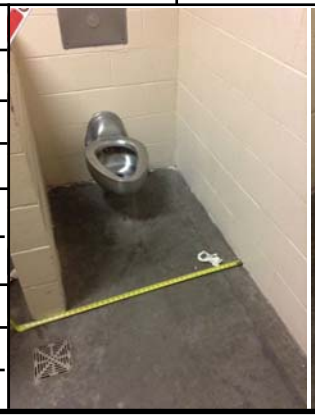

278	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	1st
Room:	Enroute
Location:	
Cost:	3000
Duration:	16 hrs

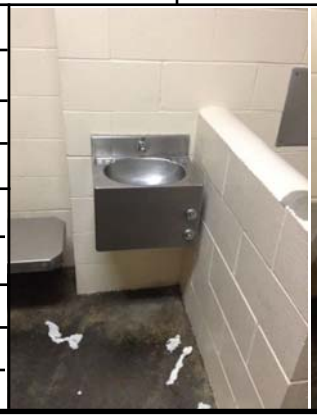

279	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Enroute
Location:	
Cost:	See ID #278
Duration:	See ID #278

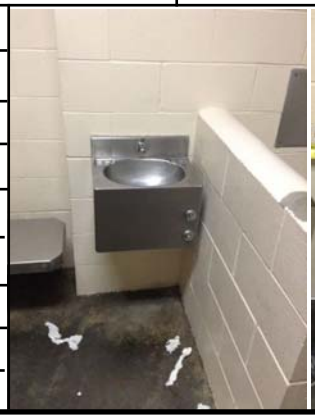

280	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Enroute
Location:	
Cost:	See *6
Duration:	See *6

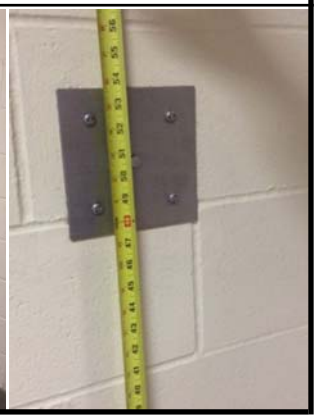

281	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	See *1
Duration:	See *1

282	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	6000
Duration:	18 hrs

283	Main Annex Jail	**Priority:**	3

Category	Water Closets (GENERAL)

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:	
604.6	
CBC Reference:	
11B-604.6	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	16 hrs

284	Main Annex Jail	**Priority:**	3

Category	Water Closets (ADULT)

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	16 hrs

285	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	300
Duration:	1.5

286	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	300
Duration:	1.5

287	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	10 hrs

288	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

289	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

290	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	100
Duration:	1 hr

291	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

292	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.25 hrs

293	Main Annex Jail	**Priority:**	3

Category	Lavatories (GENERAL)

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Staff Restroom
Location:	
Cost:	1000
Duration:	8 hrs

294	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	See *1
Duration:	See *1

295	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	6000
Duration:	18 hrs

296	Main Annex Jail	**Priority:**	3

Category	Water Closets (ADULT)

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	2000
Duration:	16 hrs

297	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	300
Duration:	1.5

298	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	300
Duration:	1.5

299	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	100
Duration:	1 hr

300	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	500
Duration:	1 hr

301	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

302	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

303	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.25 hrs

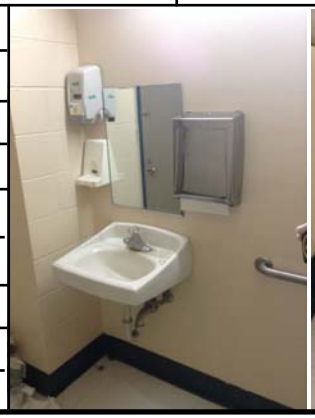

304	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	1000
Duration:	8 hrs

305	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	200
Duration:	1 hr

306	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

307	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	100
Duration:	1 hr

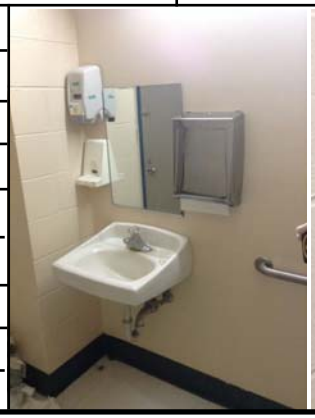

308	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	1st
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hr

309	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
50% of all drinking fountains are not standing accessible	Install for standing persons drinking fountain(s)

ADA Reference:	
211.3	
CBC Reference:	
11B-211.3	
Floor:	1st
Room:	Corridor
Location:	
Cost:	2000
Duration:	8 hrs

310	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	1st
Room:	Visitation
Location:	Inmate
Cost:	See *5
Duration:	See *5

311	Main Annex Jail	**Priority:**	2
Category	Counters		

Issue	**Recommendation**
Counter height measured over 34" AFF (parallel approach)	Recess a portion of the counter to be 34" maximum AFF

ADA Reference:	
N/A	
CBC Reference:	
11B-904.4.1	
Floor:	1st
Room:	male dress-in
Location:	
Cost:	4000
Duration:	20 hrs

312	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	1st
Room:	male dress-in
Location:	
Cost:	5000
Duration:	40 hrs

313	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	1st
Room:	male dress-in
Location:	Shower
Cost:	2000
Duration:	20 hrs

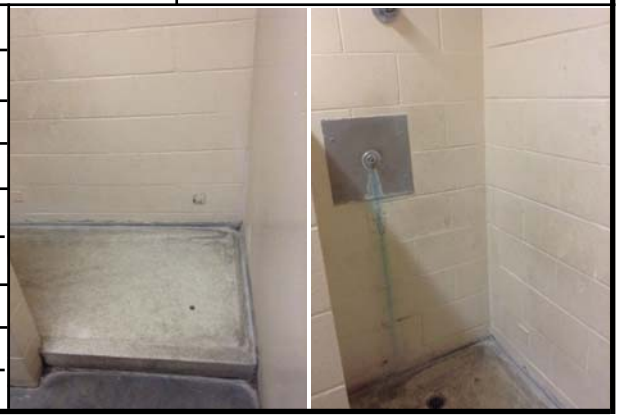

314	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	1st
Room:	male dress-in
Location:	Shower
Cost:	800
Duration:	1 hr

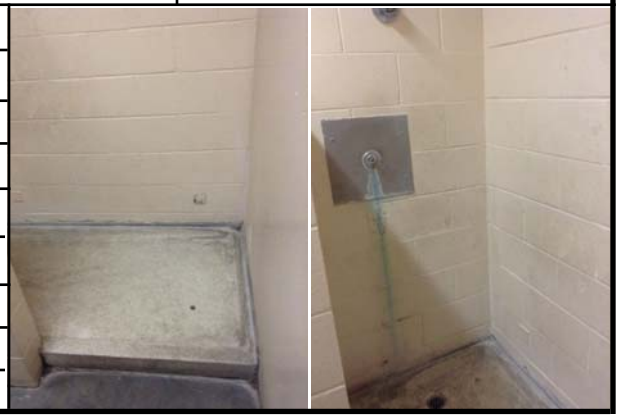

315	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	1st
Room:	male dress-in
Location:	Shower
Cost:	800
Duration:	1 hr

316	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	1st
Room:	male dress-in
Location:	Shower
Cost:	800
Duration:	1 hr

317	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	1st
Room:	male dress-in
Location:	Shower
Cost:	800
Duration:	1 hr

318	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	1st
Room:	male dress-in
Location:	Shower
Cost:	2000
Duration:	10 hrs

319	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	1st
Room:	male dress-in
Location:	Shower
Cost:	2000
Duration:	10 hrs

320	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	1st
Room:	male dress-in
Location:	
Cost:	See *1
Duration:	See *1

321	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	1st
Room:	male dress-in
Location:	
Cost:	See *1
Duration:	See *1

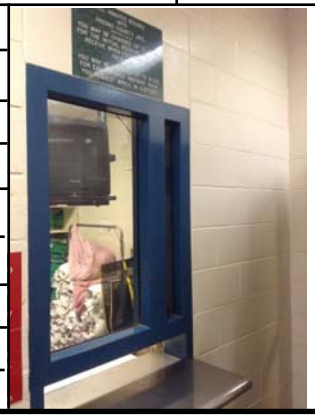

322	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Level area in direction of door swing (pull side) not 60" minimum length/maneuvering clearance	Provide required clearance area

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	1st
Room:	male dress-in
Location:	
Cost:	6000
Duration:	20 hrs

323	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	1st
Room:	Holding cell /
Location:	
Cost:	8000
Duration:	40 hrs

324	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	1st
Room:	Holding cell /
Location:	
Cost:	2000
Duration:	16 hrs

325	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	1st
Room:	Holding cell /
Location:	
Cost:	2000
Duration:	16 hrs

326	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	1st
Room:	Holding cell /
Location:	
Cost:	300
Duration:	1.5

327	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	1st
Room:	Holding cell /
Location:	
Cost:	300
Duration:	1.5

328	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Changes in level along route exceeds 1/4" maximum height	Provide affected concrete walk where level changes occur of 1/4" high

ADA Reference:	
303.2	
CBC Reference:	
11B-303.2	
Floor:	1st
Room:	Holding cell /
Location:	
Cost:	5000
Duration:	30 hrs

329	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	1st
Room:	Holding cell /
Location:	
Cost:	5000
Duration:	40 hrs

330	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	1st
Room:	Holding cell /
Location:	
Cost:	3000
Duration:	16 hrs

331	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	1st
Room:	Holding cell /
Location:	
Cost:	See ID #330
Duration:	See ID #330

332	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	1st
Room:	Holding cell /
Location:	
Cost:	See *6
Duration:	See *6

333	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	1st
Room:	Holding cell /
Location:	
Cost:	See *5
Duration:	See *5

334	Main Annex Jail	**Priority:**	1
Category	Elevators		

Issue	**Recommendation**
Emergency communication device (telephone) not provided or over 48" AFF	Adjust as required

ADA Reference:	
407.4.9	
CBC Reference:	
11B-407.4.9	
Floor:	1st
Room:	Elevator 4
Location:	
Cost:	5000
Duration:	20 hrs

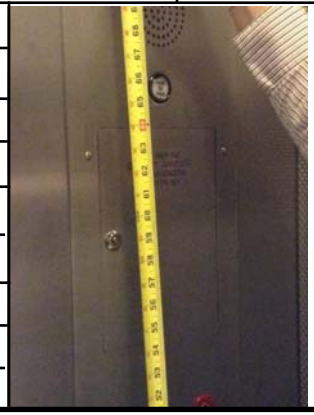

335	Main Annex Jail	**Priority:**	1
Category	Elevators		

Issue	**Recommendation**
rear grab bar not provided	

ADA Reference:	
407.1	
CBC Reference:	
11B-407.1	
Floor:	1st
Room:	Elevator 4
Location:	
Cost:	500
Duration:	1 hr

336	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Visitation
Location:	Inmate
Cost:	See *5
Duration:	See *5

337	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	2nd
Room:	Visitation
Location:	Inmate
Cost:	500
Duration:	1 hr

338	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - B4
Location:	
Cost:	3000
Duration:	16 hrs

339	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - B4
Location:	
Cost:	See *13
Duration:	See *13

340	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	2nd
Room:	Cell - B4
Location:	Shower
Cost:	See *13
Duration:	See *13

341	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - B4
Location:	Shower
Cost:	See *13
Duration:	See *13

342	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - B4
Location:	Shower
Cost:	See *13
Duration:	See *13

343	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - B4
Location:	Shower
Cost:	See *13
Duration:	See *13

344	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - B4
Location:	Shower
Cost:	See *13
Duration:	See *13

345	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Cell - B4
Location:	
Cost:	See *13
Duration:	See *13

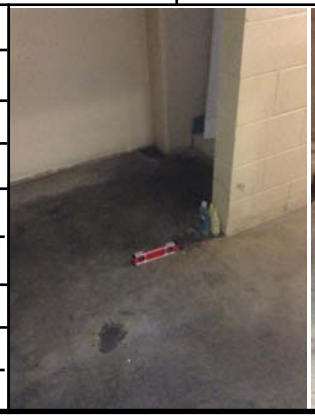

346	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - B4
Location:	
Cost:	See *13
Duration:	See *13

347	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - B4
Location:	
Cost:	2000
Duration:	16 hrs

348	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B4
Location:	
Cost:	See *13
Duration:	See *13

349	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - B4
Location:	
Cost:	See *13
Duration:	See *13

350	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - B4
Location:	
Cost:	See *13
Duration:	See *13

351	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B4
Location:	
Cost:	See *13
Duration:	See *13

352	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B4
Location:	
Cost:	See *13
Duration:	See *13

353	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - B4
Location:	
Cost:	See *5
Duration:	See *5

354	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	2nd
Room:	Cell - B4
Location:	
Cost:	See *13
Duration:	See *13

355	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	2nd
Room:	Cell - B3
Location:	Shower
Cost:	See *13
Duration:	See *13

356	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - B3
Location:	Shower
Cost:	See *13
Duration:	See *13

357	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - B3
Location:	Shower
Cost:	See *13
Duration:	See *13

358	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - B3
Location:	Shower
Cost:	See *13
Duration:	See *13

359	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

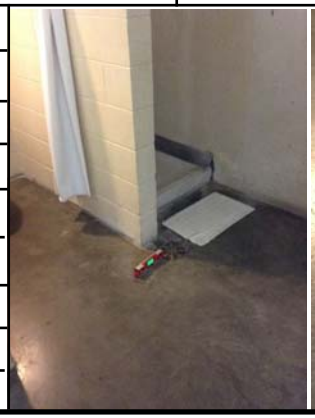

360	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

361	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	3000
Duration:	16 hrs

362	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

363	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
Clear floor space (30" x 48") not provided	Provide 30" X 48" clearance

ADA Reference:	
602.2	
CBC Reference:	
11B-602.2	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	4000
Duration:	20 hrs

364	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

365	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

366	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

367	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

368	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	2000
Duration:	16 hrs

369	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

370	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

371	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

372	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

373	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

374	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *5
Duration:	See *5

375	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B3
Location:	
Cost:	See *13
Duration:	See *13

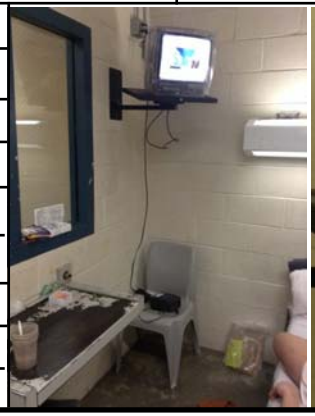

376	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - B2
Location:	Shower
Cost:	See *13
Duration:	See *13

377	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - B2
Location:	Shower
Cost:	See *13
Duration:	See *13

378	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - B2
Location:	Shower
Cost:	See *13
Duration:	See *13

379	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
Clear floor space (30" x 48") not provided	Provide 30" X 48" clearance

ADA Reference:	
602.2	
CBC Reference:	
11B-602.2	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	4000
Duration:	20 hrs

380	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Clear floor space (36" x 60") not provided adjacent to standard roll-in compartment	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.2.1	
CBC Reference:	
11B-608.2.2.1	
Floor:	2nd
Room:	Cell - B2
Location:	Shower
Cost:	See *13
Duration:	See *13

381	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	3000
Duration:	16 hrs

382	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	1000
Duration:	8 hrs

383	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - B2
Location:	Shower
Cost:	See *13
Duration:	See *13

384	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	See *13
Duration:	See *13

385	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	See *13
Duration:	See *13

386	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	See *13
Duration:	See *13

387	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	See *13
Duration:	See *13

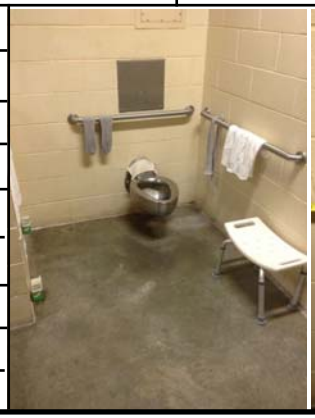

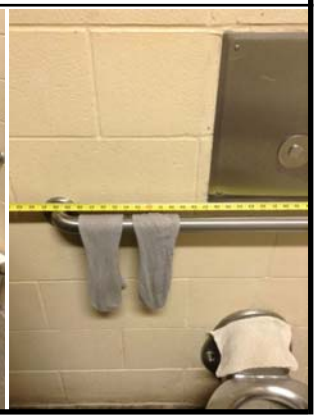

388	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	See *13
Duration:	See *13

389	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	2000
Duration:	16 hrs

390	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	See *13
Duration:	See *13

391	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	See *13
Duration:	See *13

392	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	See *5
Duration:	See *5

393	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	See *13
Duration:	See *13

394	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B2
Location:	
Cost:	See *13
Duration:	See *13

395	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Medical
Location:	
Cost:	See *2
Duration:	See *2

396	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, front approach)	Provide minimum 12" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Medical
Location:	
Cost:	200
Duration:	2 hrs

397	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Medical
Location:	
Cost:	See *6
Duration:	See *6

398	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Medical
Location:	
Cost:	See *6
Duration:	See *6

399	Main Annex Jail	**Priority:**	2
Category	Aisles		

Issue	**Recommendation**
Minimum clear aisle width of 44" (serving two sides) not provided	Provide 44" width clearance

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Medical
Location:	
Cost:	500
Duration:	5 hrs

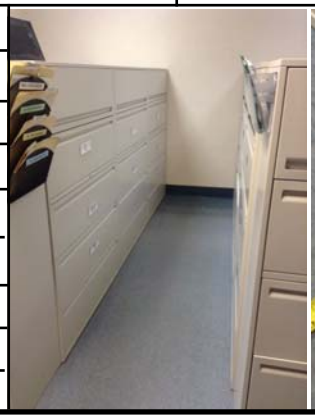

400	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Support staff
Location:	
Cost:	See *1
Duration:	See *1

401	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Support staff
Location:	
Cost:	See *2
Duration:	See *2

402	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Support staff
Location:	
Cost:	See *6
Duration:	See *6

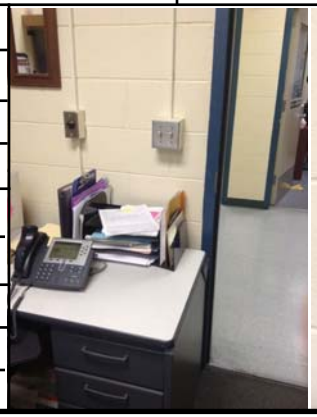

403	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Medical
Location:	
Cost:	See *2
Duration:	See *2

404	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Support staff
Location:	
Cost:	200
Duration:	2 hrs

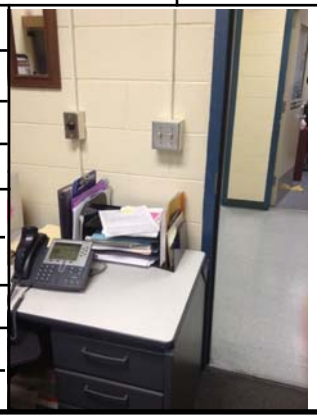

405	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Medical
Location:	
Cost:	See *1
Duration:	See *1

406	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Medical
Location:	
Cost:	200
Duration:	2 hrs

407	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Medical
Location:	
Cost:	See *6
Duration:	See *6

408	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Medical
Location:	
Cost:	See *1
Duration:	See *1

409	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	2nd
Room:	Medical
Location:	
Cost:	500
Duration:	1 hr

410	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Secretary
Location:	
Cost:	See *6
Duration:	See *6

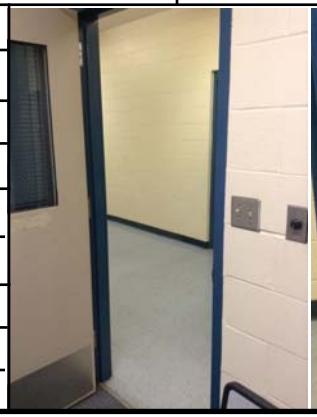

411	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	2nd
Room:	Secretary
Location:	
Cost:	500
Duration:	1 hr

412	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Secretary
Location:	
Cost:	See *1
Duration:	See *1

413	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Secretary
Location:	
Cost:	See *6
Duration:	See *6

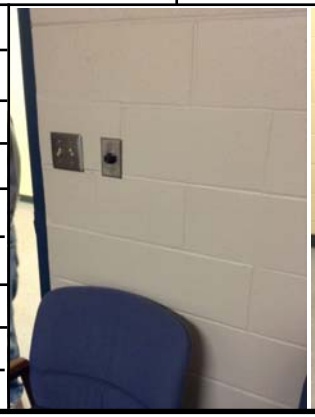

414	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Secretary
Location:	
Cost:	See *2
Duration:	See *2

415	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	2nd
Room:	Corridor
Location:	
Cost:	See *1
Duration:	See *1

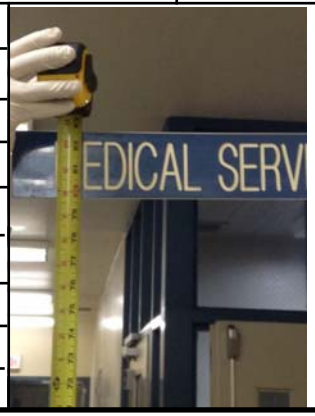

416	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Nurse Room
Location:	Restroom
Cost:	2000
Duration:	16 hrs

417	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	2nd
Room:	Nurse Room
Location:	Restroom
Cost:	6000
Duration:	18 hrs

418	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Nurse Room
Location:	Restroom
Cost:	2000
Duration:	16 hrs

419	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Nurse Room
Location:	Restroom
Cost:	3000
Duration:	16 hrs

420	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Nurse Room
Location:	Restroom
Cost:	50
Duration:	.5 hrs

421	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Nurse Room
Location:	Restroom
Cost:	50
Duration:	.5 hrs

422	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Nurse Room
Location:	Restroom
Cost:	100
Duration:	1 hr

423	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Nurse Room
Location:	Restroom
Cost:	50
Duration:	.5 hrs

424	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Nurse Room
Location:	Restroom
Cost:	See *6
Duration:	See *6

425	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser located over 9" from edge of toilet	Relocate TPD with 9" maximum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	2nd
Room:	Nurse Room
Location:	Restroom
Cost:	50
Duration:	.5 hrs

426	Main Annex Jail	**Priority:**	4
Category	Accessible Clearance		

Issue	**Recommendation**
Required 60" diameter circle or 'T'-shaped clear floor space not provided within room	Provide required clearance

ADA Reference:	
304.3	
CBC Reference:	
11B-304.3	
Floor:	2nd
Room:	Nurse Room
Location:	Restroom
Cost:	10000
Duration:	50 hrs

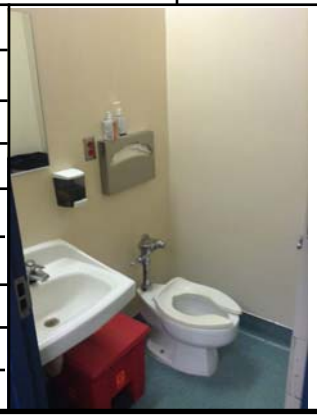

427	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	2nd
Room:	Nurse Room
Location:	Restroom
Cost:	50
Duration:	.25 hrs

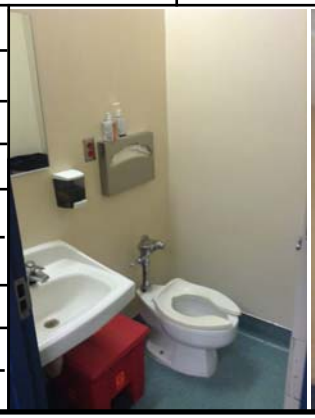

428	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Nurse Room
Location:	
Cost:	See *6
Duration:	See *6

429	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Nurse Room
Location:	
Cost:	200
Duration:	2 hrs

430	Main Annex Jail	**Priority:**	4
Category	Sinks (ADULT)		

Issue	**Recommendation**
Height of rim or counter measured over 34" AFF	Reset sink/or provide maximum 34" AFF counter

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	2nd
Room:	Nurse Room
Location:	
Cost:	1000
Duration:	8 hrs

431	Main Annex Jail	**Priority:**	4
Category	Sinks (GENERAL)		

Issue	**Recommendation**
Accessible sink not provided	Provide accessible sink

ADA Reference:	
606.1	
CBC Reference:	
11B-606.1	
Floor:	2nd
Room:	Nurse Room
Location:	
Cost:	4000
Duration:	20 hrs

432	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Nurse Room
Location:	
Cost:	See *6
Duration:	See *6

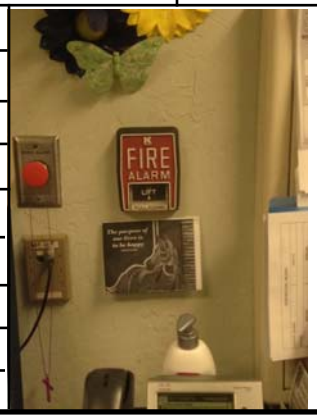

433	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Nurse Room
Location:	
Cost:	See *2
Duration:	See *2

434	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	2nd
Room:	Nurse Room
Location:	
Cost:	500
Duration:	1 hr

435	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Nurse Room
Location:	
Cost:	See *1
Duration:	See *1

436	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Utility
Location:	
Cost:	See *1
Duration:	See *1

437	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Exam room
Location:	
Cost:	See *6
Duration:	See *6

438	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Exam room
Location:	
Cost:	See *6
Duration:	See *6

439	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Exam room
Location:	
Cost:	See *6
Duration:	See *6

440	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Pharmacy
Location:	
Cost:	See *6
Duration:	See *6

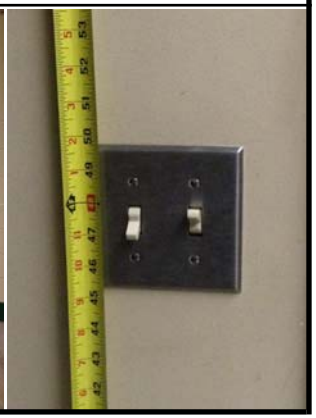

441	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Pharmacy
Location:	Restroom
Cost:	See *6
Duration:	See *6

442	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Pharmacy
Location:	
Cost:	See *6
Duration:	See *6

443	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Pharmacy
Location:	
Cost:	See *6
Duration:	See *6

444	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	2nd
Room:	Cell - B1
Location:	Shower
Cost:	See *13
Duration:	See *13

445	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - B1
Location:	Shower
Cost:	See *13
Duration:	See *13

446	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - B1
Location:	Shower
Cost:	See *13
Duration:	See *13

447	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - B1
Location:	Shower
Cost:	See *13
Duration:	See *13

448	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

449	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	2000
Duration:	16 hrs

450	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

451	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

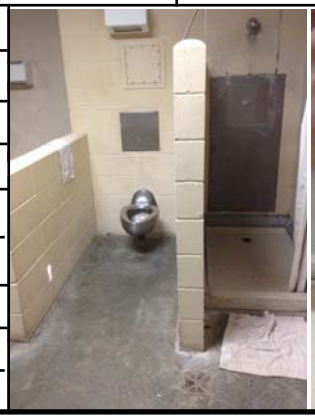

452	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

453	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

454	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

455	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

456	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

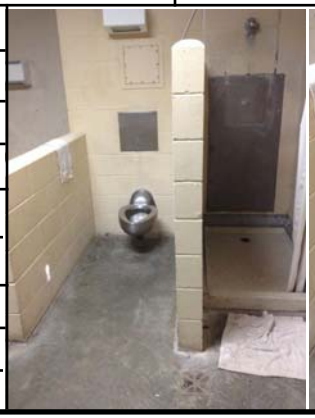

457	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

458	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - B1
Location:	Shower
Cost:	See *13
Duration:	See *13

459	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	2nd
Room:	Cell - B1
Location:	Shower
Cost:	See *13
Duration:	See *13

460	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - B1
Location:	Shower
Cost:	See *13
Duration:	See *13

461	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	2nd
Room:	Cell - B1
Location:	Shower
Cost:	See *13
Duration:	See *13

462	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - B1
Location:	Shower
Cost:	See *13
Duration:	See *13

463	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	3000
Duration:	16 hrs

464	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

465	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

466	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Minimum 30" x 48" clear floor space not provided	Provide 30" X 48" clearance

ADA Reference:	
606.2	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

467	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

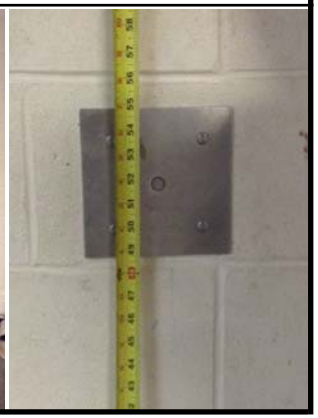

468	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

469	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

470	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

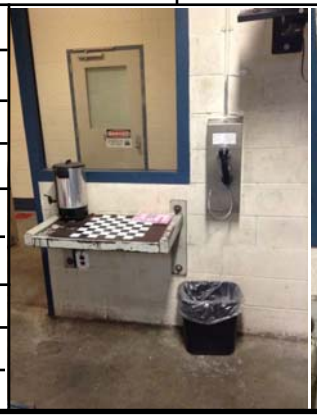

471	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *5
Duration:	See *5

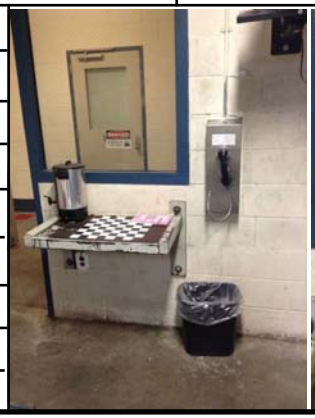

472	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	2nd
Room:	Cell - B1
Location:	
Cost:	See *13
Duration:	See *13

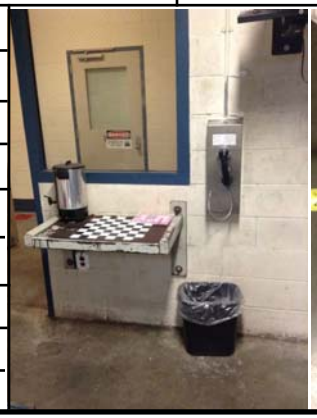

473	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - A10
Location:	Shower
Cost:	See *13
Duration:	See *13

474	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	2nd
Room:	Cell - A10
Location:	Shower
Cost:	See *13
Duration:	See *13

475	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - A10
Location:	Shower
Cost:	See *13
Duration:	See *13

476	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - A10
Location:	Shower
Cost:	See *13
Duration:	See *13

477	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	2nd
Room:	Cell - A10
Location:	Shower
Cost:	See *13
Duration:	See *13

478	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A10
Location:	Shower
Cost:	See *13
Duration:	See *13

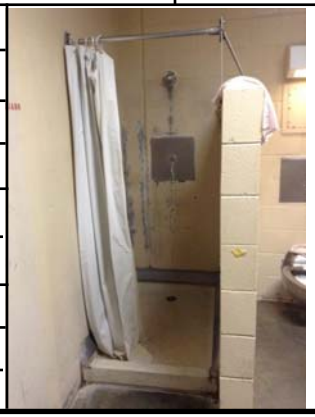

479	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	2nd
Room:	Cell - A10
Location:	Shower
Cost:	See *13
Duration:	See *13

480	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A10
Location:	Shower
Cost:	See *13
Duration:	See *13

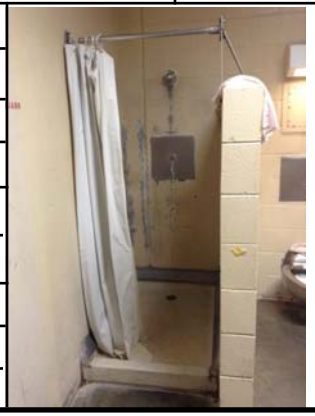

481	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A10
Location:	Shower
Cost:	See *13
Duration:	See *13

482	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	2000
Duration:	16 hrs

483	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

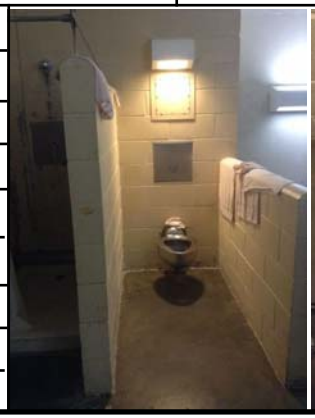

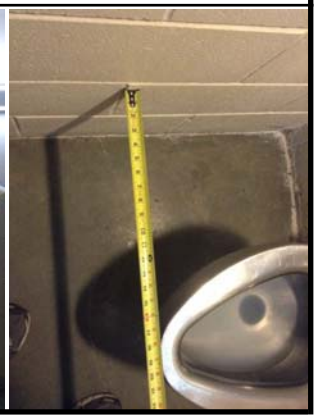

484	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

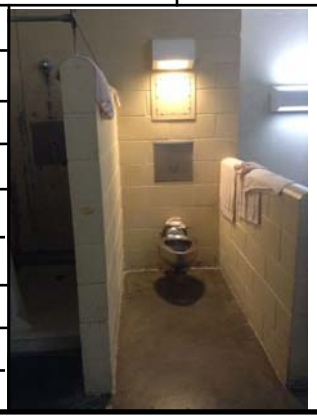

485	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

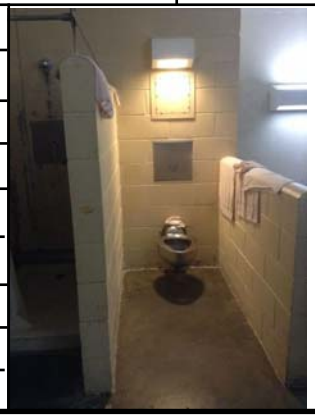

486	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

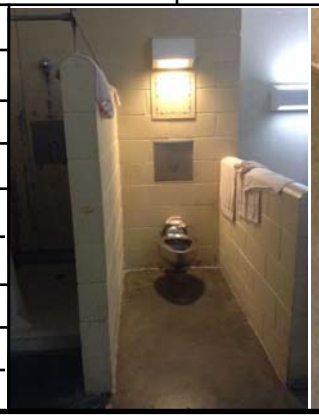

487	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

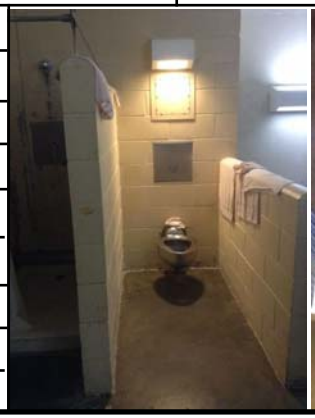

488	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

489	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

490	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

491	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	3000
Duration:	16 hrs

492	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

493	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Minimum 30" x 48" clear floor space not provided	Provide 30" X 48" clearance

ADA Reference:	
606.2	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

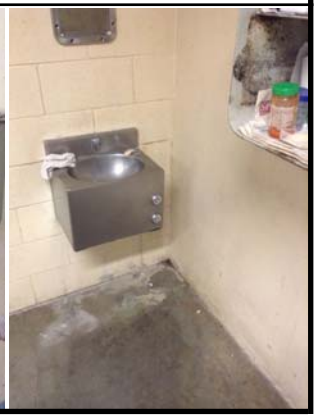

494	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

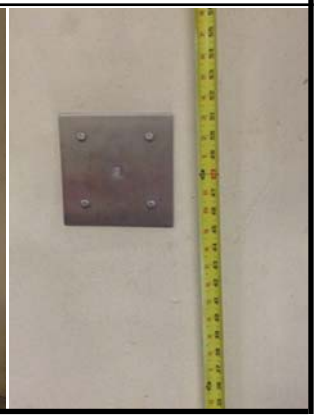

495	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

496	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

497	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *5
Duration:	See *5

498	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

499	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

500	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

501	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	2nd
Room:	Cell - A10
Location:	
Cost:	See *13
Duration:	See *13

502	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - A9
Location:	Shower
Cost:	See *13
Duration:	See *13

503	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - A9
Location:	Shower
Cost:	See *13
Duration:	See *13

504	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - A9
Location:	Shower
Cost:	See *13
Duration:	See *13

505	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	2nd
Room:	Cell - A9
Location:	Shower
Cost:	See *13
Duration:	See *13

506	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A9
Location:	Shower
Cost:	See *13
Duration:	See *13

507	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	2nd
Room:	Cell - A9
Location:	Shower
Cost:	See *13
Duration:	See *13

508	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	2nd
Room:	Cell - A9
Location:	Shower
Cost:	See *13
Duration:	See *13

509	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A9
Location:	Shower
Cost:	See *13
Duration:	See *13

510	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	See *13
Duration:	See *13

511	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	3000
Duration:	16 hrs

512	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	See *13
Duration:	See *13

513	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	2000
Duration:	16 hrs

514	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	2000
Duration:	16 hrs

515	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	See *13
Duration:	See *13

516	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	See *13
Duration:	See *13

517	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	See *13
Duration:	See *13

518	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	See *13
Duration:	See *13

519	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	See *13
Duration:	See *13

520	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	See *13
Duration:	See *13

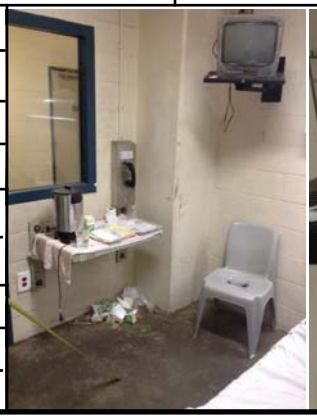

521	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	See *13
Duration:	See *13

522	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - A9
Location:	
Cost:	See *5
Duration:	See *5

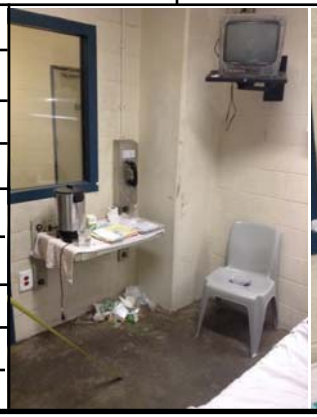

523	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - A8
Location:	Shower
Cost:	See *13
Duration:	See *13

524	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	2nd
Room:	Cell - A8
Location:	Shower
Cost:	See *13
Duration:	See *13

525	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - A8
Location:	Shower
Cost:	See *13
Duration:	See *13

526	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - A8
Location:	Shower
Cost:	See *13
Duration:	See *13

527	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	2nd
Room:	Cell - A8
Location:	Shower
Cost:	See *13
Duration:	See *13

528	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A8
Location:	Shower
Cost:	See *13
Duration:	See *13

529	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	2nd
Room:	Cell - A8
Location:	Shower
Cost:	See *13
Duration:	See *13

530	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A8
Location:	Shower
Cost:	See *13
Duration:	See *13

531	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	2nd
Room:	Cell - A8
Location:	Shower
Cost:	See *13
Duration:	See *13

532	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

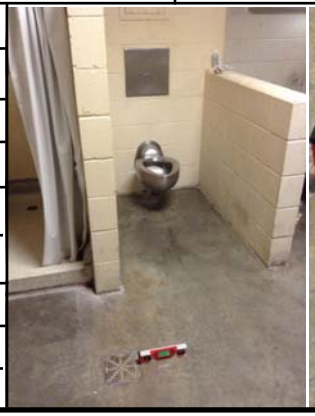

533	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

534	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	2000
Duration:	16 hrs

535	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

536	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

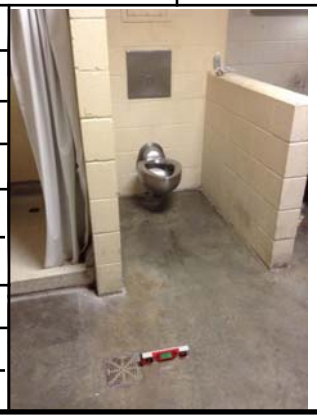

537	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

538	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

539	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

540	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

541	Main Annex Jail	**Priority:**	3

Category	Lavatories (ADULT)

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	3000
Duration:	16 hrs

542	Main Annex Jail	**Priority:**	2

Category	Detention Facility Accessories

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

543	Main Annex Jail	**Priority:**	2

Category	Detention Facility Lavatories (GENERAL)

Issue	**Recommendation**
Minimum 30" x 48" clear floor space not provided	Provide 30" X 48" clearance

ADA Reference:	
606.2	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

544	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

545	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

546	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

547	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

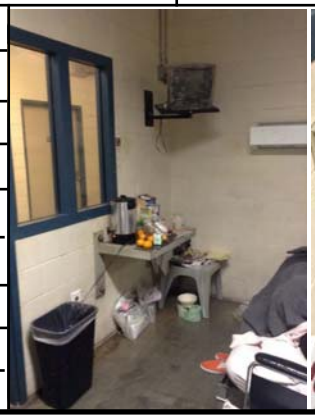

548	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

549	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

550	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *5
Duration:	See *5

551	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	2nd
Room:	Cell - A8
Location:	
Cost:	See *13
Duration:	See *13

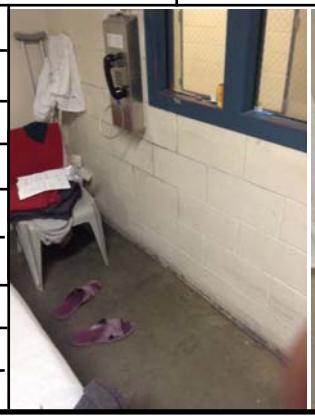

552	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - A7
Location:	Shower
Cost:	See *13
Duration:	See *13

553	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:
N/A
CBC Reference:
11B-608.9

Floor:	2nd
Room:	Cell - A7
Location:	Shower
Cost:	See *13
Duration:	See *13

554	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:
608.2.3
CBC Reference:
11B-608.2.3

Floor:	2nd
Room:	Cell - A7
Location:	Shower
Cost:	See *13
Duration:	See *13

555	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:
307.4
CBC Reference:
11B-307.4

Floor:	2nd
Room:	Cell - A7
Location:	Shower
Cost:	See *13
Duration:	See *13

556	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:
N/A
CBC Reference:
11B-608.5.2

Floor:	2nd
Room:	Cell - A7
Location:	Shower
Cost:	See *13
Duration:	See *13

557	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

558	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	2nd
Room:	Cell - A7
Location:	Shower
Cost:	See *13
Duration:	See *13

559	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A7
Location:	Shower
Cost:	See *13
Duration:	See *13

560	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	2nd
Room:	Cell - A7
Location:	Shower
Cost:	See *13
Duration:	See *13

561	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A7
Location:	Shower
Cost:	See *13
Duration:	See *13

562	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	2nd
Room:	Cell - A7
Location:	Shower
Cost:	See *13
Duration:	See *13

563	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

564	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

565	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	2000
Duration:	16 hrs

566	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

567	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

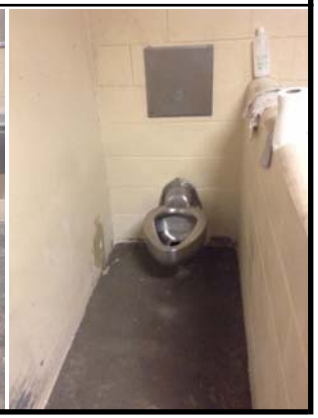

568	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	3000
Duration:	16 hrs

569	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

570	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

571	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

572	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

573	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

574	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

575	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

576	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

577	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

578	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

579	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

580	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

581	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

582	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *5
Duration:	See *5

583	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	2nd
Room:	Cell - A7
Location:	
Cost:	See *13
Duration:	See *13

584	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - A6
Location:	Shower
Cost:	See *13
Duration:	See *13

585	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	2nd
Room:	Cell - A6
Location:	Shower
Cost:	See *13
Duration:	See *13

586	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A6
Location:	Shower
Cost:	See *13
Duration:	See *13

587	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - A6
Location:	Shower
Cost:	See *13
Duration:	See *13

588	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - A6
Location:	Shower
Cost:	See *13
Duration:	See *13

589	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	2nd
Room:	Cell - A6
Location:	Shower
Cost:	See *13
Duration:	See *13

590	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A6
Location:	Shower
Cost:	See *13
Duration:	See *13

591	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	2nd
Room:	Cell - A6
Location:	Shower
Cost:	See *13
Duration:	See *13

592	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A6
Location:	Shower
Cost:	See *13
Duration:	See *13

593	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	2nd
Room:	Cell - A6
Location:	Shower
Cost:	See *13
Duration:	See *13

594	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

595	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	2000
Duration:	16 hrs

596	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

597	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

598	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

599	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide assistance placard

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

600	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

601	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

602	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	3000
Duration:	16 hrs

603	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

604	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

605	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

606	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

607	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *5
Duration:	See *5

608	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

609	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

610	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

611	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A6
Location:	
Cost:	See *13
Duration:	See *13

612	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - A5
Location:	Shower
Cost:	See *13
Duration:	See *13

613	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - A5
Location:	Shower
Cost:	See *13
Duration:	See *13

614	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - A5
Location:	Shower
Cost:	See *13
Duration:	See *13

615	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not within 6" maximum of adjacent wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A5
Location:	Shower
Cost:	See *13
Duration:	See *13

616	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	2nd
Room:	Cell - A5
Location:	Shower
Cost:	See *13
Duration:	See *13

617	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Minimum 30" x 48" clear floor space not provided	Provide 30" X 48" clearance

ADA Reference:	
606.2	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *13
Duration:	See *13

618	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	3000
Duration:	16 hrs

619	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *13
Duration:	See *13

620	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A5
Location:	Shower
Cost:	See *13
Duration:	See *13

621	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *13
Duration:	See *13

622	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *13
Duration:	See *13

623	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *13
Duration:	See *13

624	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	2000
Duration:	16 hrs

625	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *13
Duration:	See *13

626	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *13
Duration:	See *13

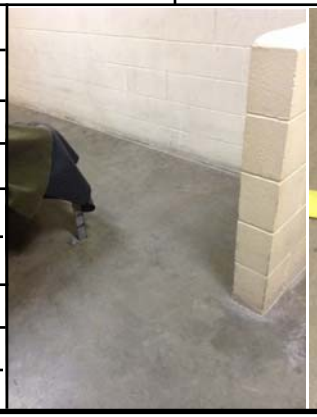

627	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *13
Duration:	See *13

628	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *13
Duration:	See *13

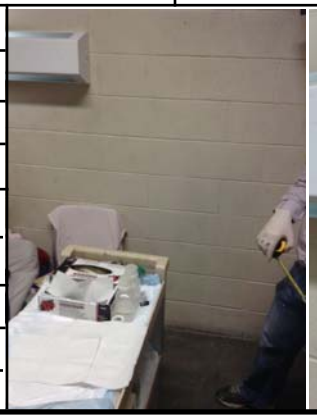

629	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *13
Duration:	See *13

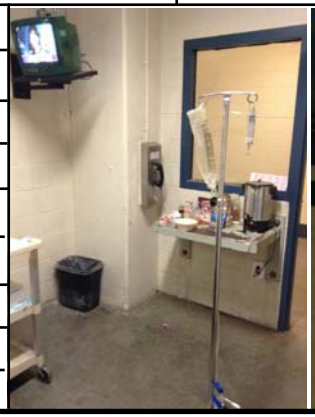

630	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *13
Duration:	See *13

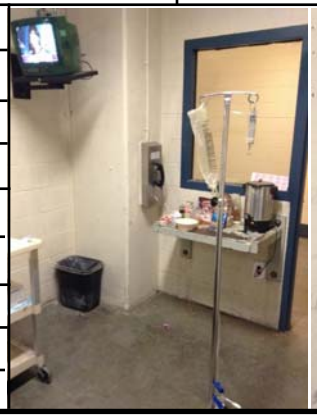

631	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *5
Duration:	See *5

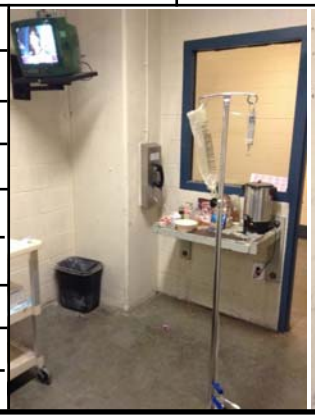

632	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	2nd
Room:	Cell - A5
Location:	
Cost:	See *13
Duration:	See *13

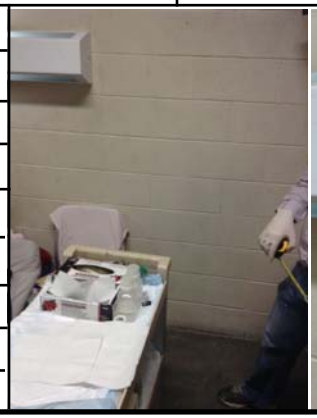

633	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Directional slope of walk over 5.0%	Provide concrete walk with maximum 5.0% slope or provide pedestrian ramp with handrails

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Cell - A4
Location:	Shower
Cost:	See *13
Duration:	See *13

634	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - A4
Location:	Shower
Cost:	See *13
Duration:	See *13

635	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - A4
Location:	Shower
Cost:	See *13
Duration:	See *13

636	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A4
Location:	Shower
Cost:	See *13
Duration:	See *13

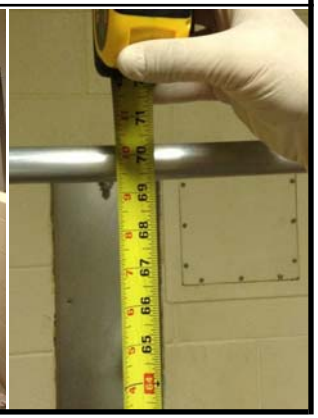

637	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A4
Location:	Shower
Cost:	See *13
Duration:	See *13

638	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide assistance placard

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

639	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

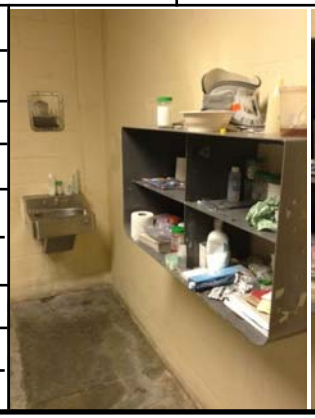

640	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

641	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	3000
Duration:	16 hrs

642	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

643	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

644	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar less than 24" from front of toilet to far edge	Adjust as required and/or provide new bar per current standards

ADA Reference:	
N/A	
CBC Reference:	
11B-604.5.1	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

645	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

646	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured over 19" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	2000
Duration:	16 hrs

647	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

648	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

649	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

650	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

651	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

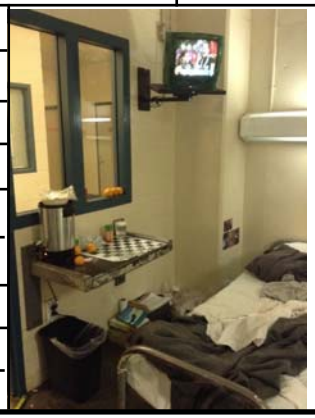

652	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

653	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

654	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

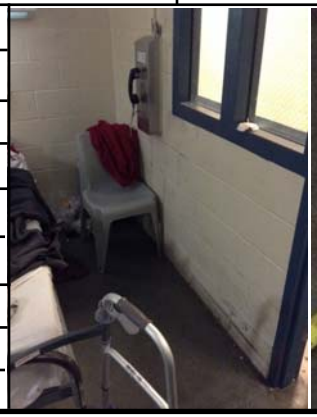

655	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *13
Duration:	See *13

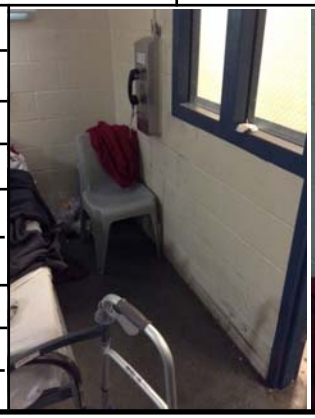

656	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - A4
Location:	
Cost:	See *5
Duration:	See *5

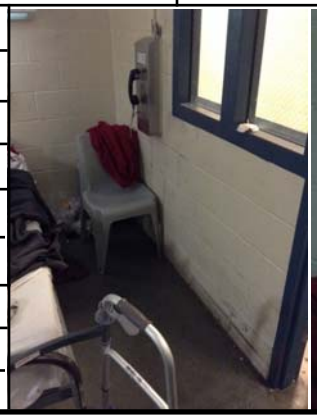

657	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - A3
Location:	Shower
Cost:	See *13
Duration:	See *13

658	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	2nd
Room:	Cell - A3
Location:	Shower
Cost:	See *13
Duration:	See *13

659	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - A3
Location:	Shower
Cost:	See *13
Duration:	See *13

660	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - A3
Location:	Shower
Cost:	See *13
Duration:	See *13

661	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A3
Location:	Shower
Cost:	See *13
Duration:	See *13

662	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *13
Duration:	See *13

663	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *13
Duration:	See *13

664	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	2000
Duration:	16 hrs

665	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *13
Duration:	See *13

666	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *13
Duration:	See *13

667	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *13
Duration:	See *13

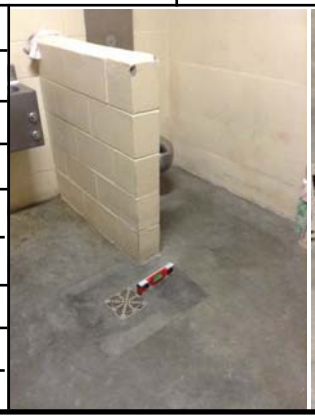

668	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	3000
Duration:	16 hrs

669	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *13
Duration:	See *13

670	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *13
Duration:	See *13

671	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *13
Duration:	See *13

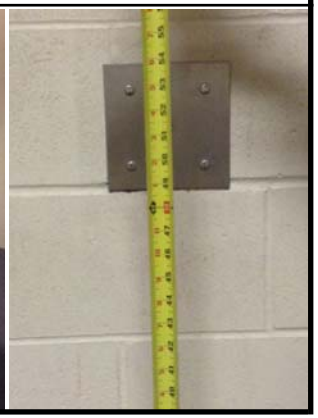

672	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *13
Duration:	See *13

673	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	Recommendation
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *13
Duration:	See *13

674	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	Recommendation
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *5
Duration:	See *5

675	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	Recommendation
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *13
Duration:	See *13

676	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	Recommendation
Minimum 15" AFF reach range not provided / front approach	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A3
Location:	
Cost:	See *13
Duration:	See *13

677	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - A2
Location:	Shower
Cost:	See *13
Duration:	See *13

678	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	2nd
Room:	Cell - A2
Location:	Shower
Cost:	See *13
Duration:	See *13

679	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - A2
Location:	Shower
Cost:	See *13
Duration:	See *13

680	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - A2
Location:	Shower
Cost:	See *13
Duration:	See *13

681	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A2
Location:	Shower
Cost:	See *13
Duration:	See *13

682	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	2nd
Room:	Cell - A2
Location:	Shower
Cost:	See *13
Duration:	See *13

683	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A2
Location:	Shower
Cost:	See *13
Duration:	See *13

684	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	2nd
Room:	Cell - A2
Location:	Shower
Cost:	See *13
Duration:	See *13

685	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - A2
Location:	Shower
Cost:	See *13
Duration:	See *13

686	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	2nd
Room:	Cell - A2
Location:	Shower
Cost:	See *13
Duration:	See *13

687	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *13
Duration:	See *13

688	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	2000
Duration:	16 hrs

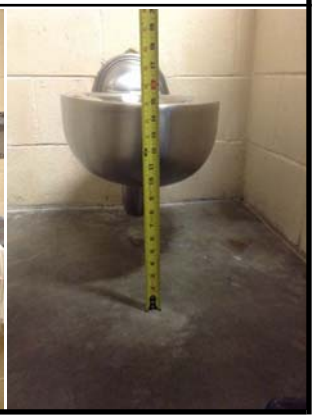

689	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *13
Duration:	See *13

690	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *13
Duration:	See *13

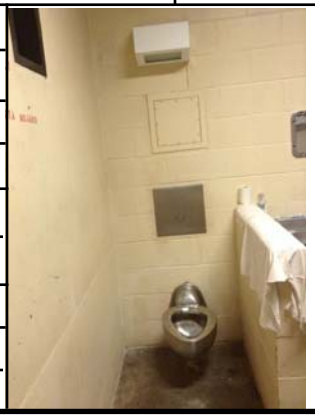

691	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *13
Duration:	See *13

692	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *13
Duration:	See *13

693	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *13
Duration:	See *13

694	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	3000
Duration:	16 hrs

695	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *13
Duration:	See *13

696	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *13
Duration:	See *13

697	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *13
Duration:	See *13

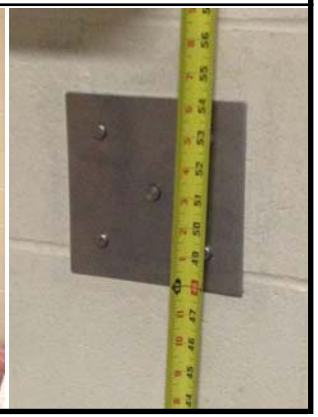

698	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *13
Duration:	See *13

699	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *13
Duration:	See *13

700	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *13
Duration:	See *13

701	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - A2
Location:	
Cost:	See *5
Duration:	See *5

702	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	2nd
Room:	Cell - A1
Location:	Shower
Cost:	See *13
Duration:	See *13

703	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - A1
Location:	Shower
Cost:	See *13
Duration:	See *13

704	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - A1
Location:	Shower
Cost:	See *13
Duration:	See *13

705	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - A1
Location:	Shower
Cost:	See *13
Duration:	See *13

706	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A1
Location:	Shower
Cost:	See *13
Duration:	See *13

707	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	2nd
Room:	Cell - A1
Location:	Shower
Cost:	See *13
Duration:	See *13

708	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *13
Duration:	See *13

709	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *13
Duration:	See *13

710	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	2000
Duration:	16 hrs

711	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *13
Duration:	See *13

712	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	3000
Duration:	16 hrs

713	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *13
Duration:	See *13

714	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *13
Duration:	See *13

715	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *13
Duration:	See *13

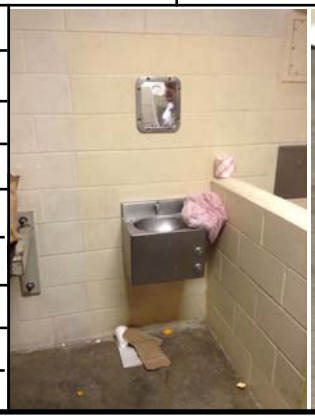

716	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *13
Duration:	See *13

717	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *5
Duration:	See *5

718	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *13
Duration:	See *13

719	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *13
Duration:	See *13

720	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *13
Duration:	See *13

721	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *13
Duration:	See *13

722	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - A1
Location:	
Cost:	See *13
Duration:	See *13

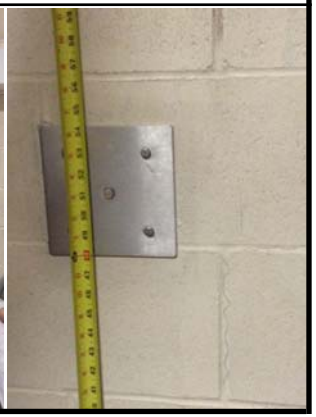

723	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - C2
Location:	Shower
Cost:	See *13
Duration:	See *13

724	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Width opening (36") not provided at one end of 60" long alternate shower	Provide required clearance or provide alternative accessible shower

ADA Reference:	
608.2.3	
CBC Reference:	
11B-608.2.3	
Floor:	2nd
Room:	Cell - C2
Location:	Shower
Cost:	See *13
Duration:	See *13

725	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - C2
Location:	Shower
Cost:	See *13
Duration:	See *13

726	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - C2
Location:	Shower
Cost:	See *13
Duration:	See *13

727	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - C2
Location:	Shower
Cost:	See *13
Duration:	See *13

728	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - C2
Location:	Shower
Cost:	See *13
Duration:	See *13

729	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	2nd
Room:	Cell - C2
Location:	
Cost:	See *13
Duration:	See *13

730	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	2nd
Room:	Cell - C2
Location:	
Cost:	See *13
Duration:	See *13

731	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Cell - C2
Location:	
Cost:	See *13
Duration:	See *13

732	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - C2
Location:	
Cost:	3000
Duration:	16 hrs

733	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - C2
Location:	
Cost:	See *13
Duration:	See *13

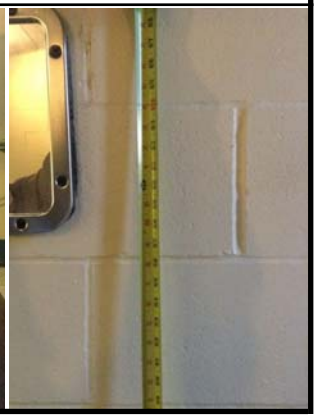

734	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - C2
Location:	
Cost:	See *13
Duration:	See *13

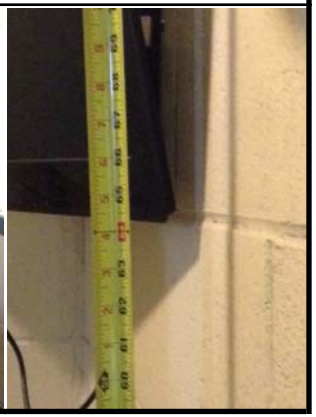

735	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	2nd
Room:	Cell - C2
Location:	
Cost:	See *13
Duration:	See *13

736	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - C2
Location:	
Cost:	See *5
Duration:	See *5

737	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - C2
Location:	
Cost:	See *13
Duration:	See *13

738	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	2nd
Room:	Cell - C1
Location:	Shower
Cost:	See *13
Duration:	See *13

739	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	2nd
Room:	Cell - C1
Location:	Shower
Cost:	See *13
Duration:	See *13

740	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	2nd
Room:	Cell - C1
Location:	Shower
Cost:	See *13
Duration:	See *13

741	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	2nd
Room:	Cell - C1
Location:	Shower
Cost:	See *13
Duration:	See *13

742	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Cell - C1
Location:	
Cost:	See *13
Duration:	See *13

743	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	2nd
Room:	Cell - C1
Location:	
Cost:	See *13
Duration:	See *13

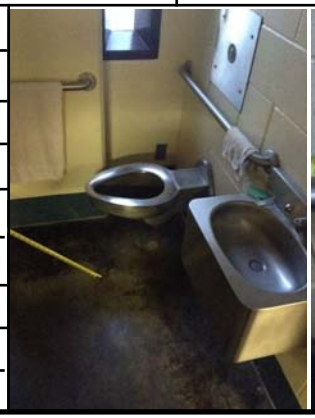

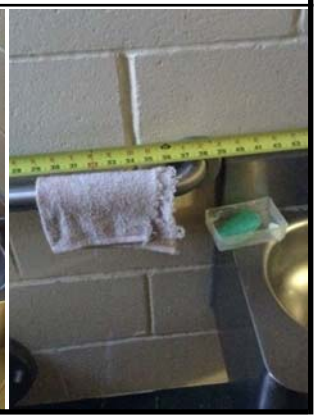

744	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Cell - C1
Location:	
Cost:	3000
Duration:	16 hrs

745	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Cell - C1
Location:	
Cost:	See *13
Duration:	See *13

746	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Cell - C1
Location:	
Cost:	See *13
Duration:	See *13

747	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - C1
Location:	
Cost:	See *13
Duration:	See *13

748	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	2nd
Room:	Cell - C1
Location:	
Cost:	See *5
Duration:	See *5

749	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	2nd
Room:	Cell - C1
Location:	
Cost:	See *13
Duration:	See *13

750	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Cell - C1
Location:	
Cost:	See *13
Duration:	See *13

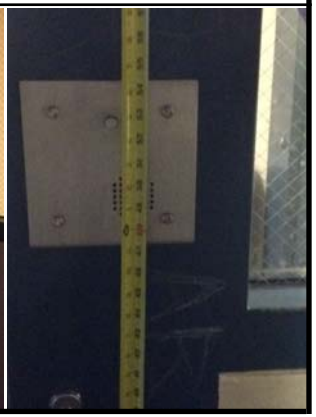

751	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	2nd
Room:	Cell - C1
Location:	Shower
Cost:	See *13
Duration:	See *13

752	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - C1
Location:	Shower
Cost:	See *13
Duration:	See *13

753	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	2nd
Room:	Cell - C1
Location:	Shower
Cost:	See *13
Duration:	See *13

754	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	2nd
Room:	Cell - C1
Location:	Shower
Cost:	See *13
Duration:	See *13

755	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	C1 and C2
Location:	Vestibule
Cost:	3000
Duration:	16 hrs

756	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Faucet controls require tight grasping, pinching or twisting to operate	Remove and replace faucet per current standards

ADA Reference:	
606.4	
CBC Reference:	
11B-606.4	
Floor:	2nd
Room:	c1 and c2
Location:	
Cost:	200
Duration:	1 hr

757	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	2nd
Room:	Corridor
Location:	
Cost:	See *4
Duration:	See *4

758	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Corridor
Location:	Janitor
Cost:	See *1
Duration:	See *1

759	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	X-Ray
Location:	
Cost:	200
Duration:	2 hrs

760	Main Annex Jail	**Priority:**	4
Category	Sinks (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate piping as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	2nd
Room:	X-Ray
Location:	
Cost:	50
Duration:	.25 hrs

761	Main Annex Jail	Priority:	4
Category	Sinks (ADULT)		

Issue	Recommendation
Height of rim or counter measured over 34" AFF	Reset sink/or provide maximum 34" AFF counter

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	2nd
Room:	X-Ray
Location:	
Cost:	1000
Duration:	8 hrs

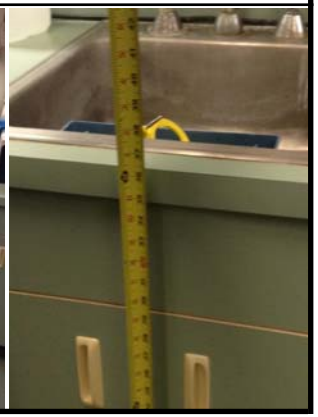

762	Main Annex Jail	Priority:	2
Category	Reach Range		

Issue	Recommendation
Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is between 10"-24" & 34" max height	Provide required reach range

ADA Reference:	
308.3.2	
CBC Reference:	
11B-308.3.2	
Floor:	2nd
Room:	X-Ray
Location:	
Cost:	50
Duration:	.5 hrs

763	Main Annex Jail	Priority:	1
Category	Landings/Thresholds		

Issue	Recommendation
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	X-Ray
Location:	
Cost:	200
Duration:	2 hrs

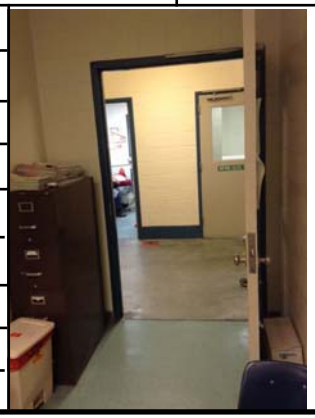

764	Main Annex Jail	Priority:	1
Category	Doors / Gates		

Issue	Recommendation
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	2nd
Room:	X-Ray
Location:	
Cost:	500
Duration:	1 hr

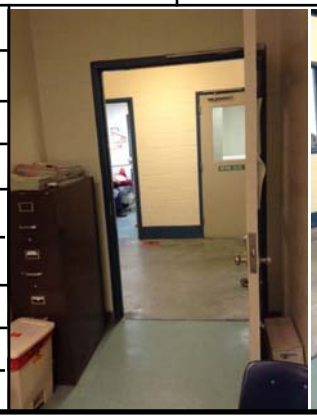

765	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	X-Ray
Location:	
Cost:	See *1
Duration:	See *1

766	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	X-Ray
Location:	
Cost:	See *6
Duration:	See *6

767	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Holding Cell
Location:	
Cost:	300
Duration:	1.5

768	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	2nd
Room:	Holding Cell
Location:	
Cost:	300
Duration:	1.5

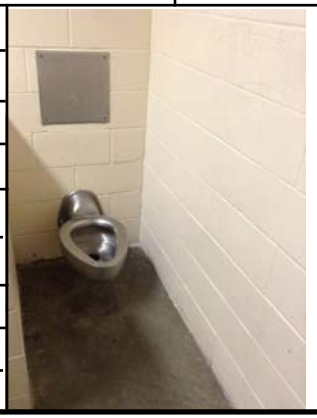

769	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Holding Cell
Location:	
Cost:	2000
Duration:	16 hrs

770	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Holding Cell
Location:	
Cost:	2000
Duration:	16 hrs

771	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Holding Cell
Location:	
Cost:	800
Duration:	4 hrs

772	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Holding Cell
Location:	
Cost:	5000
Duration:	40 hrs

773	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Holding Cell
Location:	
Cost:	3000
Duration:	16 hrs

774	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Holding Cell
Location:	
Cost:	1000
Duration:	8 hrs

775	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Exam room
Location:	
Cost:	See *1
Duration:	See *1

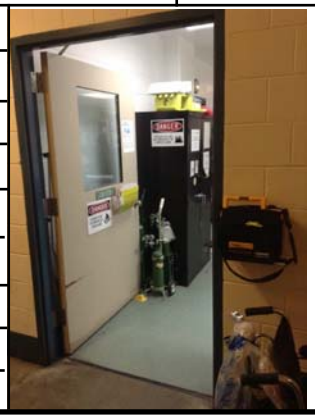

776	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	2nd
Room:	Exam room
Location:	
Cost:	500
Duration:	1 hr

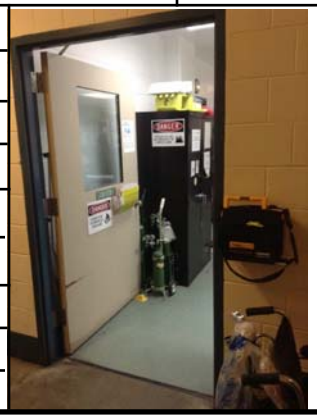

777	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide assistance placard

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Exam room
Location:	
Cost:	200
Duration:	2 hrs

778	Main Annex Jail	**Priority:**	4

Category	Sinks (ADULT)

Issue	**Recommendation**
Height of rim or counter measured over 34" AFF	Reset sink/or provide maximum 34" AFF counter

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	2nd
Room:	Exam room
Location:	
Cost:	1000
Duration:	8 hrs

779	Main Annex Jail	**Priority:**	4

Category	Sinks (GENERAL)

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate piping as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	2nd
Room:	Exam room
Location:	
Cost:	50
Duration:	.25 hrs

780	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is between 10"-24" & 34" max height	Provide required reach range

ADA Reference:	
308.3.2	
CBC Reference:	
11B-308.3.2	
Floor:	2nd
Room:	Exam room
Location:	
Cost:	50
Duration:	.5 hrs

781	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	2nd
Room:	Records
Location:	
Cost:	500
Duration:	1 hr

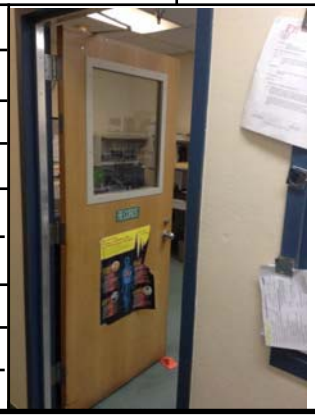

782	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Records
Location:	
Cost:	See *1
Duration:	See *1

783	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Records
Location:	
Cost:	200
Duration:	2 hrs

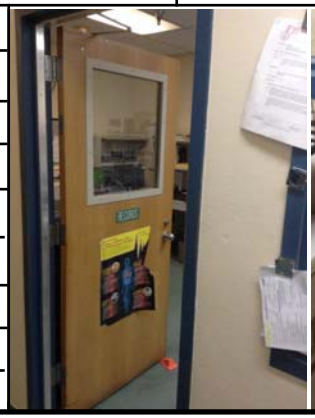

784	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, front approach)	Provide minimum 12" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Records
Location:	
Cost:	200
Duration:	2 hrs

785	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	2nd
Room:	Records
Location:	
Cost:	500
Duration:	1 hr

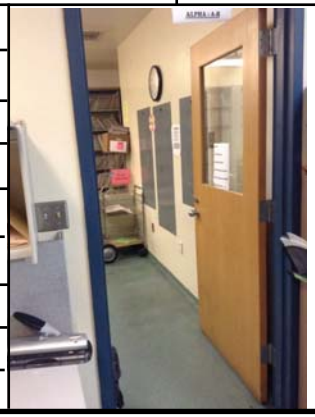

786	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Records
Location:	
Cost:	200
Duration:	2 hrs

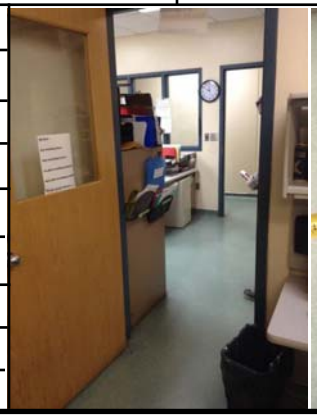

787	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Laboratory
Location:	
Cost:	See *1
Duration:	See *1

788	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	2nd
Room:	Laboratory
Location:	
Cost:	500
Duration:	1 hr

789	Main Annex Jail	**Priority:**	4
Category	Sinks (ADULT)		

Issue	**Recommendation**
Height of rim or counter measured over 34" AFF	Reset sink/or provide maximum 34" AFF counter

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	2nd
Room:	Laboratory
Location:	
Cost:	1000
Duration:	8 hrs

790	Main Annex Jail	**Priority:**	4
Category	Sinks (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate piping as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	2nd
Room:	Laboratory
Location:	
Cost:	50
Duration:	.25 hrs

791	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	2nd
Room:	Laboratory
Location:	
Cost:	500
Duration:	1 hr

792	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Laboratory
Location:	
Cost:	200
Duration:	2 hrs

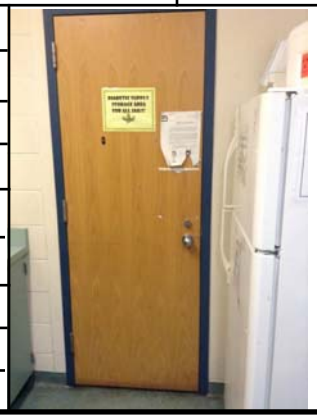

793	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	2nd
Room:	Laboratory
Location:	
Cost:	6000
Duration:	18 hrs

794	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	2nd
Room:	Corridor
Location:	
Cost:	See *4
Duration:	See *4

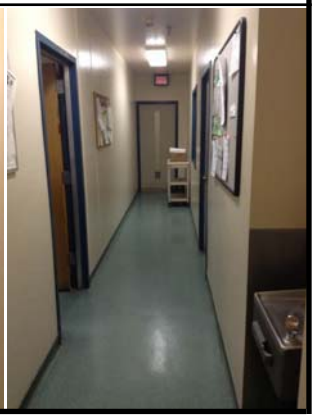

795	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
50% of all drinking fountains are not standing accessible	Install for standing persons drinking fountain(s)

ADA Reference:	
211.3	
CBC Reference:	
11B-211.3	
Floor:	2nd
Room:	Corridor
Location:	
Cost:	2000
Duration:	8 hrs

796	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
Clear floor space (30" x 48") not provided	Provide 30" X 48" clearance

ADA Reference:	
602.2	
CBC Reference:	
11B-602.2	
Floor:	2nd
Room:	Corridor
Location:	
Cost:	4000
Duration:	20 hrs

797	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Break room
Location:	
Cost:	See *1
Duration:	See *1

798	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	2nd
Room:	Break room
Location:	
Cost:	500
Duration:	1 hr

799	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Break room
Location:	
Cost:	200
Duration:	2 hrs

800	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Break room
Location:	
Cost:	See *12
Duration:	See *12

801	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	See *1
Duration:	See *1

802	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	See *2
Duration:	See *2

803	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	1000
Duration:	5 hrs

804	Main Annex Jail	**Priority:**	2
Category	Dressing/Fitting/Locker Rooms		

Issue	**Recommendation**
Door swings into room/turning space not provided	Provide turning space

ADA Reference:	
803.3	
CBC Reference:	
11B-803.3	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	6000
Duration:	18 hrs

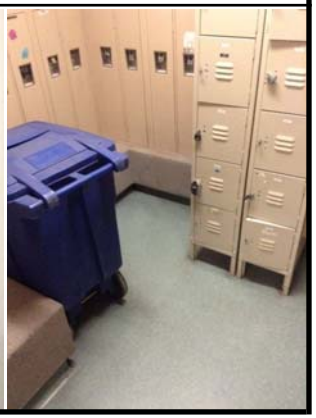

805	Main Annex Jail	**Priority:**	2
Category	Dressing/Fitting/Locker Rooms		

Issue	**Recommendation**
Turning space not provided within room	Provide turning space

ADA Reference:	
803.2	
CBC Reference:	
11B-803.2	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	4000
Duration:	20 hrs

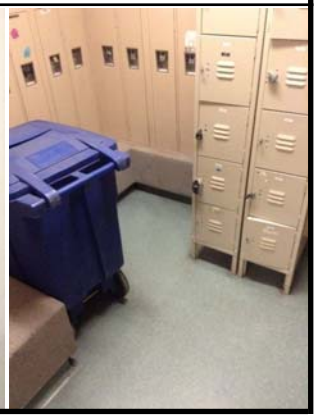

806	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	200
Duration:	2 hrs

807	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	500
Duration:	1 hr

808	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	See *1
Duration:	See *1

809	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	100
Duration:	1 hr

810	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	2000
Duration:	10 hrs

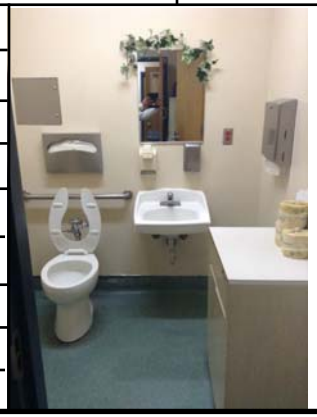

811	Main Annex Jail	**Priority:**	3
Category	Water Closet Compartments (GENERAL)		

Issue	**Recommendation**
Water closet compartment not 48" long for maneuvering for end opening door in front of toilet	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
N/A	
CBC Reference:	
11B-604.8.1.1.3	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	10000
Duration:	40 hrs

812	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:	
604.6	
CBC Reference:	
11B-604.6	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	2000
Duration:	16 hrs

813	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	2000
Duration:	16 hrs

814	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 36" minimum length	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	300
Duration:	1.5

815	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar less than 24" from front of toilet to far edge	Adjust as required and/or provide new bar per current standards

ADA Reference:	
N/A	
CBC Reference:	
11B-604.5.1	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	300
Duration:	1.5

816	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	300
Duration:	1.5

817	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	3000
Duration:	16 hrs

818	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	50
Duration:	.25 hrs

819	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	100
Duration:	1 hr

820	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	50
Duration:	.5 hrs

821	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	50
Duration:	.5 hrs

822	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	2000
Duration:	10 hrs

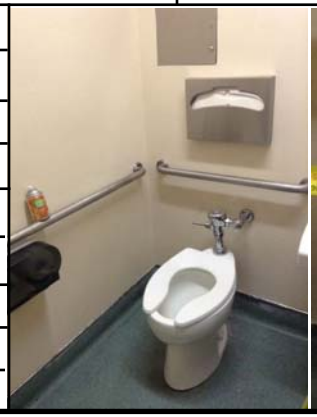

823	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Break room
Location:	Men -
Cost:	50
Duration:	.5 hrs

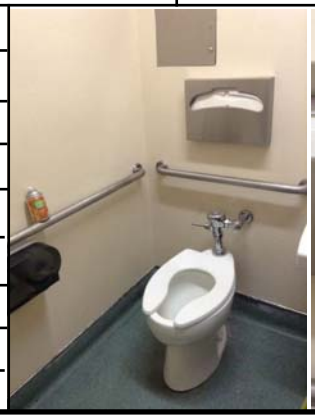

824	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	See *1
Duration:	See *1

825	Main Annex Jail	**Priority:**	1

Category	Landings/Thresholds

Issue	**Recommendation**
Level area in direction of door swing (pull side) not 60" minimum length/maneuvering clearance	Provide required clearance area

ADA Reference:
404.2.4.1
CBC Reference:
11B-404.2.4.1

Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	300
Duration:	3 hrs

826	Main Annex Jail	**Priority:**	1

Category	Corridors/Hallways

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:
403.5.1
CBC Reference:
11B-403.5.1

Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	200
Duration:	2 hrs

827	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:
703.3
CBC Reference:
11B-703.3

Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	See *1
Duration:	See *1

828	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:
404.2.7
CBC Reference:
11B-404.2.7

Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	500
Duration:	1 hr

829	Main Annex Jail	**Priority:**	1

Category	Landings/Thresholds

Issue	**Recommendation**
Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, front approach)	Provide minimum 12" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	200
Duration:	2 hrs

830	Main Annex Jail	**Priority:**	3

Category	Water Closets (ADULT)

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	2000
Duration:	16 hrs

831	Main Annex Jail	**Priority:**	3

Category	Water Closets (GENERAL)

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	2000
Duration:	10 hrs

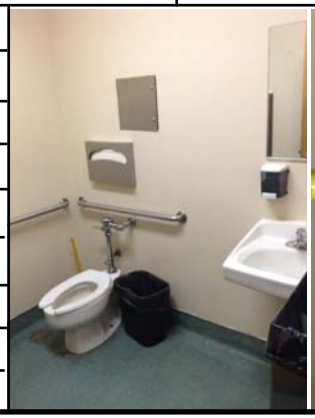

832	Main Annex Jail	**Priority:**	3

Category	Accessories

Issue	**Recommendation**
Toilet paper dispenser located over 9" from edge of toilet	Relocate TPD with 9" maximum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	50
Duration:	.5 hrs

833	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:	
604.6	
CBC Reference:	
11B-604.6	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	2000
Duration:	16 hrs

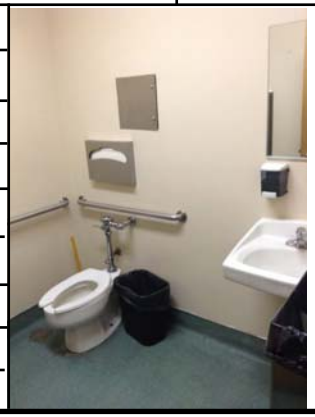

834	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	300
Duration:	1.5

835	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	300
Duration:	1.5

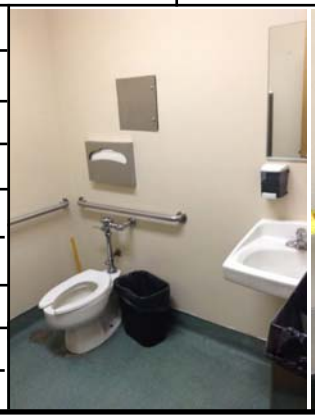

836	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Faucet controls require tight grasping, pinching or twisting to operate	Remove and replace faucet per current standards

ADA Reference:	
606.4	
CBC Reference:	
11B-606.4	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	200
Duration:	1 hr

837	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	1000
Duration:	8 hrs

838	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	100
Duration:	1 hr

839	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	50
Duration:	.5 hrs

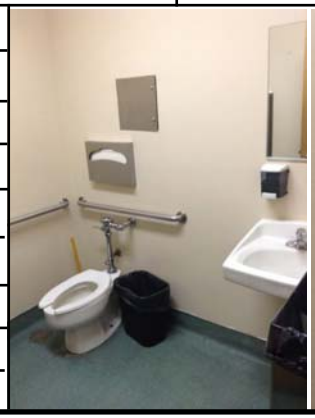

840	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	50
Duration:	.5 hrs

841	Main Annex Jail	**Priority:**	3

Category	Accessories

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	50
Duration:	.5 hrs

842	Main Annex Jail	**Priority:**	2

Category	Operable parts

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	500
Duration:	1 hr

843	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Break room
Location:	Women-
Cost:	See *2
Duration:	See *2

844	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	To Stairwell
Location:	Southwest
Cost:	See *6
Duration:	See *6

845	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, front approach)	Provide minimum 12" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	To Stairwell
Location:	Southwest
Cost:	6000
Duration:	20 hrs

846	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	To Stairwell
Location:	Southwest
Cost:	See *6
Duration:	See *6

847	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	To Stairwell
Location:	Southwest
Cost:	See *1
Duration:	See *1

848	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	To Stairwell
Location:	Southwest
Cost:	See *1
Duration:	See *1

849	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Briefing room
Location:	
Cost:	See *2
Duration:	See *2

850	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Briefing room
Location:	
Cost:	See *1
Duration:	See *1

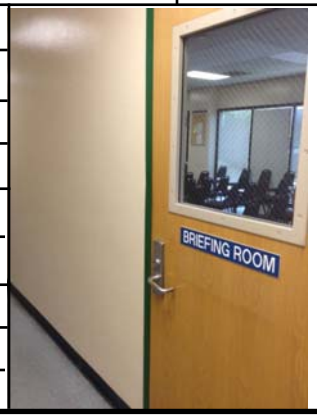

851	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Briefing room
Location:	Patio
Cost:	See *2
Duration:	See *2

852	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	2nd
Room:	Briefing room
Location:	Patio
Cost:	5000
Duration:	40 hrs

853	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Landing over 1/2" lower than top of threshold at doorway	Remove and replace affected concrete landing for compliance

ADA Reference:	
404.2.5	
CBC Reference:	
11B-404.2.5	
Floor:	2nd
Room:	Briefing room
Location:	Patio
Cost:	800
Duration:	4 hrs

854	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Briefing room
Location:	
Cost:	See *2
Duration:	See *2

855	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Briefing room
Location:	
Cost:	See *2
Duration:	See *2

856	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Briefing room
Location:	
Cost:	See *2
Duration:	See *2

857	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	2nd
Room:	Briefing room
Location:	
Cost:	See *1
Duration:	See *1

858	Main Annex Jail	**Priority:**	1

Category	Landings/Thresholds

Issue	**Recommendation**
Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, front approach)	Provide minimum 12" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Briefing room
Location:	
Cost:	6000
Duration:	20 hrs

859	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Detention
Location:	
Cost:	See *1
Duration:	See *1

860	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	2nd
Room:	Detention
Location:	
Cost:	See *1
Duration:	See *1

861	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Detention
Location:	
Cost:	2000
Duration:	10 hrs

862	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Detention
Location:	
Cost:	2000
Duration:	10 hrs

863	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	2nd
Room:	Detention
Location:	
Cost:	See *1
Duration:	See *1

864	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Lieutenant
Location:	
Cost:	See *1
Duration:	See *1

865	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Lieutenant
Location:	
Cost:	See *2
Duration:	See *2

866	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Lieutenant
Location:	
Cost:	200
Duration:	2 hrs

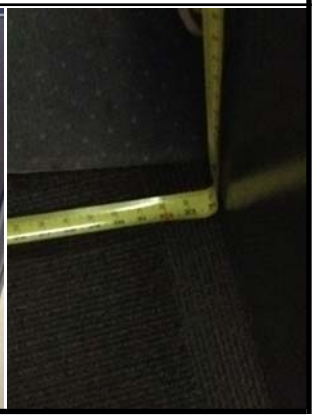

867	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Lieutenant
Location:	
Cost:	6000
Duration:	20 hrs

868	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	2nd
Room:	Lieutenant
Location:	
Cost:	See *1
Duration:	See *1

869	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Lieutenant
Location:	
Cost:	See *1
Duration:	See *1

870	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Lieutenant
Location:	
Cost:	See *1
Duration:	See *1

871	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Lieutenant
Location:	
Cost:	See *2
Duration:	See *2

872	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Lieutenant
Location:	
Cost:	6000
Duration:	20 hrs

873	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Distribution
Location:	
Cost:	See *1
Duration:	See *1

874	Main Annex Jail	**Priority:**	4
Category	Sinks (ADULT)		

Issue	**Recommendation**
Height of rim or counter measured over 34" AFF	Reset sink/or provide maximum 34" AFF counter

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	2nd
Room:	Distribution
Location:	
Cost:	1000
Duration:	8 hrs

875	Main Annex Jail	**Priority:**	4
Category	Sinks (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate piping as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	2nd
Room:	Distribution
Location:	
Cost:	50
Duration:	.25 hrs

876	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is between 10"-24" & 34" max height	Provide required reach range

ADA Reference:	
308.3.2	
CBC Reference:	
11B-308.3.2	
Floor:	2nd
Room:	Distribution
Location:	
Cost:	50
Duration:	.5 hrs

877	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is between 10"-24" & 34" max height	Provide required reach range

ADA Reference:	
308.3.2	
CBC Reference:	
11B-308.3.2	
Floor:	2nd
Room:	Distribution
Location:	
Cost:	50
Duration:	.5 hrs

878	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	2nd
Room:	Distribution
Location:	
Cost:	6000
Duration:	18 hrs

879	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, front approach)	Provide minimum 12" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Distribution
Location:	
Cost:	200
Duration:	2 hrs

880	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	2nd
Room:	Administration
Location:	
Cost:	See *1
Duration:	See *1

881	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Administration
Location:	
Cost:	See *1
Duration:	See *1

882	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Administration
Location:	
Cost:	See *2
Duration:	See *2

883	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	2nd
Room:	Administration
Location:	
Cost:	200
Duration:	2 hrs

884	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Administration
Location:	
Cost:	200
Duration:	2 hrs

885	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Toilet door sign not contrasting colors	Remove and replace sign per current standards

ADA Reference:	
703.5.1	
CBC Reference:	
11B-703.5.1	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	See *1
Duration:	See *1

886	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	See *1
Duration:	See *1

887	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	300
Duration:	1.5

888	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	300
Duration:	1.5

889	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	50
Duration:	.5 hrs

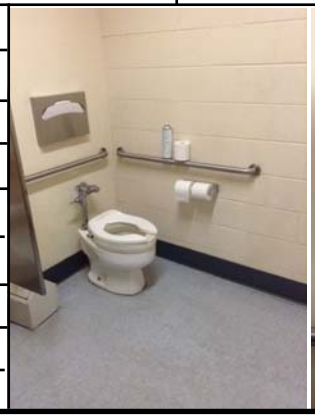

890	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser not located min. 7" from edge of toilet	Relocate TPD with 7" minimum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	50
Duration:	.5 hrs

891	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	2000
Duration:	10 hrs

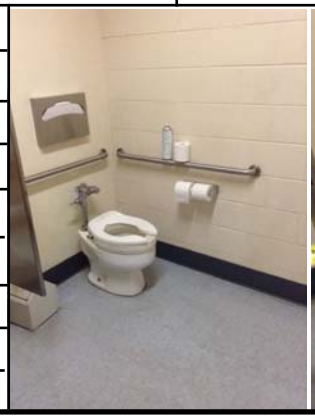

892	Main Annex Jail	**Priority:**	3
Category	Urinals		

Issue	**Recommendation**
Clear floor space in front of urinal not provided	Provide 30" X 48" clearance

ADA Reference:	
605.3	
CBC Reference:	
11B-605.3	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	3000
Duration:	20 hrs

893	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	50
Duration:	.25 hrs

894	Main Annex Jail	**Priority:**	2
Category	Detention Facility Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	1000
Duration:	8 hrs

895	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	100
Duration:	1 hr

896	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	50
Duration:	.5 hrs

897	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	50
Duration:	.5 hrs

898	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	500
Duration:	1 hr

899	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Staff Restroom
Location:	Unisex
Cost:	200
Duration:	2 hrs

900	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	See *1
Duration:	See *1

901	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	See *2
Duration:	See *2

902	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:	
604.6	
CBC Reference:	
11B-604.6	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	2000
Duration:	16 hrs

903	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	300
Duration:	1.5

904	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	300
Duration:	1.5

905	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser not located min. 7" from edge of toilet	Relocate TPD with 7" minimum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

906	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

907	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.25 hrs

908	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	100
Duration:	1 hr

909	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

910	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	1000
Duration:	8 hrs

911	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

912	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	200
Duration:	2 hrs

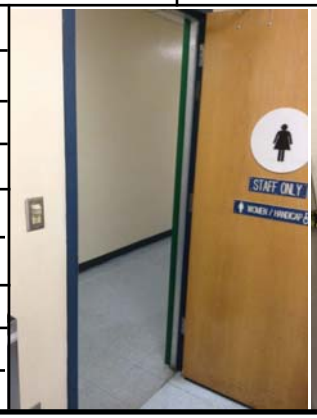

913	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	2nd
Room:	Conference
Location:	
Cost:	See *1
Duration:	See *1

914	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Conference
Location:	
Cost:	See *1
Duration:	See *1

915	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Conference
Location:	
Cost:	See *2
Duration:	See *2

916	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Conference
Location:	
Cost:	See *2
Duration:	See *2

917	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Conference
Location:	
Cost:	See *1
Duration:	See *1

918	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Staff Restroom
Location:	
Cost:	See *1
Duration:	See *1

919	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	See *2
Duration:	See *2

920	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	See *1
Duration:	See *1

921	Main Annex Jail	**Priority:**	3
Category	Urinals		

Issue	**Recommendation**
Urinal rim measured over 17" AFF	Adjust as required

ADA Reference:	
605.2	
CBC Reference:	
11B-605.2	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	1000
Duration:	8 hrs

922	Main Annex Jail	**Priority:**	3
Category	Urinals		

Issue	**Recommendation**
Flush control measured over 44" AFF	Adjust as required

ADA Reference:	
605.4	
CBC Reference:	
11B-605.4	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	2000
Duration:	10 hrs

923	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	1000
Duration:	8 hrs

924	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	100
Duration:	1 hr

925	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	50
Duration:	.5 hrs

926	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	50
Duration:	.5 hrs

927	Main Annex Jail	**Priority:**	3
Category	Water Closet Compartments (GENERAL)		

Issue	**Recommendation**
Lever, pull or push type handle on inside face near latch of door not provided	Provide required handle per current standards

ADA Reference:	
604.8.2.2	
CBC Reference:	
11B-604.8.2.2	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	500
Duration:	1 hr

928	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured over 19" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	2000
Duration:	16 hrs

929	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	300
Duration:	1.5

930	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	300
Duration:	1.5

931	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser not located min. 7" from edge of toilet	Relocate TPD with 7" minimum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	2nd
Room:	Staff Restroom
Location:	Men
Cost:	50
Duration:	.5 hrs

932	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	See *1
Duration:	See *1

933	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	See *1
Duration:	See *1

934	Main Annex Jail	**Priority:**	1

Category	Landings/Thresholds

Issue	**Recommendation**
Level area in direction of door swing (pull side) not 60" minimum length/maneuvering clearance	Provide required clearance area

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	6000
Duration:	16 hrs

935	Main Annex Jail	**Priority:**	3

Category	Lavatories (GENERAL)

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.25 hrs

936	Main Annex Jail	**Priority:**	3

Category	Accessories

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

937	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

938	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Lavatory not 18" minimum to centerline from side wall or partition	Relocate Lavatory as required; modification maybe required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.6	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	1000
Duration:	8 hrs

939	Main Annex Jail	**Priority:**	3
Category	Water Closet Compartments (GENERAL)		

Issue	**Recommendation**
Lever, pull or push type handle on inside face near latch of door not provided	Provide required handle per current standards

ADA Reference:	
604.8.2.2	
CBC Reference:	
11B-604.8.2.2	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	500
Duration:	1 hr

940	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured over 19" AFF	Remove and replace water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	2000
Duration:	16 hrs

941	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	300
Duration:	1.5

942	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	300
Duration:	1.5

943	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser not located min. 7" from edge of toilet	Relocate TPD with 7" minimum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	50
Duration:	.5 hrs

944	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	2nd
Room:	Staff Restroom
Location:	Women
Cost:	500
Duration:	1 hr

945	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Break room
Location:	
Cost:	See *1
Duration:	See *1

946	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Break room
Location:	
Cost:	See *2
Duration:	See *2

947	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	2nd
Room:	Break room
Location:	
Cost:	See *1
Duration:	See *1

948	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Break room
Location:	
Cost:	See *12
Duration:	See *12

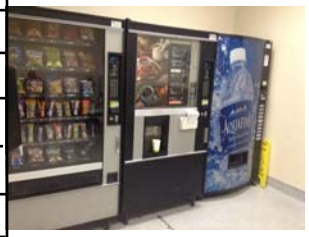

949	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Break room
Location:	
Cost:	See *12
Duration:	See *12

950	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Break room
Location:	
Cost:	See *12
Duration:	See *12

951	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF side unobstructed reach range exceeded	Provide required reach range

ADA Reference:	
308.3.1	
CBC Reference:	
11B-308.3.1	
Floor:	2nd
Room:	Break room
Location:	
Cost:	See *12
Duration:	See *12

952	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF side unobstructed reach range exceeded	Provide required reach range

ADA Reference:	
308.3.1	
CBC Reference:	
11B-308.3.1	
Floor:	2nd
Room:	Break room
Location:	
Cost:	See *12
Duration:	See *12

953	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 16 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	2nd
Room:	Break room
Location:	
Cost:	2000
Duration:	10 hrs

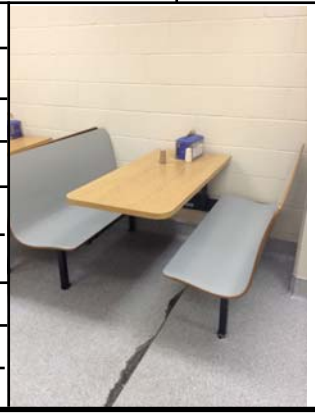

954	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Break room
Location:	
Cost:	200
Duration:	2 hrs

955	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Stairwell
Location:	Northwest
Cost:	See *6
Duration:	See *6

956	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	2nd
Room:	Stairwell
Location:	Northwest
Cost:	5000
Duration:	20 hrs

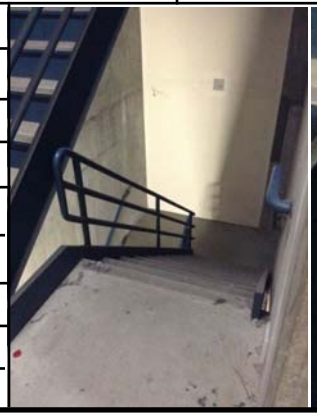

957	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	2nd
Room:	Stairwell
Location:	Northwest
Cost:	N/A
Duration:	N/A

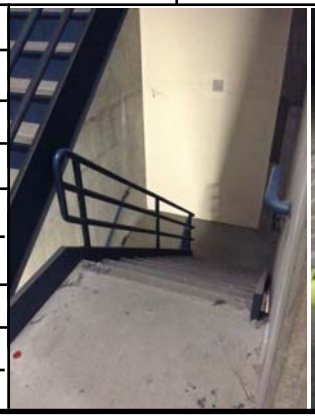

958	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at top stairs not 12" minimum of level distance (parallel with floor) beyond top nosing	Modify handrail(s) to provide required 12" extensions or replace per current standards

ADA Reference:	
505.10.2	
CBC Reference:	
11B-505.10.2	
Floor:	2nd
Room:	Stairwell
Location:	Northwest
Cost:	1500
Duration:	2 hrs

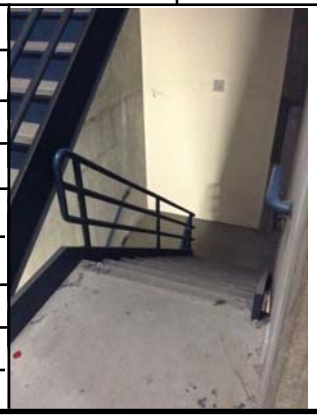

959	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign between 70" - 120" AFF (to bottom) not 2" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	2nd
Room:	Conference
Location:	
Cost:	See *1
Duration:	See *1

960	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Conference
Location:	
Cost:	See *2
Duration:	See *2

961	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Conference
Location:	
Cost:	200
Duration:	2 hrs

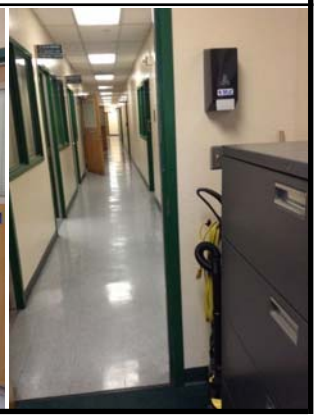

962	Main Annex Jail	**Priority:**	4
Category	Sinks (ADULT)		

Issue	**Recommendation**
Height of rim or counter measured over 34" AFF	Reset sink/or provide maximum 34" AFF counter

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	2nd
Room:	Dental
Location:	
Cost:	1000
Duration:	8 hrs

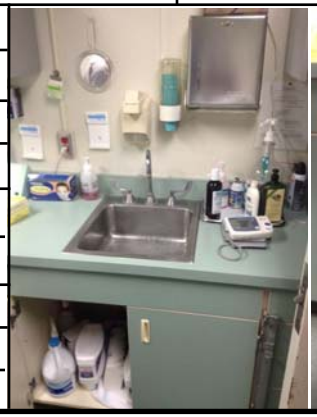

963	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Dental
Location:	
Cost:	50
Duration:	.5 hrs

964	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth) Measured 55"	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Dental
Location:	
Cost:	50
Duration:	.5 hrs

965	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth) Measured 55"	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	2nd
Room:	Dental
Location:	
Cost:	50
Duration:	.5 hrs

966	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 18" maneuvering clearance on latch side (pull side, front approach) of interior door not provided	Provide minimum 18" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Dental
Location:	
Cost:	200
Duration:	2 hrs

967	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	2nd
Room:	Dental
Location:	
Cost:	See *2
Duration:	See *2

968	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Minimum 12" maneuvering clearance on latch side of interior door not provided (push side, front approach)	Provide minimum 12" maneuvering clearance

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	2nd
Room:	Dental
Location:	
Cost:	6000
Duration:	20 hrs

969	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	2nd
Room:	Dental
Location:	
Cost:	See *1
Duration:	See *1

970	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	3rd
Room:	Stairwell
Location:	Northwest
Cost:	5000
Duration:	20 hrs

971	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Stairwell
Location:	Northwest
Cost:	See *6
Duration:	See *6

972	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Storage
Location:	North
Cost:	See *6
Duration:	See *6

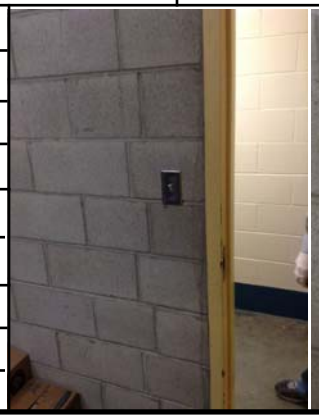

973	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	3rd
Room:	Storage
Location:	
Cost:	500
Duration:	1 hr

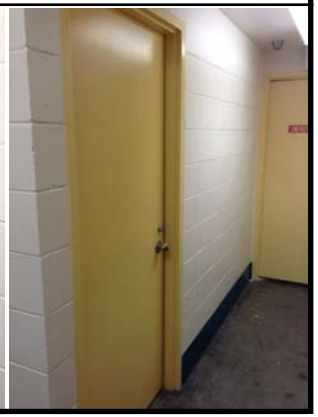

974	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	3rd
Room:	Storage
Location:	
Cost:	See *1
Duration:	See *1

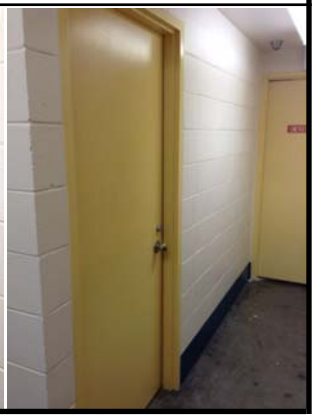

975	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	3rd
Room:	Corridor
Location:	
Cost:	See *4
Duration:	See *4

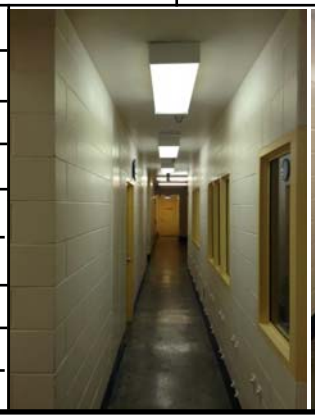

976	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	2000
Duration:	16 hrs

977	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

978	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

979	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

980	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

981	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	3000
Duration:	16 hrs

982	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

983	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

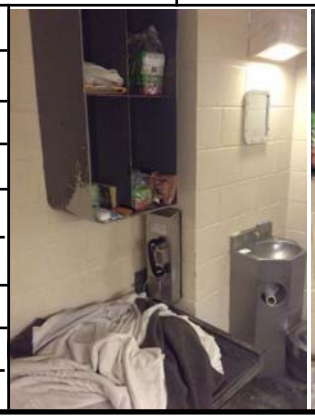

984	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

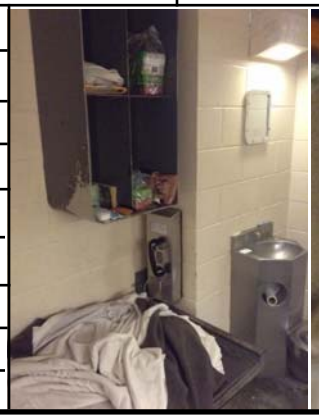

985	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

986	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

987	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

988	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	3rd
Room:	Shower
Location:	Rear Cell
Cost:	See *11
Duration:	See *11

989	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Provide concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	3rd
Room:	Shower
Location:	Rear Cell
Cost:	See *11
Duration:	See *11

990	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	3rd
Room:	Shower
Location:	Rear Cell
Cost:	See *11
Duration:	See *11

991	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	3rd
Room:	Shower
Location:	Rear Cell
Cost:	See *11
Duration:	See *11

992	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	3rd
Room:	Shower
Location:	Rear Cell
Cost:	See *11
Duration:	See *11

993	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	3rd
Room:	Shower
Location:	Rear Cell
Cost:	See *11
Duration:	See *11

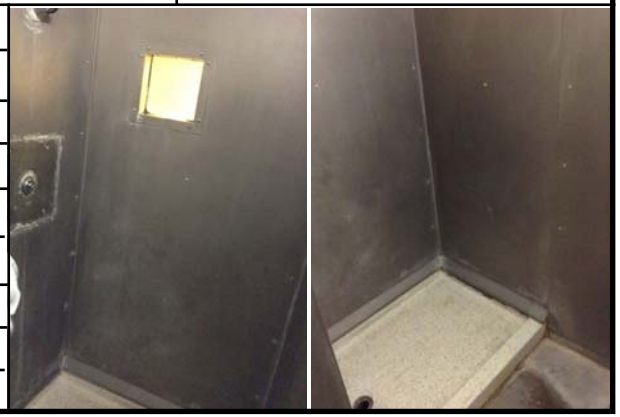

994	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Shower
Location:	Rear Cell
Cost:	See *11
Duration:	See *11

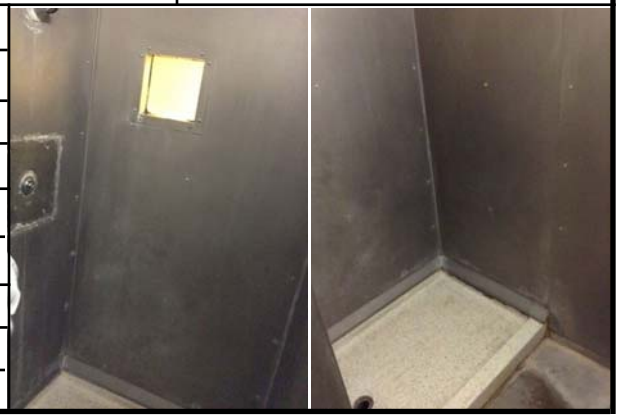

995	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	3rd
Room:	Shower
Location:	Rear Cell
Cost:	See *11
Duration:	See *11

996	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Shower
Location:	Rear Cell
Cost:	See *11
Duration:	See *11

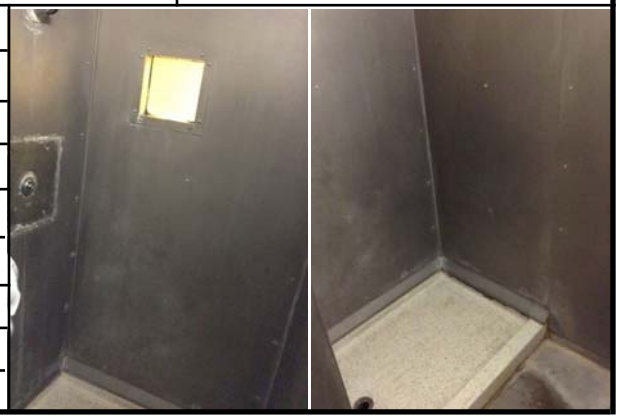

997	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	3rd
Room:	Shower
Location:	Rear Cell
Cost:	See *11
Duration:	See *11

998	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Shower
Location:	Rear Cell
Cost:	See *11
Duration:	See *11

999	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	3rd
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

1000	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	3rd
Room:	Storage
Location:	South
Cost:	500
Duration:	1 hr

1001	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	3rd
Room:	Storage
Location:	South
Cost:	See *1
Duration:	See *1

1002	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	3rd
Room:	Stairwell
Location:	Southwest
Cost:	5000
Duration:	20 hrs

1003	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	3rd
Room:	Stairwell
Location:	Southwest
Cost:	N/A
Duration:	N/A

1004	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Stairwell
Location:	Southwest
Cost:	See *6
Duration:	See *6

1005	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Stairwell
Location:	Southwest
Cost:	2000
Duration:	8 hrs

1006	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	See *2
Duration:	See *2

1007	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:	
604.6	
CBC Reference:	
11B-604.6	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	16 hrs

1008	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	16 hrs

1009	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	300
Duration:	1.5

1010	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	300
Duration:	1.5

1011	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

1012	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	500
Duration:	1 hr

1013	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

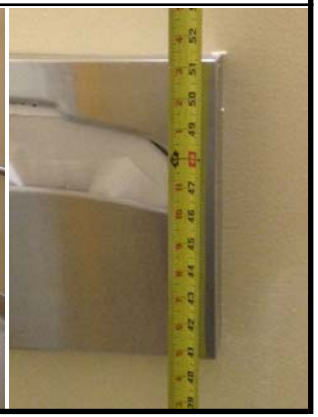

1014	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	100
Duration:	1 hr

1015	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.25 hrs

1016	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	3000
Duration:	16 hrs

1017	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

1018	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	See *6
Duration:	See *6

1019	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hr

1020	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	3rd
Room:	Staff Restroom
Location:	
Cost:	See *1
Duration:	See *1

1021	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Conference
Location:	Law Library
Cost:	See *6
Duration:	See *6

1022	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	3rd
Room:	Conference
Location:	Law Library
Cost:	See *1
Duration:	See *1

1023	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	3rd
Room:	Janitor
Location:	
Cost:	See *1
Duration:	See *1

1024	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	3rd
Room:	Janitor
Location:	
Cost:	500
Duration:	1 hr

1025	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Janitor
Location:	
Cost:	See *6
Duration:	See *6

1026	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Scullery
Location:	
Cost:	See *6
Duration:	See *6

1027	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	3rd
Room:	Scullery
Location:	
Cost:	500
Duration:	1 hr

1028	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	3rd
Room:	Scullery
Location:	
Cost:	See *1
Duration:	See *1

1029	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	3rd
Room:	Classroom
Location:	
Cost:	See *4
Duration:	See *4

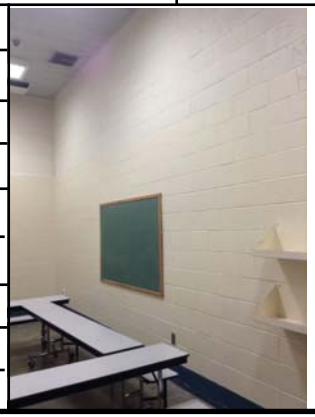

1030	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Minimum 27" high x 8" deep clearance under counter not provided	Provide minimum 27" high X 8" deep clearance under counter

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	3rd
Room:	Classroom
Location:	
Cost:	1000
Duration:	1 hr

1031	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Classroom
Location:	
Cost:	See *6
Duration:	See *6

1032	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
50% of all drinking fountains are not standing accessible	Install for standing persons drinking fountain(s)

ADA Reference:	
211.3	
CBC Reference:	
11B-211.3	
Floor:	3rd
Room:	Corridor
Location:	
Cost:	2000
Duration:	8 hrs

1033	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
Knee clearance space under drinking fountain not provided/8" deep at 27" tall and 11" deep at 9" tall and 30" wide	Reset fountain for compliance; replace if required

ADA Reference:	
602.2	
CBC Reference:	
11B-602.2	
Floor:	3rd
Room:	Corridor
Location:	
Cost:	1000
Duration:	8 hrs

1034	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	3rd
Room:	Conference
Location:	
Cost:	See *1
Duration:	See *1

1035	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	3rd
Room:	Conference
Location:	
Cost:	500
Duration:	1 hr

1036	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	3rd
Room:	Conference
Location:	
Cost:	See *2
Duration:	See *2

1037	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Conference
Location:	
Cost:	See *6
Duration:	See *6

1038	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Level area in direction of door swing (pull side) not 60" minimum length/maneuvering clearance	Provide required clearance area

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	3rd
Room:	Conference
Location:	
Cost:	1000
Duration:	5 hrs

1039	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	3rd
Room:	Infirmary
Location:	
Cost:	See *1
Duration:	See *1

1040	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	3rd
Room:	Infirmary
Location:	
Cost:	See *2
Duration:	See *2

1041	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	3rd
Room:	Infirmary
Location:	
Cost:	500
Duration:	1 hr

1042	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

1043	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

1044	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

1045	Main Annex Jail	**Priority:**	4
Category	Sinks (GENERAL)		

Issue	**Recommendation**
30" x 48" clear floor space not provided for front approach	Provide 30" X 48" clearance for front approach

ADA Reference:	
606.2	
CBC Reference:	
11B-606.2	
Floor:	3rd
Room:	Infirmary
Location:	
Cost:	4000
Duration:	20 hrs

1046	Main Annex Jail	**Priority:**	4
Category	Sinks (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate piping as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	3rd
Room:	Infirmary
Location:	
Cost:	50
Duration:	.25 hrs

1047	Main Annex Jail	**Priority:**	4
Category	Sinks (ADULT)		

Issue	**Recommendation**
Height of rim or counter measured over 34" AFF	Reset sink/or provide maximum 34" AFF counter

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	3rd
Room:	Infirmary
Location:	
Cost:	1000
Duration:	8 hrs

1048	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is between 10"-24" & 34" max height	Provide required reach range

ADA Reference:	
308.3.2	
CBC Reference:	
11B-308.3.2	
Floor:	3rd
Room:	Infirmary
Location:	
Cost:	50
Duration:	.5 hrs

1049	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is between 10"-24" & 34" max height	Provide required reach range

ADA Reference:	
308.3.2	
CBC Reference:	
11B-308.3.2	
Floor:	3rd
Room:	Infirmary
Location:	
Cost:	50
Duration:	.5 hrs

1050	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 46" AFF side obstructed reach range exceeded when obstruction depth is between 10"-24" & 34" max height	Provide required reach range

ADA Reference:	
308.3.2	
CBC Reference:	
11B-308.3.2	
Floor:	3rd
Room:	Infirmary
Location:	
Cost:	50
Duration:	.5 hrs

1051	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	3rd
Room:	Infirmary
Location:	Restroom
Cost:	6000
Duration:	18 hrs

1052	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	3rd
Room:	Infirmary
Location:	Restroom
Cost:	See *1
Duration:	See *1

1053	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Unisex toilet door sign not 1/4" thick of contrasting circle and triangle symbols with the circle circumscribing the triangle	Provide sign per current standards

ADA Reference:	
N/A	
CBC Reference:	
11B-703.7.2.6.3	
Floor:	3rd
Room:	Infirmary
Location:	Restroom
Cost:	See *1
Duration:	See *1

1054	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	3rd
Room:	Infirmary
Location:	Restroom
Cost:	2000
Duration:	16 hrs

1055	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror (not over lavatory) measured over 35" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 35" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	3rd
Room:	Infirmary
Location:	Restroom
Cost:	100
Duration:	1 hr

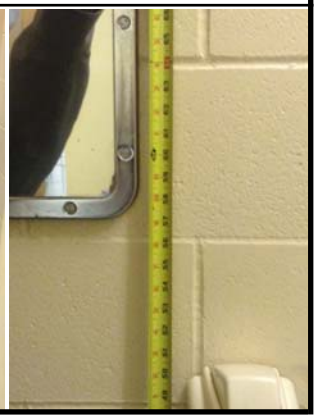

1056	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	3rd
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.5 hrs

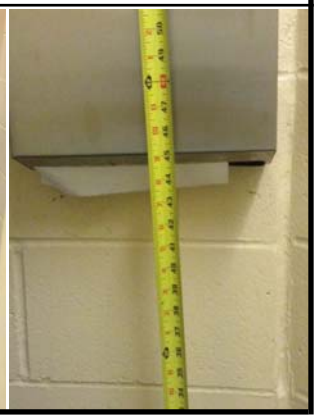

1057	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	3rd
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.25 hrs

1058	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Infirmary
Location:	Restroom
Cost:	See *6
Duration:	See *6

1059	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Infirmary
Location:	Restroom
Cost:	300
Duration:	1.5

1060	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Infirmary
Location:	Restroom
Cost:	300
Duration:	1.5

1061	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	3rd
Room:	Gym
Location:	
Cost:	See *4
Duration:	See *4

1062	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1063	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1064	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1065	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1066	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1067	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1068	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1069	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1070	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *5
Duration:	See *5

1071	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1072	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

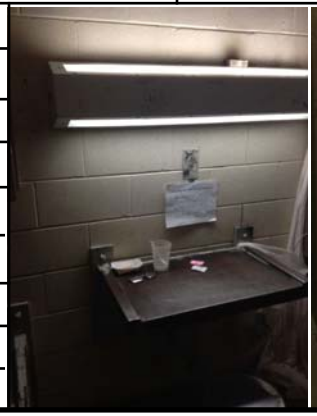

1073	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1074	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	3rd
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1075	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 32 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	3rd
Room:	Pod - A
Location:	
Cost:	See *8
Duration:	See *8

1076	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	3rd
Room:	Pod - A
Location:	
Cost:	See *8
Duration:	See *8

1077	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - A
Location:	
Cost:	500
Duration:	5 hrs

1078	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - A
Location:	
Cost:	500
Duration:	5 hrs

1079	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - A
Location:	
Cost:	500
Duration:	5 hrs

1080	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	3rd
Room:	Pod - A
Location:	
Cost:	5000
Duration:	20 hrs

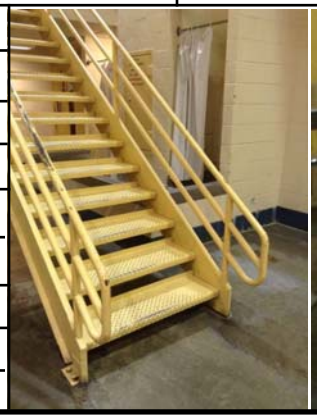

1081	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	3rd
Room:	Pod - A
Location:	
Cost:	N/A
Duration:	N/A

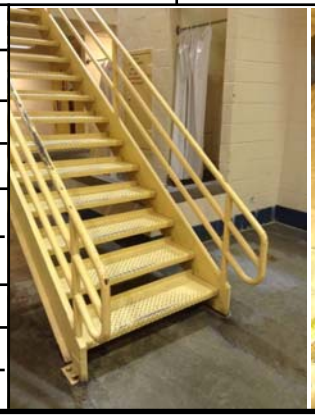

1082	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	3rd
Room:	Pod - A
Location:	
Cost:	6000
Duration:	30 hrs

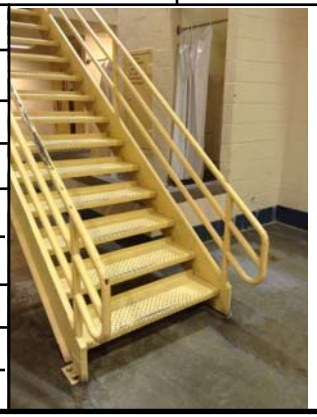

1083	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	3rd
Room:	Pod - A
Location:	
Cost:	1500
Duration:	2 hrs

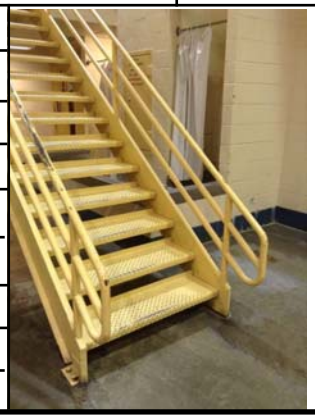

1084	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	3rd
Room:	Pod - A
Location:	
Cost:	10000
Duration:	50 hrs

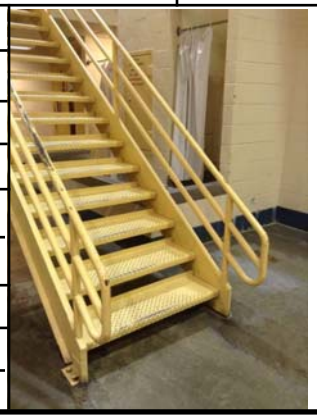

1085	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	3rd
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1086	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	3rd
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1087	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	3rd
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1088	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	3rd
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1089	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	3rd
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

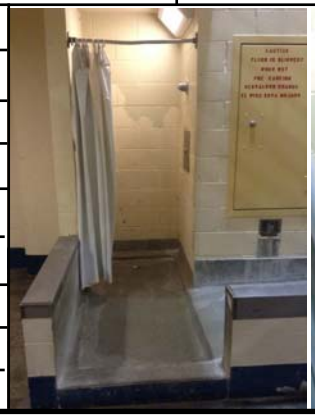

1090	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1091	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	3rd
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

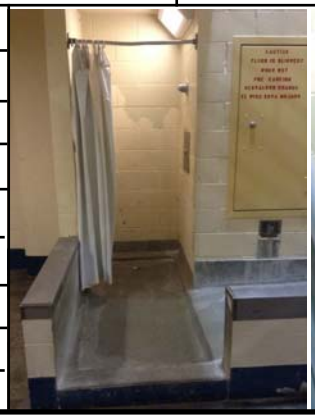

1092	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1093	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	3rd
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

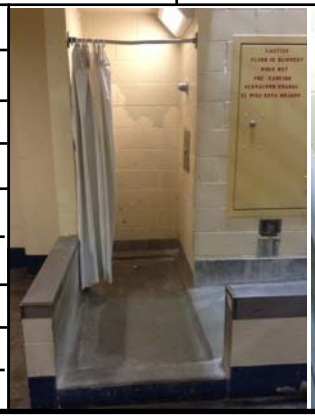

1094	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	3rd
Room:	Pod - A
Location:	
Cost:	See *8
Duration:	See *8

1095	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	See *8
Duration:	See *8

1096	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	See *8
Duration:	See *8

1097	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

1098	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

1099	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	5000
Duration:	20 hrs

1100	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	N/A
Duration:	N/A

1101	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	1500
Duration:	2 hrs

1102	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	6000
Duration:	30 hrs

1103	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	10000
Duration:	50 hrs

1104	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	See *5
Duration:	See *5

1105	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

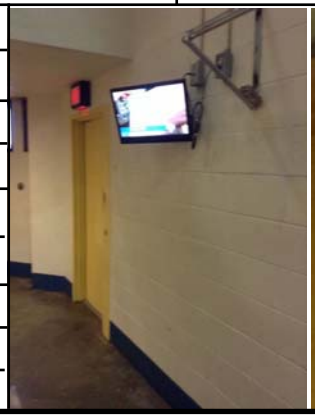

1106	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	1000
Duration:	5 hrs

1107	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	3rd
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1108	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	3rd
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1109	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1110	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	3rd
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1111	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

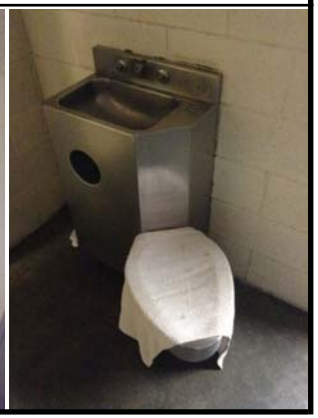

1112	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

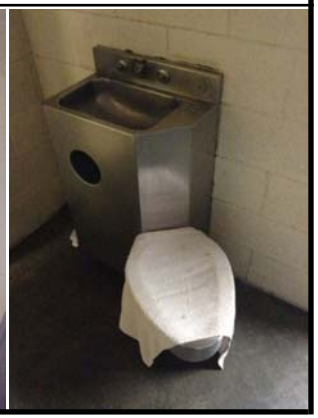

1113	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	3rd
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

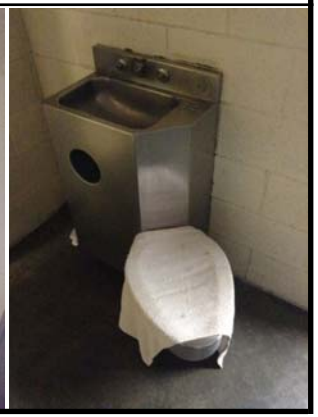

1114	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	3rd
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

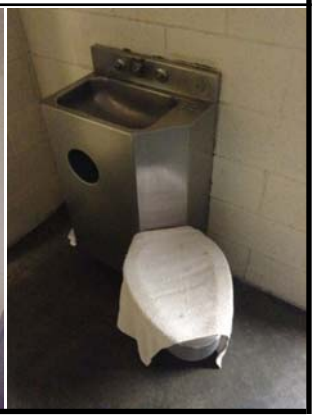

1115	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1116	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

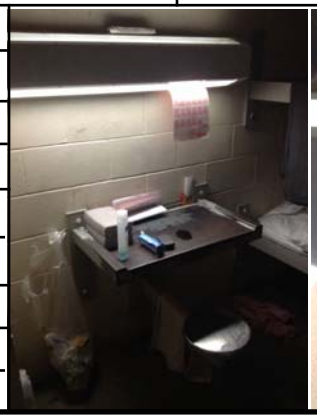
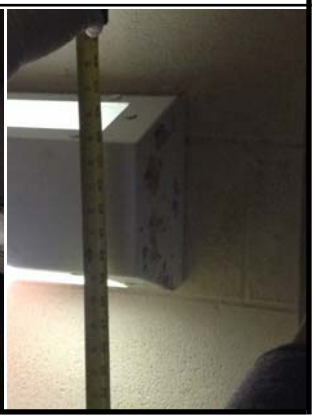

1117	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1118	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	3rd
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1119	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	3rd
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1120	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	3rd
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1121	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	3rd
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

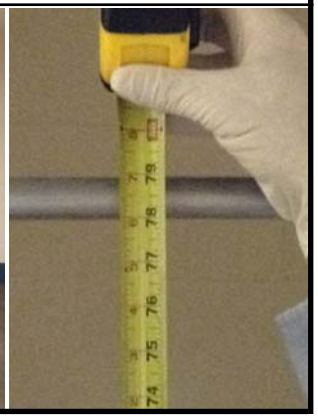

1122	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	3rd
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1123	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1124	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	3rd
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1125	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1126	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	3rd
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1127	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	3rd
Room:	Pod - B
Location:	
Cost:	See *8
Duration:	See *8

1128	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	3rd
Room:	Pod - C
Location:	
Cost:	See *8
Duration:	See *8

1129	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	3rd
Room:	Pod - C
Location:	
Cost:	See *8
Duration:	See *8

1130	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	3rd
Room:	Pod - C
Location:	
Cost:	6000
Duration:	30 hrs

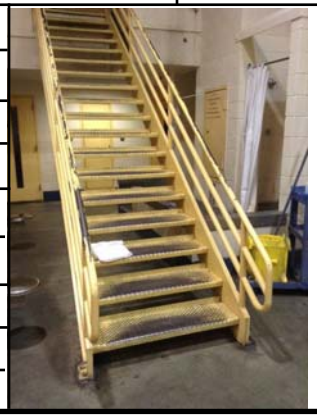

1131	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	3rd
Room:	Pod - C
Location:	
Cost:	5000
Duration:	20 hrs

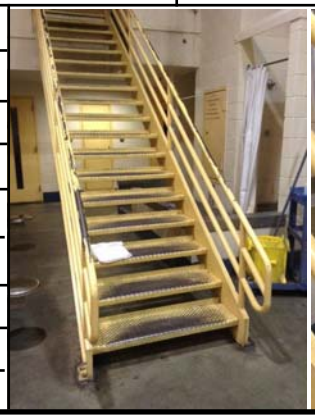

1132	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	3rd
Room:	Pod - C
Location:	
Cost:	N/A
Duration:	N/A

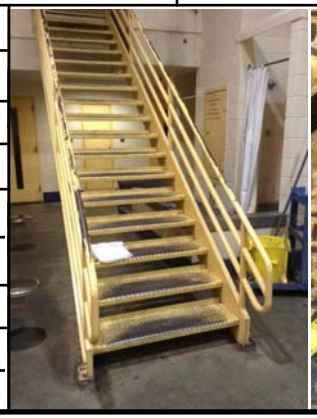

1133	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

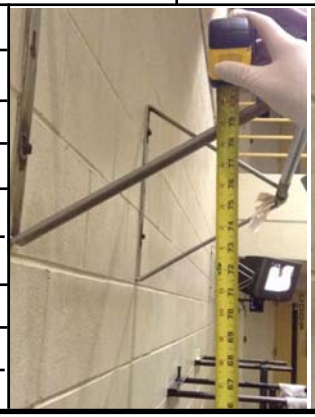

1134	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

1135	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	3rd
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

1136	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - C
Location:	
Cost:	1000
Duration:	5 hrs

1137	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	3rd
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1138	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	3rd
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1139	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1140	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	3rd
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1141	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1142	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1143	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	3rd
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1144	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	3rd
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

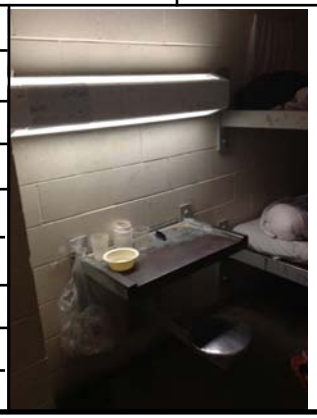

1145	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

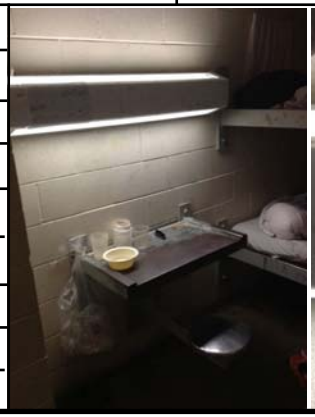

1146	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1147	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1148	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	3rd
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

1149	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	3rd
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

1150	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	3rd
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

1151	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	3rd
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

1152	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	3rd
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

1153	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

1154	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	3rd
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

1155	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

1156	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	3rd
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

1157	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - C
Location:	
Cost:	200
Duration:	2 hrs

1158	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	3rd
Room:	Pod - C
Location:	
Cost:	See *5
Duration:	See *5

1159	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	3rd
Room:	Pod - C
Location:	
Cost:	See *8
Duration:	See *8

1160	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	See *8
Duration:	See *8

1161	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	See *8
Duration:	See *8

1162	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	See *5
Duration:	See *5

1163	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	3000
Duration:	15 hrs

1164	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

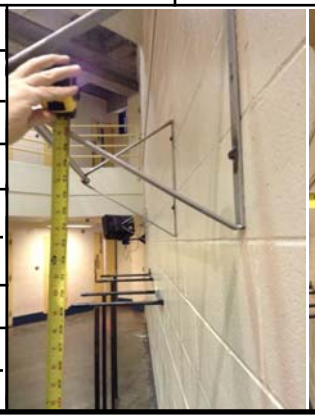

1165	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

1166	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

1167	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	1000
Duration:	5 hrs

1168	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	3rd
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

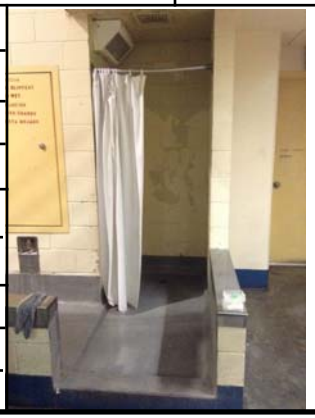

1169	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	3rd
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1170	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	3rd
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1171	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	3rd
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1172	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	3rd
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1173	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1174	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	3rd
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1175	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1176	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	3rd
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1177	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	3rd
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1178	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	3rd
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1179	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	3rd
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1180	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1181	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1182	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1183	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	3rd
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1184	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

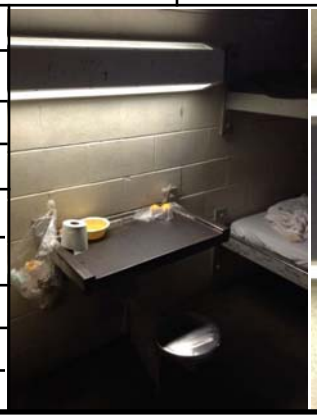

1185	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	3rd
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

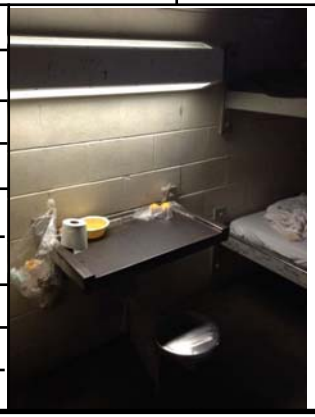

1186	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1187	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1188	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	5000
Duration:	20 hrs

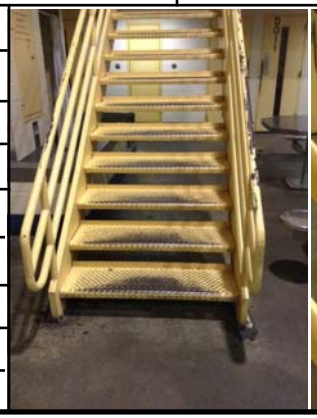

1189	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	N/A
Duration:	N/A

1190	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	6000
Duration:	30 hrs

1191	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	10000
Duration:	50 hrs

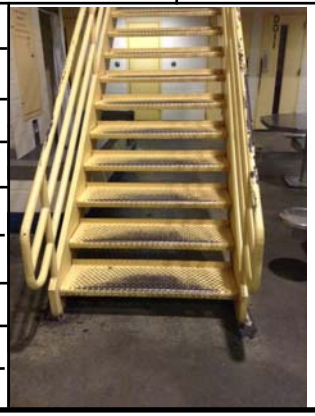

1192	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	3rd
Room:	Pod - D
Location:	
Cost:	See *8
Duration:	See *8

1193	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	See *8
Duration:	See *8

1194	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	See *8
Duration:	See *8

1195	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	200
Duration:	2 hrs

1196	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	See *5
Duration:	See *5

1197	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

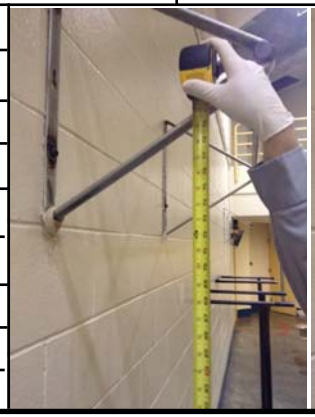

1198	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

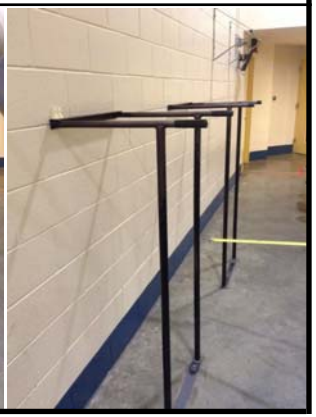

1199	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

1200	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	1000
Duration:	5 hrs

1201	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:
N/A
CBC Reference:
11B-608.9

Floor:	3rd
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1202	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:
603.4
CBC Reference:
11B-603.4

Floor:	3rd
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1203	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:
608.7
CBC Reference:
11B-608.7

Floor:	3rd
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1204	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:
N/A
CBC Reference:
11B-608.5.2

Floor:	3rd
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1205	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	3rd
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1206	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1207	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	3rd
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1208	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1209	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	3rd
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1210	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	5000
Duration:	20 hrs

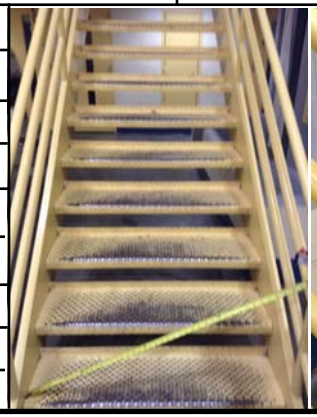

1211	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	N/A
Duration:	N/A

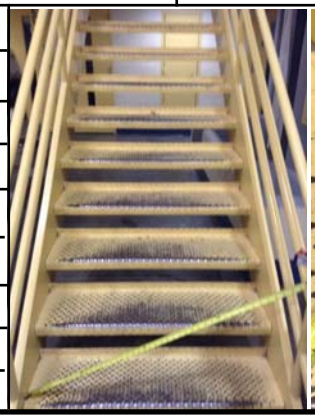

1212	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	6000
Duration:	30 hrs

1213	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	10000
Duration:	50 hrs

1214	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	3rd
Room:	Pod - E
Location:	
Cost:	See *8
Duration:	See *8

1215	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	3rd
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1216	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	3rd
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

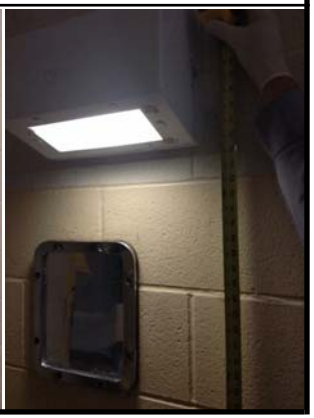

1217	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

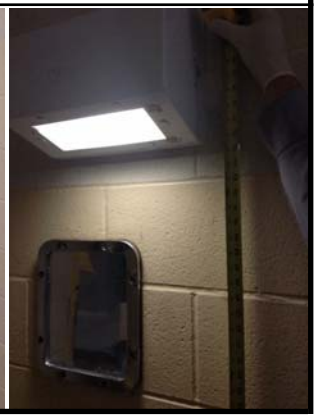

1218	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	3rd
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1219	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1220	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1221	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

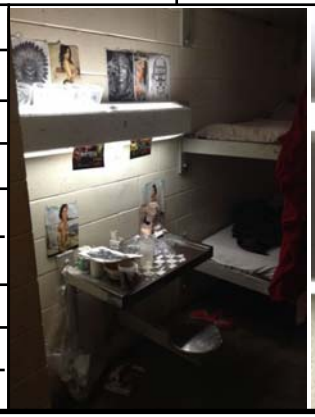

1222	Main Annex Jail	**Priority:**	2

Category	Dining/Bar Facilities

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	3rd
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

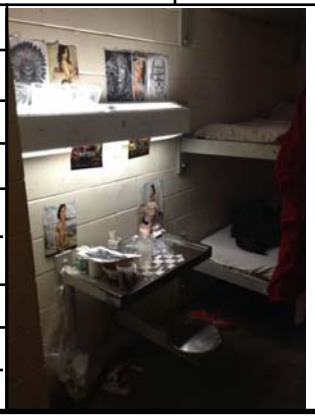

1223	Main Annex Jail	**Priority:**	1

Category	Protruding Objects

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1224	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1225	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	Recommendation
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	3rd
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1226	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	Recommendation
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	3rd
Room:	Pod - F
Location:	
Cost:	See *8
Duration:	See *8

1227	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	Recommendation
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	3rd
Room:	Pod - F
Location:	
Cost:	See *8
Duration:	See *8

1228	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	Recommendation
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	3rd
Room:	Pod - F
Location:	
Cost:	See *5
Duration:	See *5

1229	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	3rd
Room:	Pod - F
Location:	
Cost:	5000
Duration:	20 hrs

1230	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	3rd
Room:	Pod - F
Location:	
Cost:	N/A
Duration:	N/A

1231	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	3rd
Room:	Pod - F
Location:	
Cost:	6000
Duration:	30 hrs

1232	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	3rd
Room:	Pod - F
Location:	
Cost:	10000
Duration:	50 hrs

1233	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

1234	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

1235	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

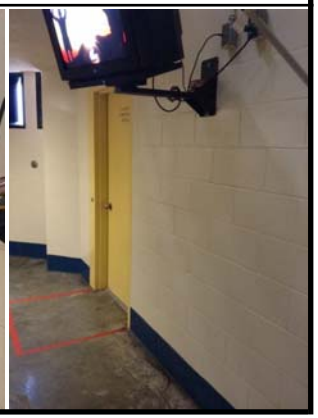

1236	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - F
Location:	
Cost:	1000
Duration:	5 hrs

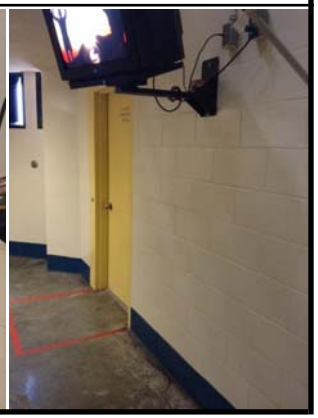

1237	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	3rd
Room:	Pod - F
Location:	
Cost:	See *8
Duration:	See *8

1238	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	3rd
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1239	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	3rd
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1240	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	3rd
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1241	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	3rd
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

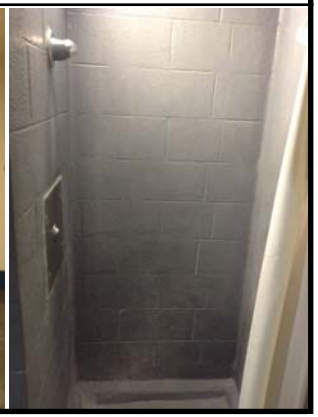

1242	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

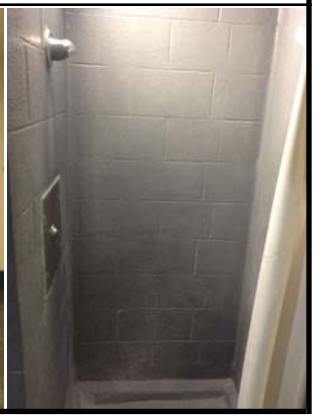

1243	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	3rd
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

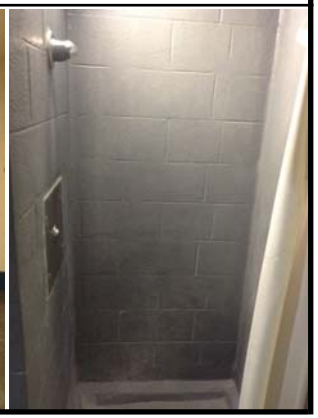

1244	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	3rd
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

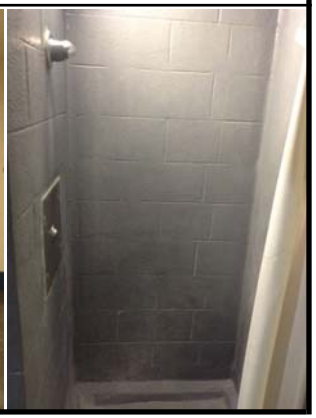

1245	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	3rd
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

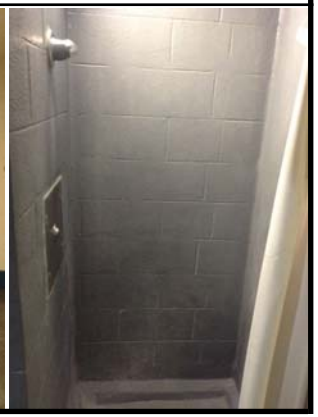

1246	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	3rd
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1247	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	3rd
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1248	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	3rd
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1249	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1250	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	3rd
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1251	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	3rd
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1252	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1253	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	3rd
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1254	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	3rd
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1255	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	3rd
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

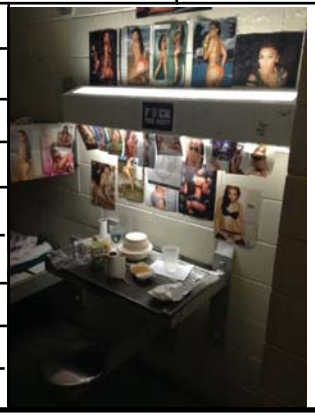

1256	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

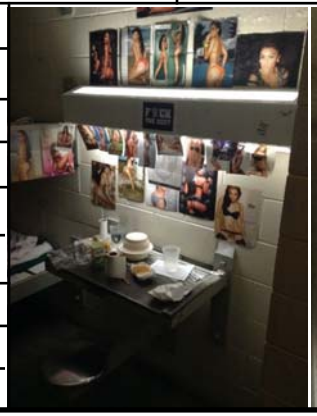

1257	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	3rd
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

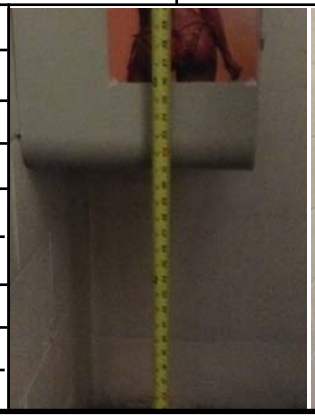

1258	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	3rd
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1259	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

1260	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	2000
Duration:	16 hrs

1261	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

1262	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

1263	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

1264	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

1265	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	3000
Duration:	16 hrs

1266	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	See *5
Duration:	See *5

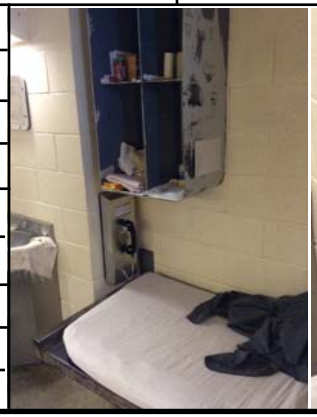

1267	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

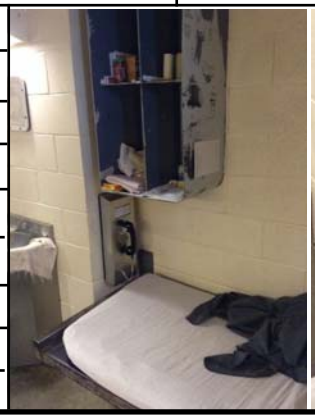

1268	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

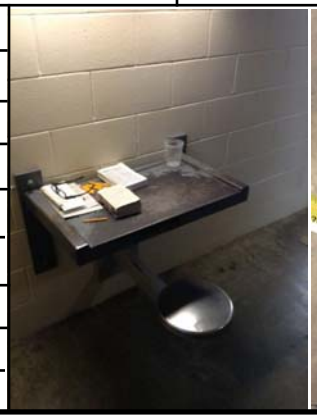

1269	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

1270	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

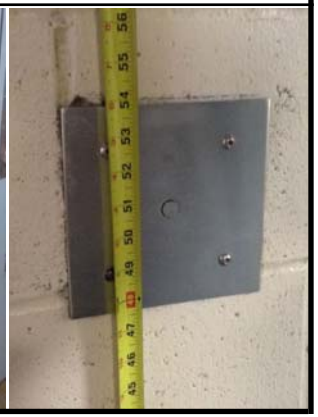

1271	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Accessible seating not dispersed within each functional dining area	Disperse accessible seating per current standards

ADA Reference:	
226.2	
CBC Reference:	
11B-226.2	
Floor:	4th
Room:	Cell FF
Location:	Rear Cell
Cost:	See *10
Duration:	See *10

1272	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	4th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1273	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Remove and replace concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	4th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1274	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	4th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1275	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	4th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1276	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	4th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1277	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	4th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1278	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1279	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	4th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1280	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1281	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	4th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1282	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1283	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	4th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1284	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	4th
Room:	Corridor
Location:	
Cost:	See *4
Duration:	See *4

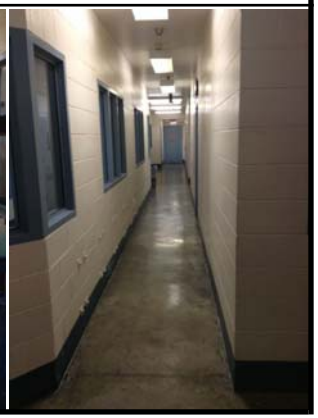

1285	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Corridor
Location:	
Cost:	2000
Duration:	8 hrs

1286	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	4th
Room:	Stairwell
Location:	Southwest
Cost:	5000
Duration:	20 hrs

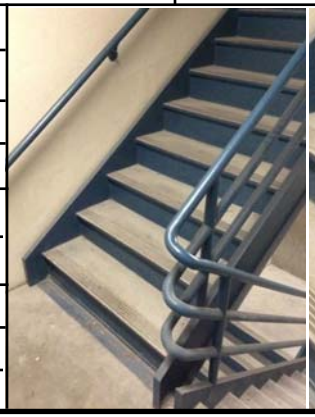

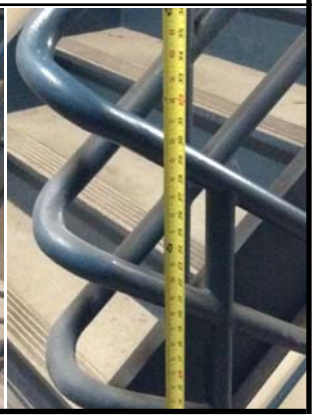

1287	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Stairwell
Location:	Southwest
Cost:	See *6
Duration:	See *6

1288	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	4th
Room:	Stairwell
Location:	Southwest
Cost:	N/A
Duration:	N/A

1289	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Corridor
Location:	
Cost:	See *6
Duration:	See *6

1290	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	4th
Room:	Corridor
Location:	
Cost:	500
Duration:	1 hr

1291	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	4th
Room:	Corridor
Location:	
Cost:	See *1
Duration:	See *1

1292	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Conference
Location:	Law Library
Cost:	See *6
Duration:	See *6

1293	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	4th
Room:	Conference
Location:	Law Library
Cost:	See *2
Duration:	See *2

1294	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	4th
Room:	Conference
Location:	Law Library
Cost:	500
Duration:	1 hr

1295	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	4th
Room:	Conference
Location:	Law Library
Cost:	See *1
Duration:	See *1

1296	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	4th
Room:	Janitor
Location:	
Cost:	See *1
Duration:	See *1

1297	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	4th
Room:	Janitor
Location:	
Cost:	500
Duration:	1 hr

1298	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Janitor
Location:	
Cost:	See *6
Duration:	See *6

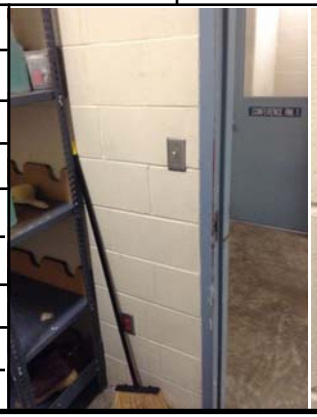

1299	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	4th
Room:	Scullery
Location:	
Cost:	See *2
Duration:	See *2

1300	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Scullery
Location:	
Cost:	See *6
Duration:	See *6

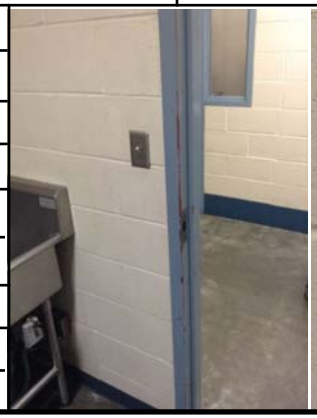

1301	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	4th
Room:	Scullery
Location:	
Cost:	500
Duration:	1 hr

1302	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	4th
Room:	Scullery
Location:	
Cost:	See *1
Duration:	See *1

1303	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Conference
Location:	
Cost:	See *6
Duration:	See *6

1304	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	4th
Room:	Gym
Location:	
Cost:	See *4
Duration:	See *4

1305	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	16 hrs

1306	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:	
604.6	
CBC Reference:	
11B-604.6	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	16 hrs

1307	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	300
Duration:	1.5

1308	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	300
Duration:	1.5

1309	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

1310	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	500
Duration:	1 hr

1311	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

1312	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser not located min. 7" from edge of toilet	Relocate TPD with 7" minimum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

1313	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	10 hrs

1314	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.25 hrs

1315	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	3000
Duration:	16 hrs

1316	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

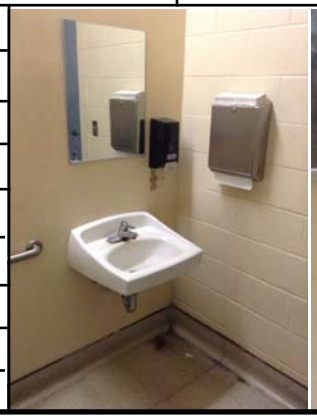

1317	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	100
Duration:	1 hr

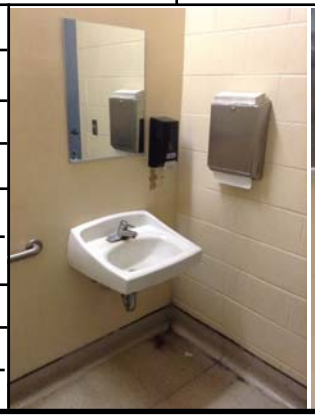

1318	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

1319	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	See *6
Duration:	See *6

1320	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hr

1321	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	See *2
Duration:	See *2

1322	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	4th
Room:	Staff Restroom
Location:	
Cost:	See *1
Duration:	See *1

1323	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	4th
Room:	Storage
Location:	North
Cost:	See *1
Duration:	See *1

1324	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	4th
Room:	Storage
Location:	North
Cost:	See *2
Duration:	See *2

1325	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Storage
Location:	North
Cost:	See *6
Duration:	See *6

1326	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	4th
Room:	Stairwell
Location:	North
Cost:	5000
Duration:	20 hrs

1327	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	4th
Room:	Stairwell
Location:	North
Cost:	N/A
Duration:	N/A

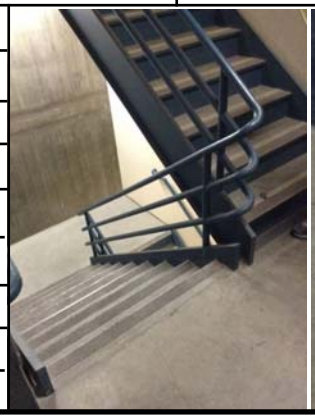

1328	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Stairwell
Location:	North
Cost:	See *6
Duration:	See *6

1329	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	4th
Room:	Conference
Location:	
Cost:	See *2
Duration:	See *2

1330	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	4th
Room:	Conference
Location:	
Cost:	500
Duration:	1 hr

1331	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Conference
Location:	
Cost:	See *6
Duration:	See *6

1332	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Level area in direction of door swing (pull side) not 60" minimum length/maneuvering clearance	Provide required clearance area

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	4th
Room:	Conference
Location:	
Cost:	1000
Duration:	5 hrs

1333	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	4th
Room:	Conference
Location:	
Cost:	See *1
Duration:	See *1

1334	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

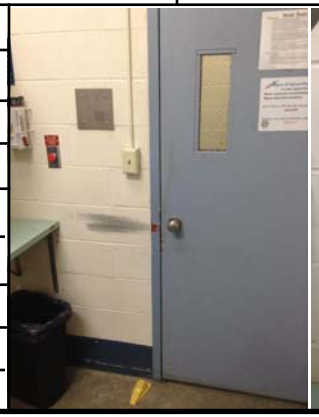

1335	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

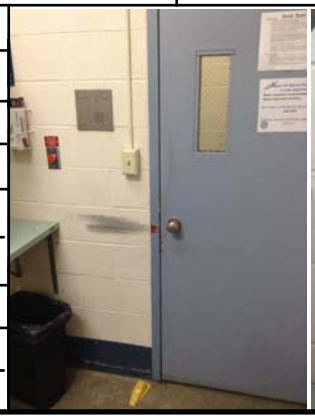

1336	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

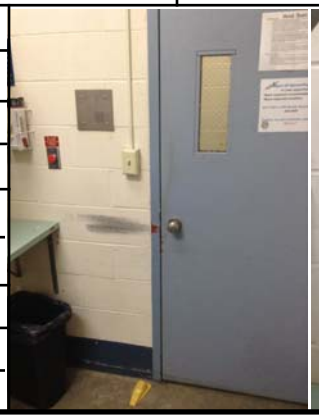

1337	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Lettering height on sign over 40"-70" AFF (to bottom) not 5/8" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	See *1
Duration:	See *1

1338	Main Annex Jail	**Priority:**	3

Category	Water Closets (ADULT)

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	4th
Room:	Infirmary
Location:	Restroom
Cost:	2000
Duration:	16 hrs

1339	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	4th
Room:	Infirmary
Location:	Restroom
Cost:	6000
Duration:	18 hrs

1340	Main Annex Jail	**Priority:**	3

Category	Water Closets (ADULT)

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	4th
Room:	Infirmary
Location:	Restroom
Cost:	2000
Duration:	16 hrs

1341	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	4th
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.25 hrs

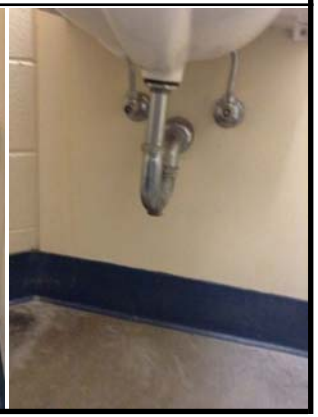

1342	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	4th
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.5 hrs

1343	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	4th
Room:	Infirmary
Location:	Restroom
Cost:	100
Duration:	1 hr

1344	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	4th
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.5 hrs

1345	Main Annex Jail	**Priority:**	4
Category	Accessible Clearance		

Issue	**Recommendation**
Required 60" diameter circle or 'T'-shaped clear floor space not provided within room	Provide required clearance

ADA Reference:	
304.3	
CBC Reference:	
11B-304.3	
Floor:	4th
Room:	Infirmary
Location:	Restroom
Cost:	10000
Duration:	50 hrs

1346	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Unisex toilet door sign not 1/4" thick of contrasting circle and triangle symbols with the circle circumscribing the triangle	Provide sign per current standards

ADA Reference:	
N/A	
CBC Reference:	
11B-703.7.2.6.3	
Floor:	4th
Room:	Infirmary
Location:	Restroom
Cost:	See *1
Duration:	See *1

1347	Main Annex Jail	**Priority:**	4
Category	Sinks (ADULT)		

Issue	**Recommendation**
Height of rim or counter measured over 34" AFF	Reset sink/or provide maximum 34" AFF counter

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	1000
Duration:	8 hrs

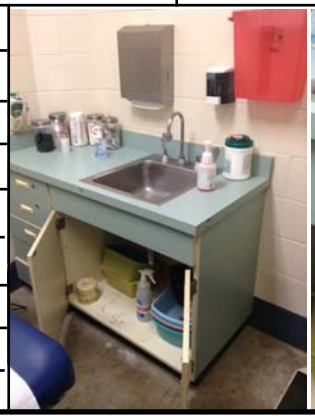

1348	Main Annex Jail	**Priority:**	4
Category	Sinks (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate piping as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	50
Duration:	.25 hrs

1349	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 44" AFF front obstructed reach range exceeded when obstruction depth is between 20"-25"	Provide required reach range

ADA Reference:	
308.2.2	
CBC Reference:	
11B-308.2.2	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	50
Duration:	.5 hrs

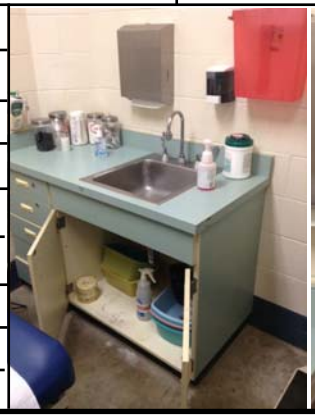

1350	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 44" AFF front obstructed reach range exceeded when obstruction depth is between 20"-25"	Provide required reach range

ADA Reference:	
308.2.2	
CBC Reference:	
11B-308.2.2	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	50
Duration:	.5 hrs

1351	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	See *2
Duration:	See *2

1352	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	500
Duration:	1 hr

1353	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	See *1
Duration:	See *1

1354	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	See *2
Duration:	See *2

1355	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

1356	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

1357	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	4th
Room:	Infirmary
Location:	
Cost:	See *1
Duration:	See *1

1358	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
Knee clearance space under drinking fountain not provided/8" deep at 27" tall and 11" deep at 9" tall and 30" wide	Reset fountain for compliance; replace if required

ADA Reference:	
602.2	
CBC Reference:	
11B-602.2	
Floor:	4th
Room:	Corridor
Location:	
Cost:	1000
Duration:	8 hrs

1359	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
50% of all drinking fountains are not standing accessible	Install for standing persons drinking fountain(s)

ADA Reference:	
211.3	
CBC Reference:	
11B-211.3	
Floor:	4th
Room:	Corridor
Location:	
Cost:	2000
Duration:	8 hrs

1360	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Minimum 27" high x 8" deep clearance under counter not provided	Provide minimum 27" high X 8" deep clearance under counter

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	4th
Room:	Classroom
Location:	
Cost:	1000
Duration:	1 hr

1361	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	4th
Room:	Classroom
Location:	
Cost:	See *4
Duration:	See *4

1362	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Classroom
Location:	
Cost:	See *6
Duration:	See *6

1363	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	4th
Room:	Pod - A
Location:	
Cost:	See *8
Duration:	See *8

1364	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	4th
Room:	Pod - A
Location:	
Cost:	See *8
Duration:	See *8

1365	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - A
Location:	
Cost:	500
Duration:	5 hrs

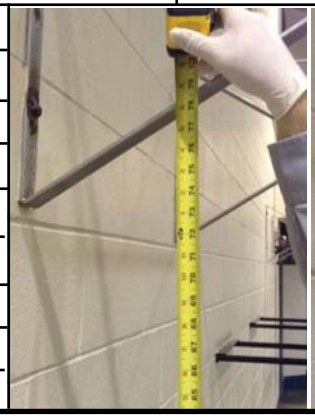

1366	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - A
Location:	
Cost:	500
Duration:	5 hrs

1367	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - A
Location:	
Cost:	500
Duration:	5 hrs

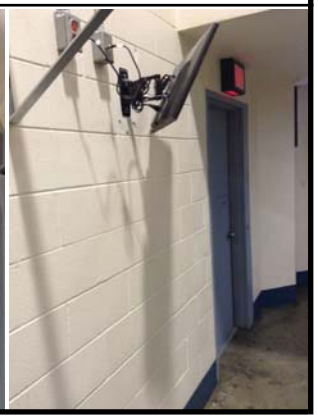

1368	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - A
Location:	
Cost:	1000
Duration:	5 hrs

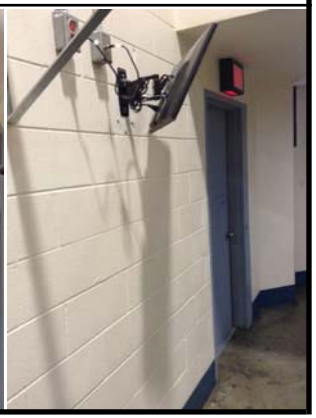

1369	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:
N/A
CBC Reference:
11B-608.9

Floor:	4th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1370	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:
608.7
CBC Reference:
11B-608.7

Floor:	4th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1371	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:
N/A
CBC Reference:
11B-608.5.2

Floor:	4th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

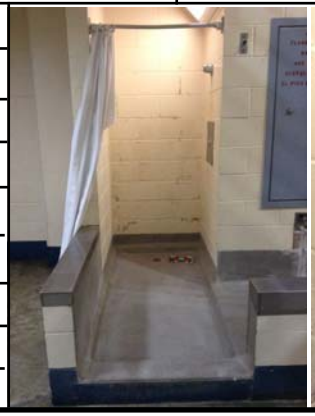

1372	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:
307.4
CBC Reference:
11B-307.4

Floor:	4th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1373	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	4th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1374	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	4th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1375	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

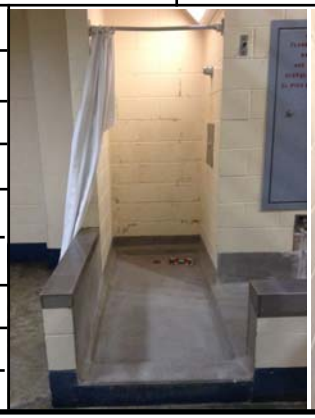

1376	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	4th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1377	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1378	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	4th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1379	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	4th
Room:	Pod - A
Location:	
Cost:	5000
Duration:	20 hrs

1380	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	4th
Room:	Pod - A
Location:	
Cost:	N/A
Duration:	N/A

1381	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	4th
Room:	Pod - A
Location:	
Cost:	6000
Duration:	30 hrs

1382	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	4th
Room:	Pod - A
Location:	
Cost:	10000
Duration:	50 hrs

1383	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	4th
Room:	Pod - A
Location:	
Cost:	See *8
Duration:	See *8

1384	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1385	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1386	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

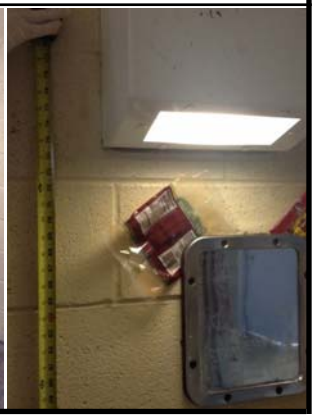

1387	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

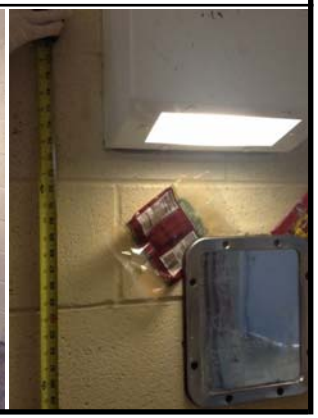

1388	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1389	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1390	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1391	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

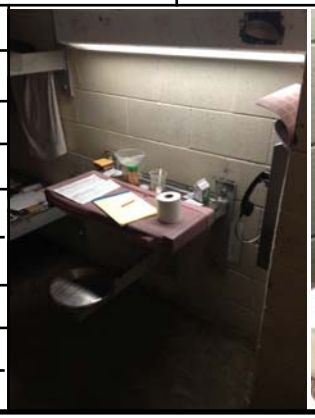

1392	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *5
Duration:	See *5

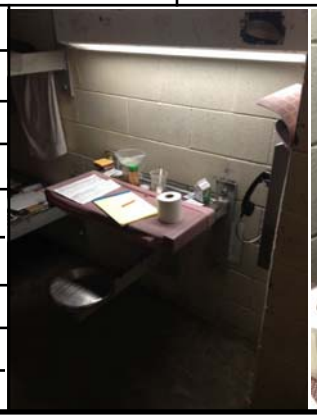

1393	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

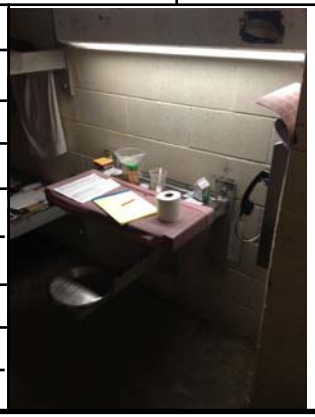

1394	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1395	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1396	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1397	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 40 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	4th
Room:	Pod - B
Location:	
Cost:	See *8
Duration:	See *8

1398	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	4th
Room:	Pod - B
Location:	
Cost:	See *8
Duration:	See *8

1399	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	4th
Room:	Pod - B
Location:	
Cost:	5000
Duration:	20 hrs

1400	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	4th
Room:	Pod - B
Location:	
Cost:	N/A
Duration:	N/A

1401	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	4th
Room:	Pod - B
Location:	
Cost:	6000
Duration:	30 hrs

1402	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	4th
Room:	Pod - B
Location:	
Cost:	10000
Duration:	50 hrs

1403	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	4th
Room:	Pod - B
Location:	
Cost:	See *5
Duration:	See *5

1404	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

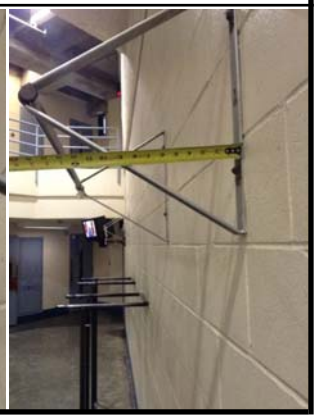

1405	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

1406	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

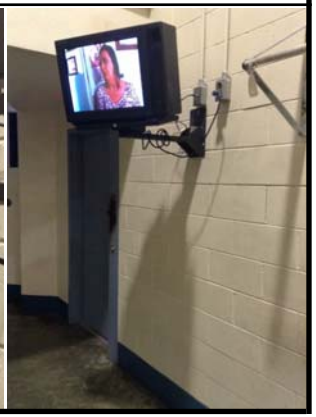

1407	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - B
Location:	
Cost:	1000
Duration:	5 hrs

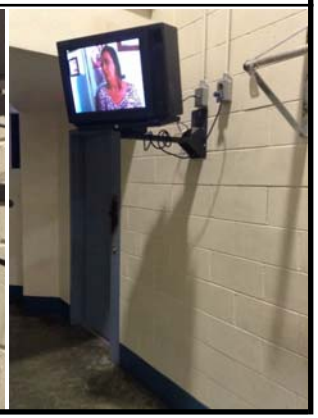

1408	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	4th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1409	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	4th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1410	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	4th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1411	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	4th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1412	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	4th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1413	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1414	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	4th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1415	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1416	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	4th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1417	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	4th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1418	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	4th
Room:	Pod - B
Location:	
Cost:	See *8
Duration:	See *8

1419	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	4th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1420	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	4th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1421	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	4th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

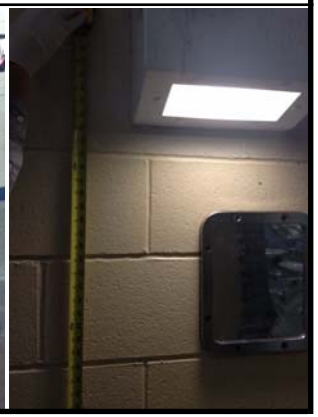

1422	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

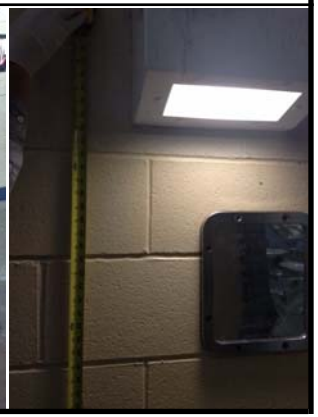

1423	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1424	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	4th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1425	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1426	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	4th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

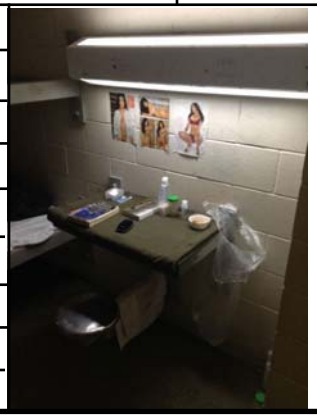

1427	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

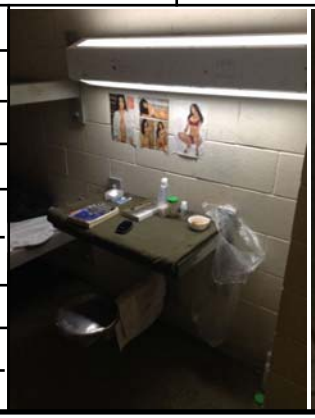

1428	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1429	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1430	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	4th
Room:	Pod - C
Location:	
Cost:	See *8
Duration:	See *8

1431	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	4th
Room:	Pod - C
Location:	
Cost:	See *8
Duration:	See *8

1432	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	4th
Room:	Pod - C
Location:	
Cost:	5000
Duration:	20 hrs

1433	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	4th
Room:	Pod - C
Location:	
Cost:	N/A
Duration:	N/A

1434	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	4th
Room:	Pod - C
Location:	
Cost:	6000
Duration:	30 hrs

1435	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	4th
Room:	Pod - C
Location:	
Cost:	10000
Duration:	50 hrs

1436	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	4th
Room:	Pod - C
Location:	
Cost:	See *8
Duration:	See *8

1437	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

1438	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

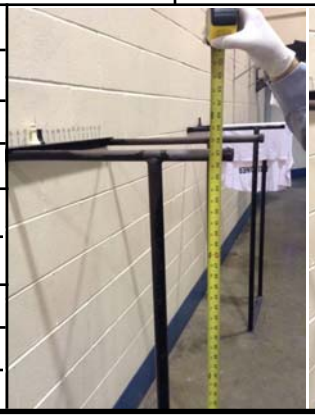

1439	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

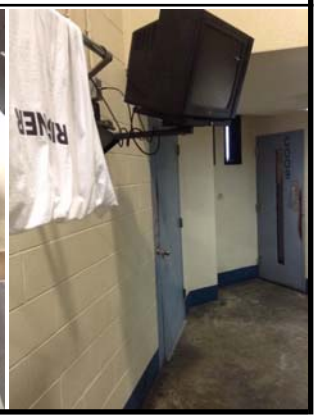

1440	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - C
Location:	
Cost:	1000
Duration:	5 hrs

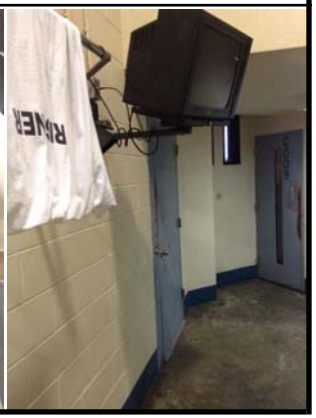

1441	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:
N/A
CBC Reference:
11B-608.9

Floor:	4th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

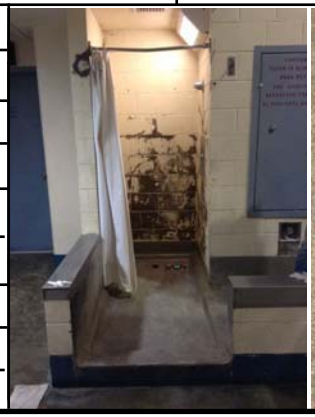

1442	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:
N/A
CBC Reference:
11B-608.5.2

Floor:	4th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

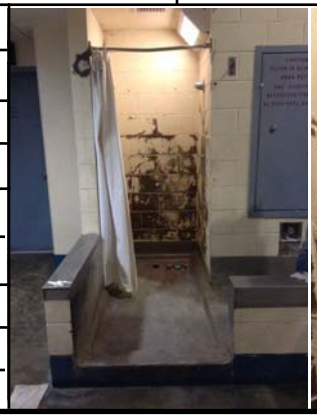

1443	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:
608.7
CBC Reference:
11B-608.7

Floor:	4th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

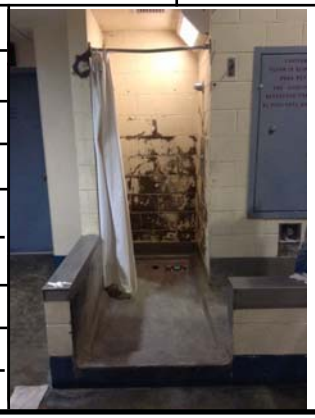

1444	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:
307.4
CBC Reference:
11B-307.4

Floor:	4th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

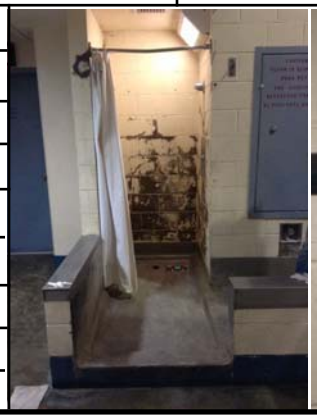

1445	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	4th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

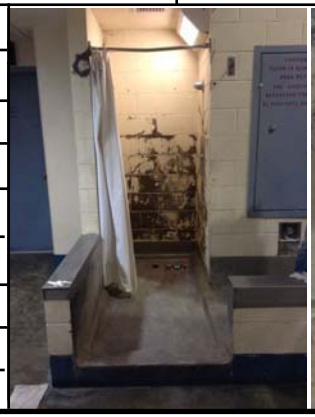

1446	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	4th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

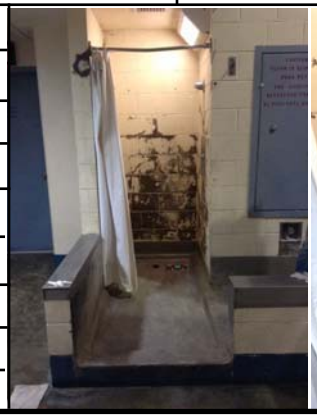

1447	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

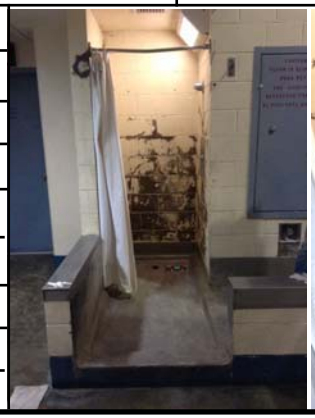

1448	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	4th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

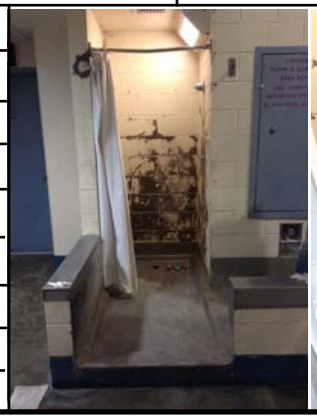

1449	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

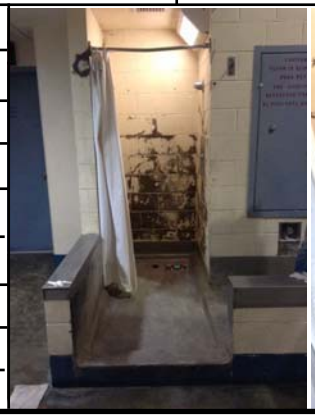

1450	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	4th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

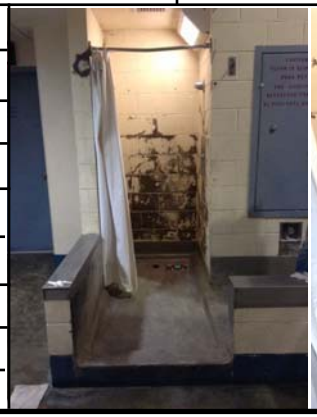

1451	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	4th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1452	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	4th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1453	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	4th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

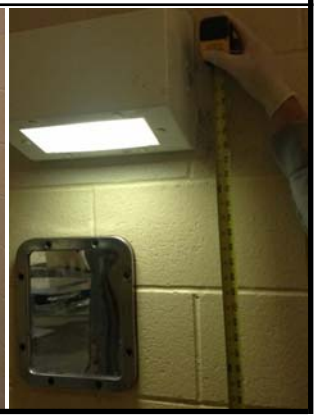

1454	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

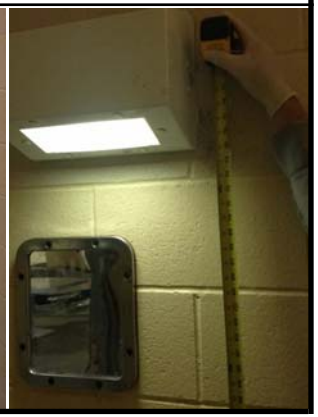

1455	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1456	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1457	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1458	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	4th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

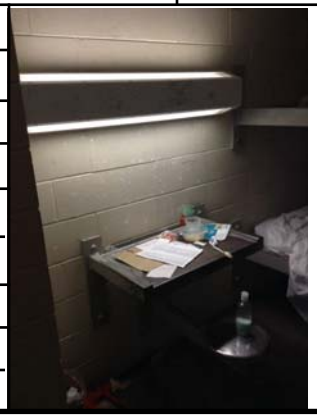

1459	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1460	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1461	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	4th
Room:	Pod - C
Location:	
Cost:	See *5
Duration:	See *5

1462	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	4th
Room:	Visitation
Location:	Inmate
Cost:	3000
Duration:	15 hrs

1463	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	4th
Room:	Visitation
Location:	Inmate
Cost:	See *5
Duration:	See *5

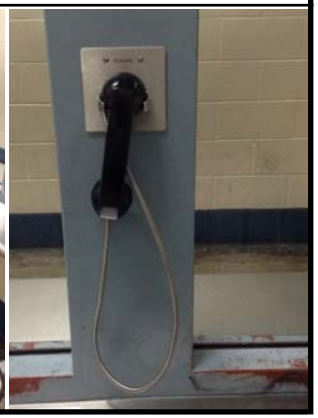

1464	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	See *8
Duration:	See *8

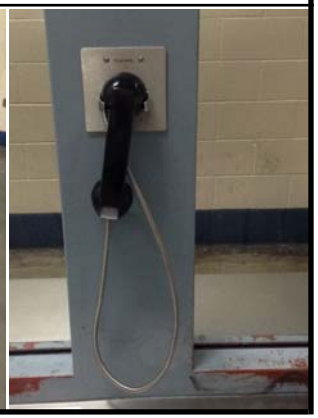

1465	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	See *5
Duration:	See *5

1466	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	See *8
Duration:	See *8

1467	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

1468	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

1469	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

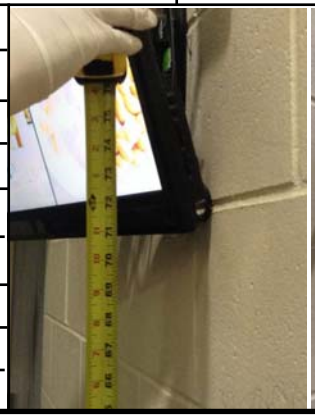

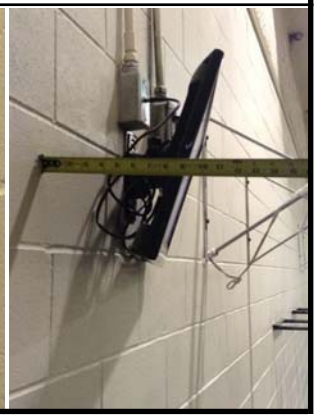

1470	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	1000
Duration:	5 hrs

1471	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	4th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1472	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	4th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1473	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	4th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

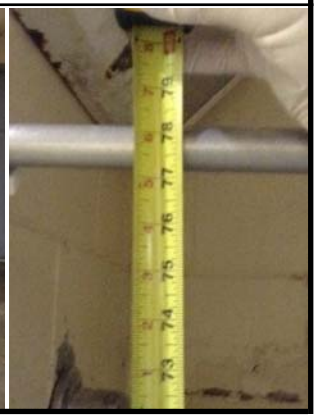

1474	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	4th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1475	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	4th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1476	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1477	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	4th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1478	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1479	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	4th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1480	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	4th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1481	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	5000
Duration:	20 hrs

1482	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	N/A
Duration:	N/A

1483	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	1500
Duration:	2 hrs

1484	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	6000
Duration:	30 hrs

1485	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	10000
Duration:	50 hrs

1486	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	4th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1487	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	4th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1488	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	4th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

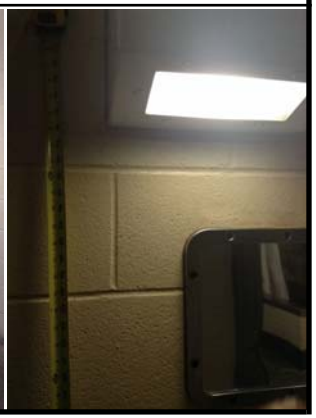

1489	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

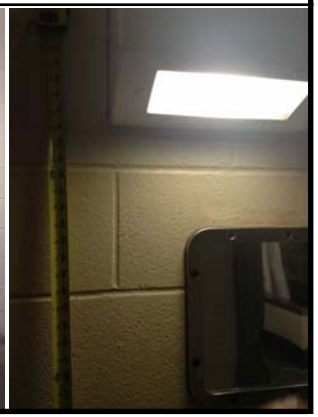

1490	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1491	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1492	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	4th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1493	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

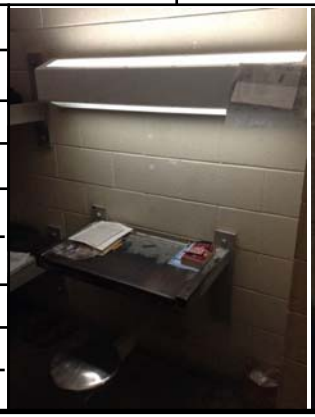

1494	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	4th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

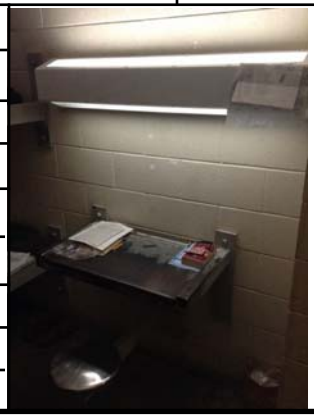

1495	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1496	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1497	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	4th
Room:	Pod - D
Location:	
Cost:	See *8
Duration:	See *8

1498	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	See *8
Duration:	See *8

1499	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	See *8
Duration:	See *8

1500	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	See *5
Duration:	See *5

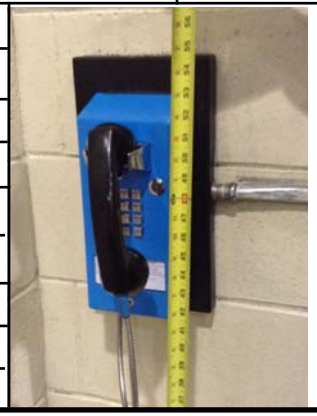

1501	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	200
Duration:	2 hrs

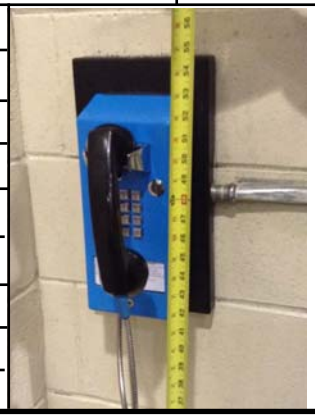

1502	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	5000
Duration:	20 hrs

1503	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	N/A
Duration:	N/A

1504	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	6000
Duration:	30 hrs

1505	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	10000
Duration:	50 hrs

1506	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	1500
Duration:	2 hrs

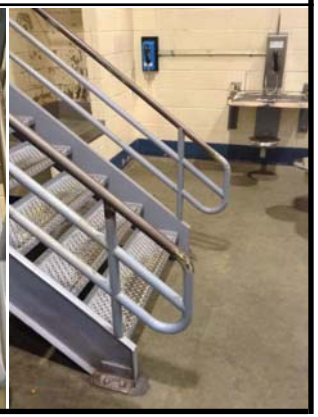

1507	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	See *8
Duration:	See *8

1508	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

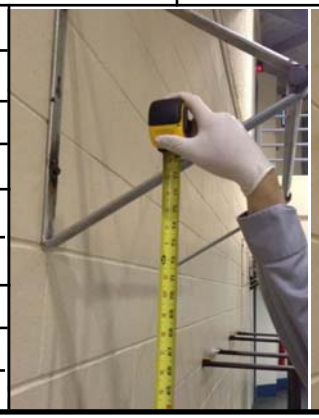

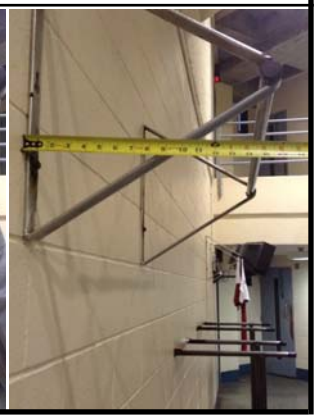

1509	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

1510	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

1511	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - E
Location:	
Cost:	1000
Duration:	5 hrs

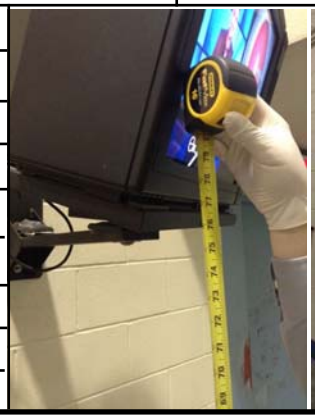

1512	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	4th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1513	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	4th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1514	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	4th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1515	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	4th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1516	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	4th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1517	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	4th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1518	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1519	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	4th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1520	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1521	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	4th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1522	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	4th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

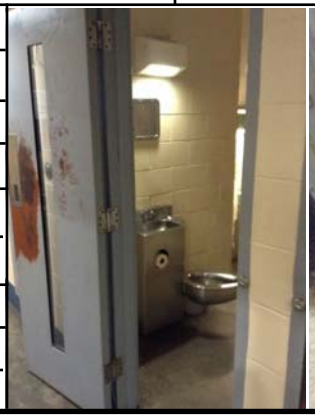

1523	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	4th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1524	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1525	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	4th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1526	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1527	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1528	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	4th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1529	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1530	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	4th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1531	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

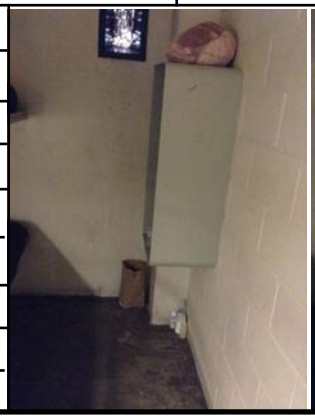

1532	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1533	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	Recommendation
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	4th
Room:	Pod - F
Location:	
Cost:	See *8
Duration:	See *8

1534	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	Recommendation
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	4th
Room:	Pod - F
Location:	
Cost:	See *8
Duration:	See *8

1535	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	Recommendation
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	4th
Room:	Pod - F
Location:	
Cost:	See *5
Duration:	See *5

1536	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	Recommendation
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	4th
Room:	Pod - F
Location:	
Cost:	5000
Duration:	20 hrs

1537	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	4th
Room:	Pod - F
Location:	
Cost:	N/A
Duration:	N/A

1538	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	4th
Room:	Pod - F
Location:	
Cost:	1500
Duration:	2 hrs

1539	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	4th
Room:	Pod - F
Location:	
Cost:	6000
Duration:	30 hrs

1540	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	4th
Room:	Pod - F
Location:	
Cost:	10000
Duration:	50 hrs

1541	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

1542	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

1543	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

1544	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - F
Location:	
Cost:	1000
Duration:	5 hrs

1545	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	4th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

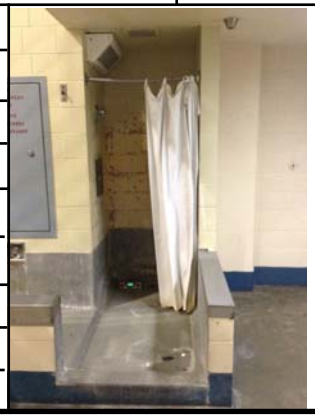

1546	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	4th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

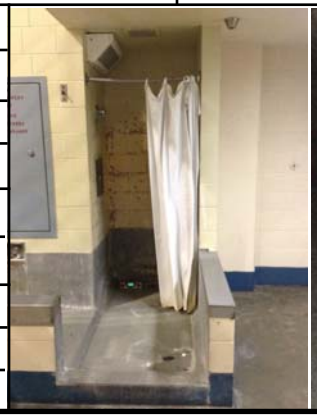

1547	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	4th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

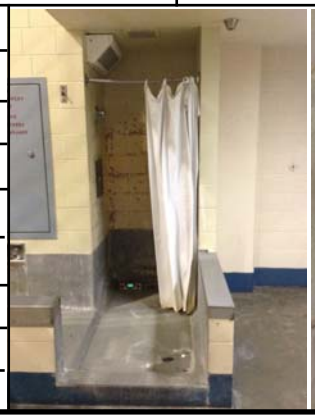

1548	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	4th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

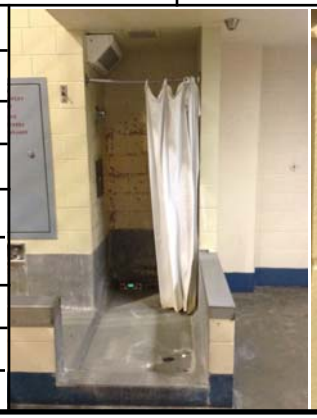

1549	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	4th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

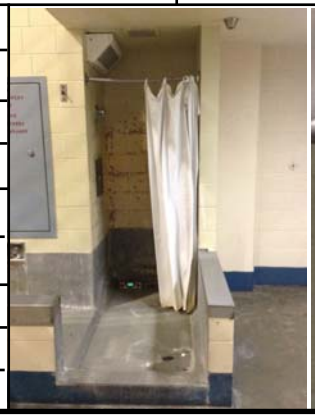

1550	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	4th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

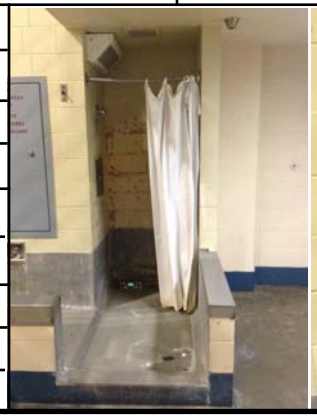

1551	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

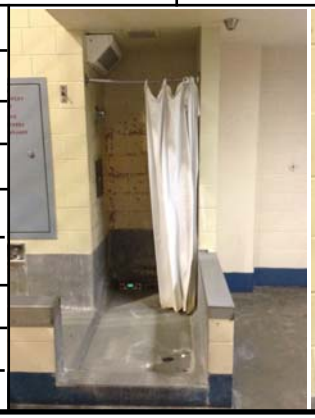

1552	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	4th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

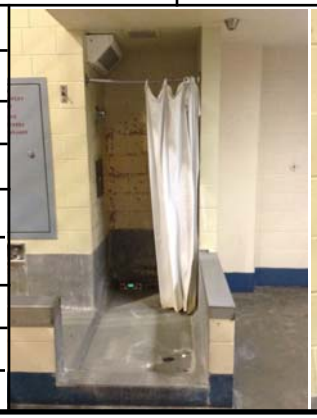

1553	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	4th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

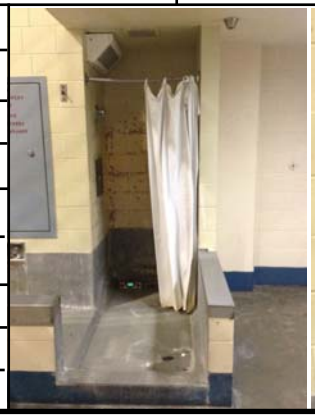

1554	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	4th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

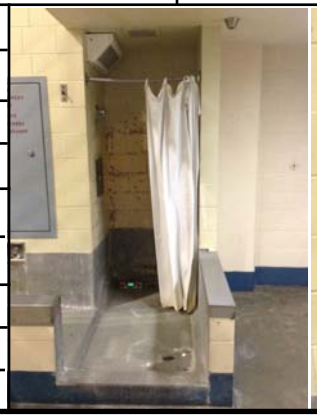

1555	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	4th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

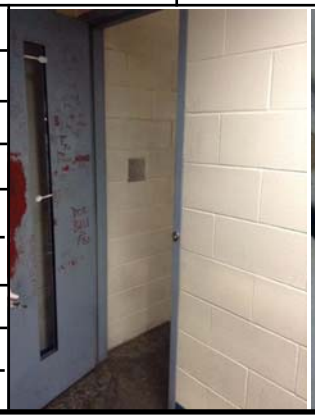

1556	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	4th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1557	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	4th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

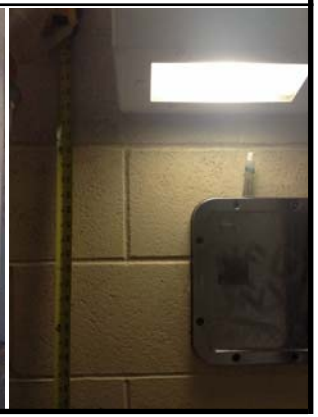

1558	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

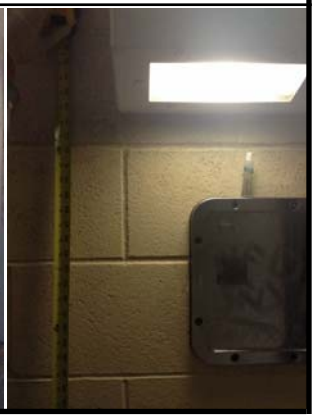

1559	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1560	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	4th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1561	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	4th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1562	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	4th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

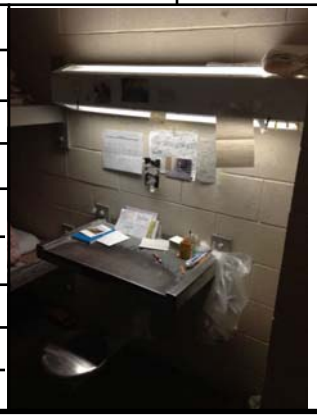

1563	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1564	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	4th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1565	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	4th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1566	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Remove and replace concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	5th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1567	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	5th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1568	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	5th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1569	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	5th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1570	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	5th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1571	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1572	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	5th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1573	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1574	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	5th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1575	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	5th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1576	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	5th
Room:	Cell FF
Location:	
Cost:	See *11
Duration:	See *11

1577	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

1578	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	5th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

1579	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	5th
Room:	Cell FF
Location:	Shower
Cost:	2000
Duration:	16 hrs

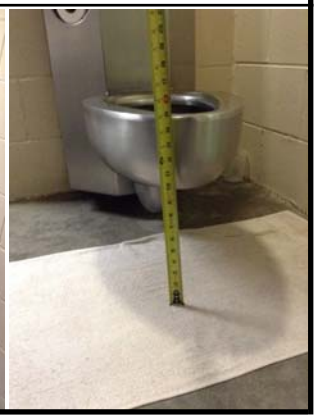

1580	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	5th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

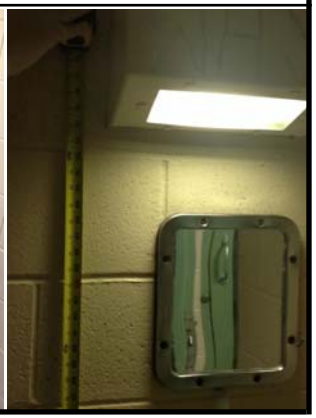

1581	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

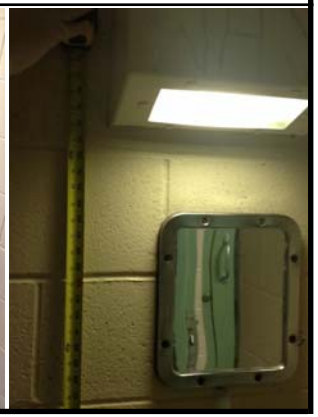

1582	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	5th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

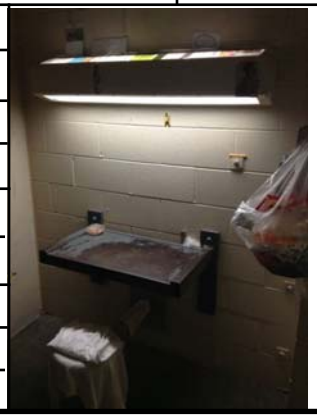

1583	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

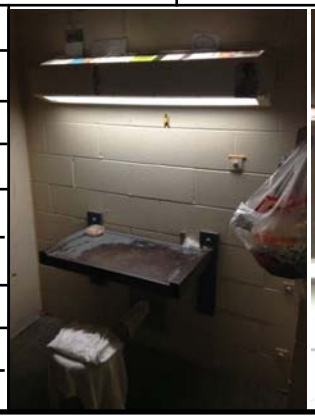

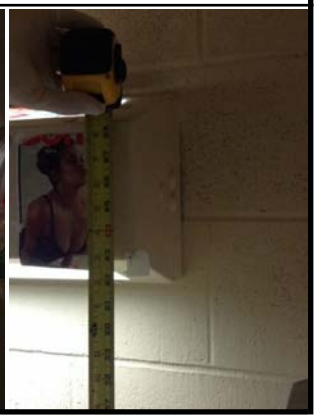

1584	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	5th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

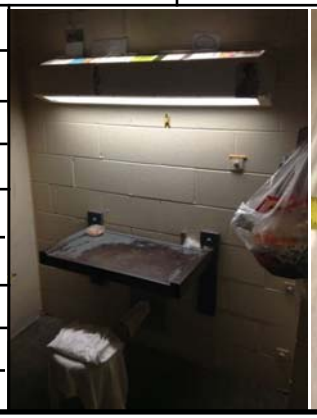

1585	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

1586	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	5th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

1587	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	5th
Room:	Cell FF
Location:	Cell
Cost:	See *5
Duration:	See *5

1588	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

1589	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	5th
Room:	Cell FF
Location:	
Cost:	500
Duration:	5 hrs

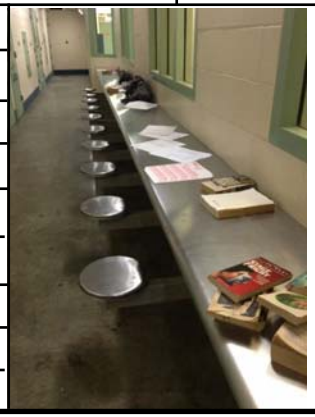

1590	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	5th
Room:	Cell FF
Location:	
Cost:	See *4
Duration:	See *4

1591	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Corridor
Location:	
Cost:	2000
Duration:	8 hrs

1592	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	5th
Room:	Storage
Location:	South
Cost:	500
Duration:	1 hr

1593	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	5th
Room:	Storage
Location:	South
Cost:	See *1
Duration:	See *1

1594	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Storage
Location:	South
Cost:	See *6
Duration:	See *6

1595	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	5th
Room:	Stairwell
Location:	South
Cost:	5000
Duration:	20 hrs

1596	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	5th
Room:	Stairwell
Location:	South
Cost:	N/A
Duration:	N/A

1597	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at top stairs not 12" minimum of level distance (parallel with floor) beyond top nosing	Modify handrail(s) to provide required 12" extensions or replace per current standards

ADA Reference:	
505.10.2	
CBC Reference:	
11B-505.10.2	
Floor:	5th
Room:	Stairwell
Location:	South
Cost:	1500
Duration:	2 hrs

1598	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Stairwell
Location:	South
Cost:	See *6
Duration:	See *6

1599	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	5th
Room:	Conference
Location:	Law Library
Cost:	See *2
Duration:	See *2

1600	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Conference
Location:	Law Library
Cost:	See *6
Duration:	See *6

1601	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:
703.3
CBC Reference:
11B-703.3

Floor:	5th
Room:	Conference
Location:	Law Library
Cost:	See *1
Duration:	See *1

1602	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:
703.3
CBC Reference:
11B-703.3

Floor:	5th
Room:	Janitor
Location:	
Cost:	See *1
Duration:	See *1

1603	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:
404.2.7
CBC Reference:
11B-404.2.7

Floor:	5th
Room:	Janitor
Location:	
Cost:	500
Duration:	1 hr

1604	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:
308.2.1
CBC Reference:
11B-308.2.1

Floor:	5th
Room:	Janitor
Location:	
Cost:	See *6
Duration:	See *6

1605	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	5th
Room:	Scullery
Location:	
Cost:	See *2
Duration:	See *2

1606	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Scullery
Location:	
Cost:	See *6
Duration:	See *6

1607	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	5th
Room:	Gym
Location:	
Cost:	See *4
Duration:	See *4

1608	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Minimum 17" deep toe clearance under counter not provided	Provide required toe clearance

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	5th
Room:	Gym
Location:	
Cost:	1000
Duration:	1 hr

1609	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	See *1
Duration:	See *1

1610	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:	
604.6	
CBC Reference:	
11B-604.6	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	16 hrs

1611	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	16 hrs

1612	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	300
Duration:	1.5

1613	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	300
Duration:	1.5

1614	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser not located min. 7" from edge of toilet	Relocate TPD with 7" minimum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

1615	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

1616	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	500
Duration:	1 hr

1617	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

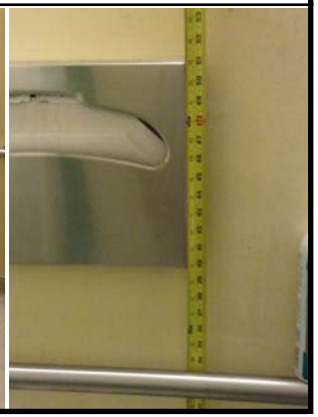

1618	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.25 hrs

1619	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	3000
Duration:	16 hrs

1620	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

1621	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	100
Duration:	1 hr

1622	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

1623	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	10 hrs

1624	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	See *6
Duration:	See *6

1625	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	5th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hr

1626	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	5th
Room:	Conference
Location:	
Cost:	See *2
Duration:	See *2

1627	Main Annex Jail	**Priority:**	1
Category	Landings/Thresholds		

Issue	**Recommendation**
Level area in direction of door swing (pull side) not 60" minimum length/maneuvering clearance	Provide required clearance area

ADA Reference:	
404.2.4.1	
CBC Reference:	
11B-404.2.4.1	
Floor:	5th
Room:	Conference
Location:	
Cost:	1000
Duration:	5 hrs

1628	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	5th
Room:	Conference
Location:	
Cost:	500
Duration:	1 hr

1629	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Conference
Location:	
Cost:	See *6
Duration:	See *6

1630	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	See *1
Duration:	See *1

1631	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	See *1
Duration:	See *1

1632	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	See *2
Duration:	See *2

1633	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

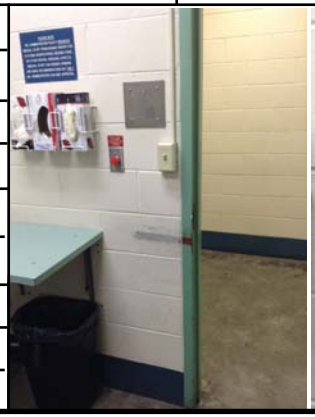

1634	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

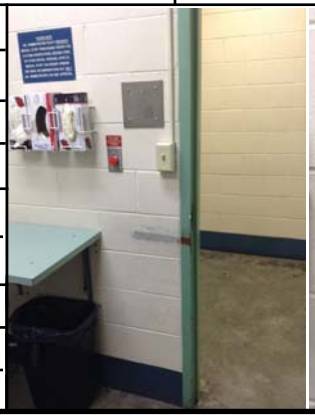

1635	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

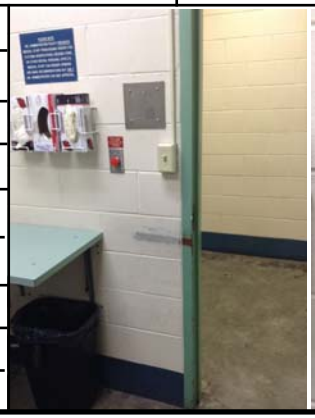

1636	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign over 40"-70" AFF (to bottom) not 5/8" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	See *1
Duration:	See *1

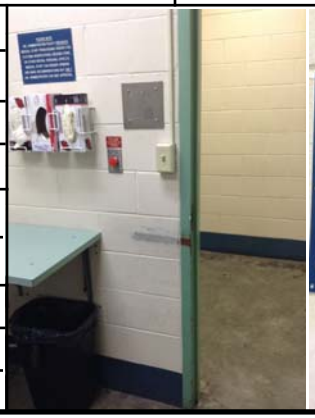

1637	Main Annex Jail	**Priority:**	4
Category	Sinks (ADULT)		

Issue	**Recommendation**
Height of rim or counter measured over 34" AFF	Reset sink/or provide maximum 34" AFF counter

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	1000
Duration:	8 hrs

1638	Main Annex Jail	**Priority:**	4
Category	Sinks (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate piping as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	50
Duration:	.25 hrs

1639	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	50
Duration:	.5 hrs

1640	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	50
Duration:	.5 hrs

1641	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Unisex toilet door sign not 1/4" thick of contrasting circle and triangle symbols with the circle circumscribing the triangle	Provide sign per current standards

ADA Reference:	
N/A	
CBC Reference:	
11B-703.7.2.6.3	
Floor:	5th
Room:	Infirmary
Location:	Restroom
Cost:	See *1
Duration:	See *1

1642	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	5th
Room:	Infirmary
Location:	Restroom
Cost:	500
Duration:	1 hr

1643	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	5th
Room:	Infirmary
Location:	Restroom
Cost:	6000
Duration:	18 hrs

1644	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	5th
Room:	Infirmary
Location:	Restroom
Cost:	2000
Duration:	16 hrs

1645	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	5th
Room:	Infirmary
Location:	Restroom
Cost:	2000
Duration:	16 hrs

1646	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	5th
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.5 hrs

1647	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	5th
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.25 hrs

1648	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	5th
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.5 hrs

1649	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	5th
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.5 hrs

1650	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror (not over lavatory) measured over 35" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 35" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	5th
Room:	Infirmary
Location:	Restroom
Cost:	100
Duration:	1 hr

1651	Main Annex Jail	**Priority:**	4
Category	Accessible Clearance		

Issue	**Recommendation**
Required 60" diameter circle or 'T'-shaped clear floor space not provided within room	Provide required clearance

ADA Reference:	
304.3	
CBC Reference:	
11B-304.3	
Floor:	5th
Room:	Infirmary
Location:	Restroom
Cost:	10000
Duration:	50 hrs

1652	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

1653	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

1654	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	5th
Room:	Infirmary
Location:	
Cost:	See *2
Duration:	See *2

1655	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	5th
Room:	Storage
Location:	North
Cost:	500
Duration:	1 hr

1656	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	5th
Room:	Storage
Location:	North
Cost:	See *1
Duration:	See *1

1657	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Storage
Location:	North
Cost:	See *6
Duration:	See *6

1658	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	5th
Room:	Stairwell
Location:	North
Cost:	N/A
Duration:	N/A

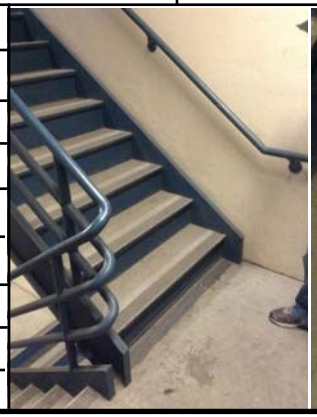

1659	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	5th
Room:	Stairwell
Location:	North
Cost:	5000
Duration:	20 hrs

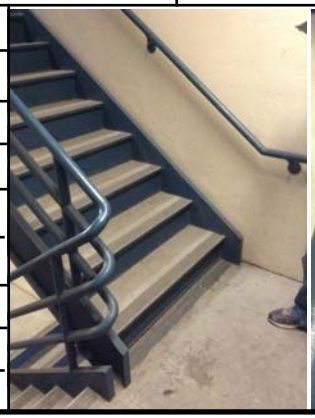

1660	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Stairwell
Location:	North
Cost:	See *6
Duration:	See *6

1661	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	5th
Room:	Classroom
Location:	
Cost:	See *4
Duration:	See *4

1662	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Minimum 27" high x 8" deep clearance under counter not provided	Provide minimum 27" high X 8" deep clearance under counter

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	5th
Room:	Classroom
Location:	
Cost:	1000
Duration:	1 hr

1663	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Classroom
Location:	
Cost:	See *6
Duration:	See *6

1664	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
50% of all drinking fountains are not standing accessible	Install for standing persons drinking fountain(s)

ADA Reference:	
211.3	
CBC Reference:	
11B-211.3	
Floor:	5th
Room:	Corridor
Location:	
Cost:	2000
Duration:	8 hrs

1665	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
Knee clearance space under drinking fountain not provided/8" deep at 27" tall and 11" deep at 9" tall and 30" wide	Remove and reset fountain for compliance; replace if required

ADA Reference:	
602.2	
CBC Reference:	
11B-602.2	
Floor:	5th
Room:	Corridor
Location:	
Cost:	1000
Duration:	8 hrs

1666	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 32 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	5th
Room:	Pod - A
Location:	
Cost:	See *8
Duration:	See *8

1667	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	5th
Room:	Pod - A
Location:	
Cost:	See *8
Duration:	See *8

1668	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - A
Location:	
Cost:	500
Duration:	5 hrs

1669	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - A
Location:	
Cost:	500
Duration:	5 hrs

1670	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - A
Location:	
Cost:	500
Duration:	5 hrs

1671	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - A
Location:	
Cost:	1000
Duration:	5 hrs

1672	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	5th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1673	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	5th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1674	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	5th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1675	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	5th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1676	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	5th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1677	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1678	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	5th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1679	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1680	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	5th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1681	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	5th
Room:	Pod - A
Location:	
Cost:	N/A
Duration:	N/A

1682	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	5th
Room:	Pod - A
Location:	
Cost:	6000
Duration:	30 hrs

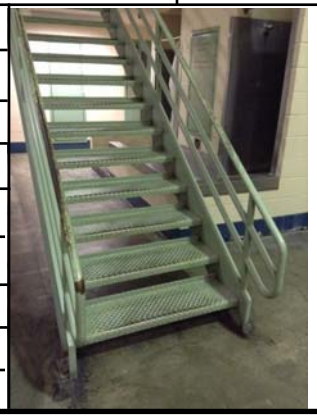

1683	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	5th
Room:	Pod - A
Location:	
Cost:	5000
Duration:	20 hrs

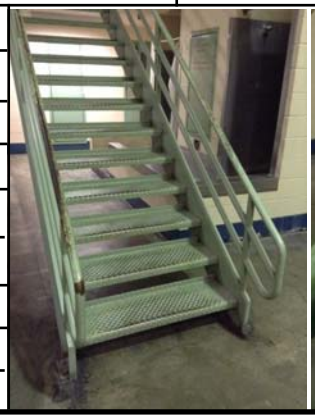

1684	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	5th
Room:	Pod - A
Location:	
Cost:	1500
Duration:	2 hrs

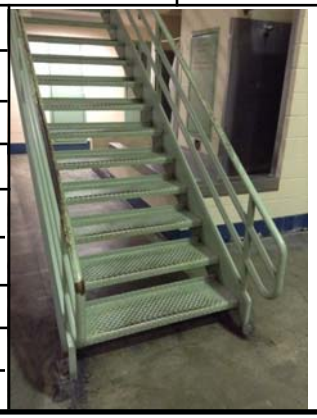

1685	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	5th
Room:	Pod - A
Location:	
Cost:	10000
Duration:	50 hrs

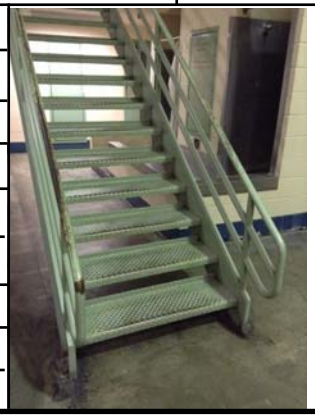

1686	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	5th
Room:	Pod - A
Location:	
Cost:	See *8
Duration:	See *8

1687	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1688	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1689	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

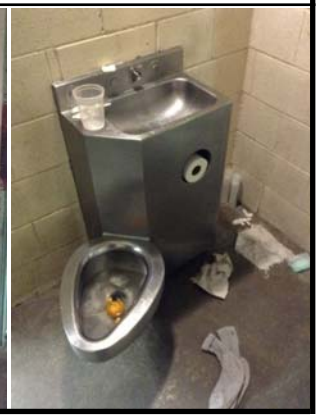

1690	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1691	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

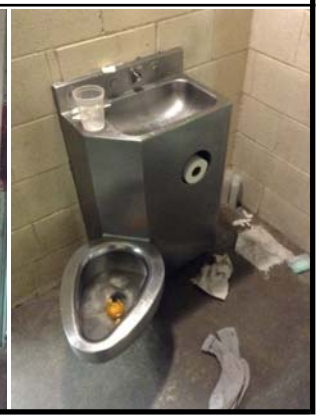

1692	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1693	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1694	Main Annex Jail	**Priority:**	4
Category	Accessible Clearance		

Issue	**Recommendation**
Required 60" diameter circle or 'T'-shaped clear floor space not provided within room	Provide required clearance

ADA Reference:	
304.3	
CBC Reference:	
11B-304.3	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1695	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1696	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

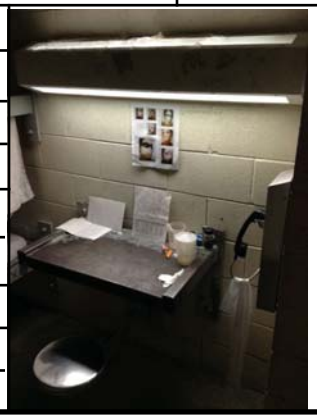

1697	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *5
Duration:	See *5

1698	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1699	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1700	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1701	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	Recommendation
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	See *8
Duration:	See *8

1702	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	Recommendation
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	See *8
Duration:	See *8

1703	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	Recommendation
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

1704	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	Recommendation
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	1000
Duration:	5 hrs

1705	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

1706	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

1707	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	5th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1708	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	5th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1709	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	5th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1710	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	5th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1711	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	5th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1712	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1713	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	5th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1714	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1715	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	5th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1716	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	N/A
Duration:	N/A

1717	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	5000
Duration:	20 hrs

1718	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	1500
Duration:	2 hrs

1719	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	6000
Duration:	30 hrs

1720	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	10000
Duration:	50 hrs

1721	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	See *5
Duration:	See *5

1722	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide assistance placard

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	200
Duration:	2 hrs

1723	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	5th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1724	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	5th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1725	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	5th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1726	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1727	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	5th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1728	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	5th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1729	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	5th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1730	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1731	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	5th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1732	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1733	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1734	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	5th
Room:	Pod - B
Location:	
Cost:	See *8
Duration:	See *8

1735	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	See *8
Duration:	See *8

1736	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	See *8
Duration:	See *8

1737	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

1738	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

1739	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

1740	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	1000
Duration:	5 hrs

1741	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:
608.7
CBC Reference:
11B-608.7

Floor:	5th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

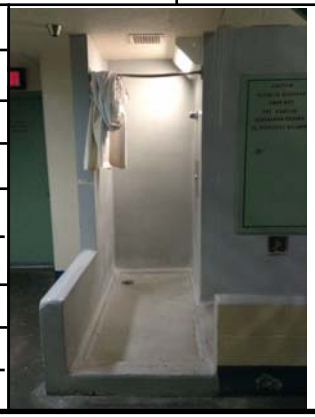

1742	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:
N/A
CBC Reference:
11B-608.9

Floor:	5th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

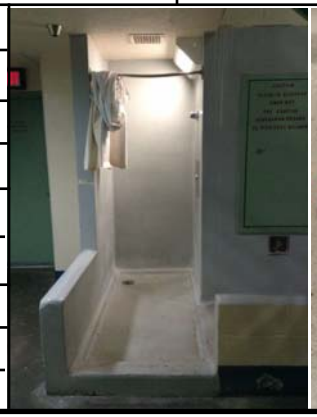

1743	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:
307.4
CBC Reference:
11B-307.4

Floor:	5th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

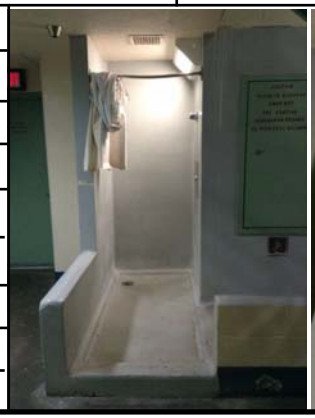

1744	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:
N/A
CBC Reference:
11B-608.5.2

Floor:	5th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

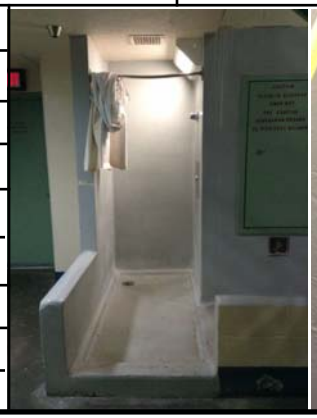

1745	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	5th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

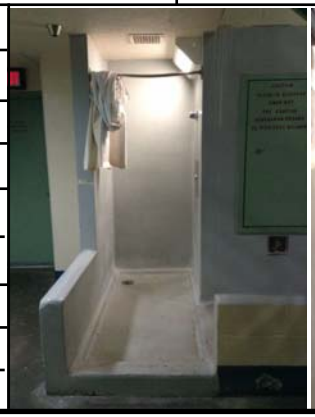

1746	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

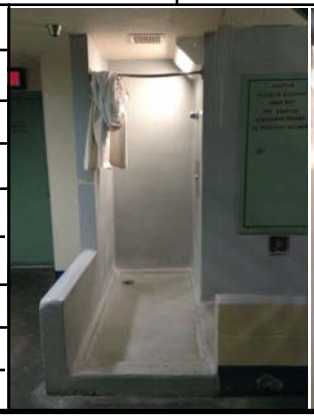

1747	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	5th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

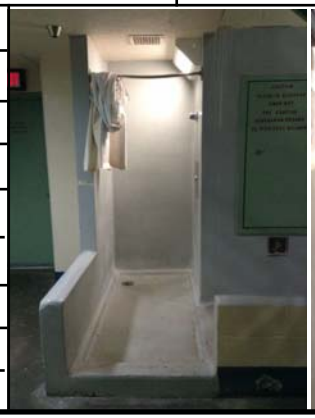

1748	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

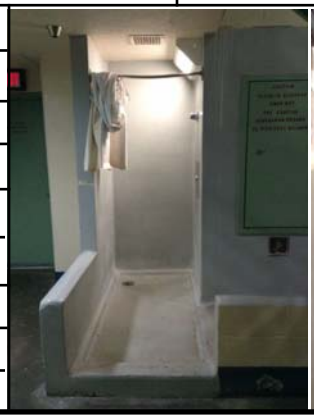

1749	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	5th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

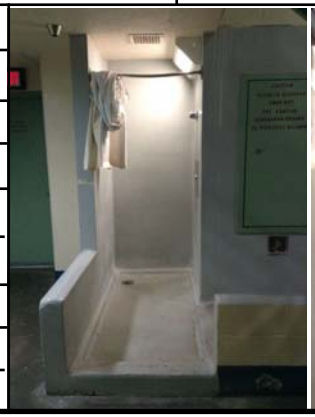

1750	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	1500
Duration:	2 hrs

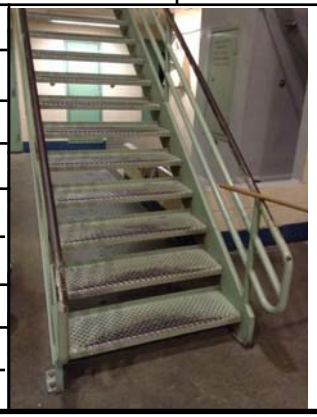

1751	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	N/A
Duration:	N/A

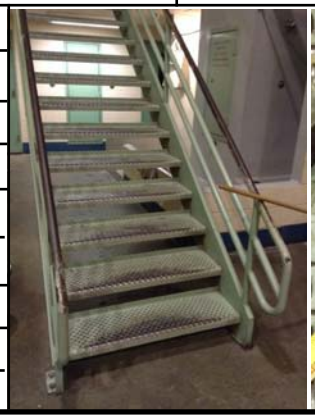

1752	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	5000
Duration:	20 hrs

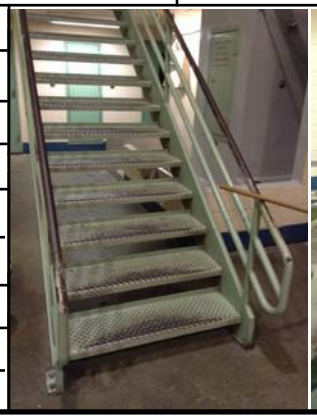

1753	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	6000
Duration:	30 hrs

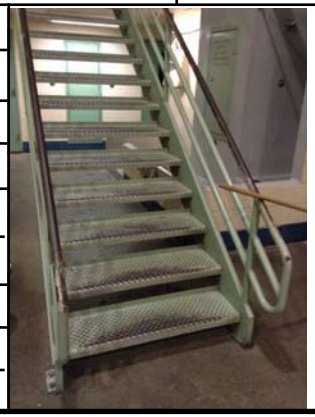

1754	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	10000
Duration:	50 hrs

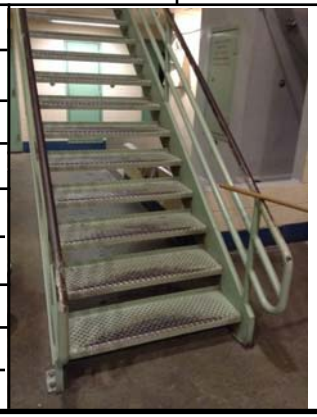

1755	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	5th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

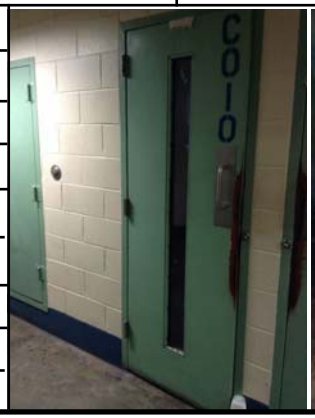

1756	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	5th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

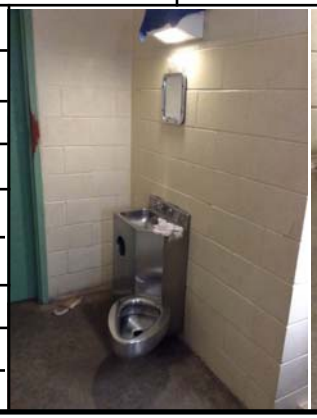

1757	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	5th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

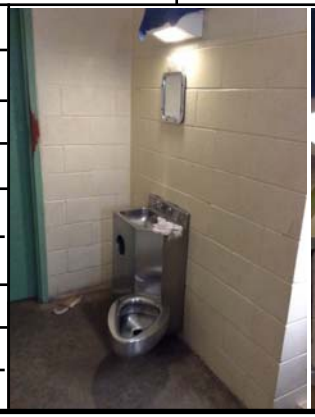

1758	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

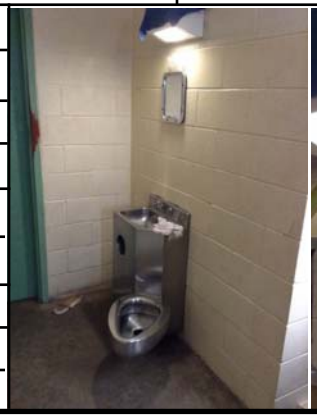

1759	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	5th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

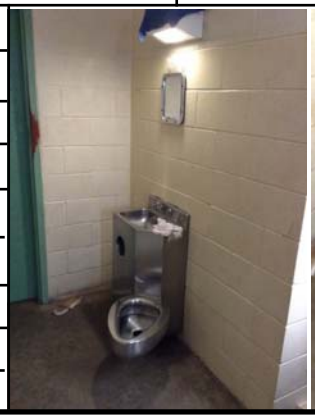

1760	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	5th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

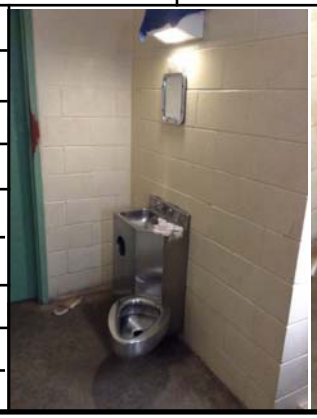

1761	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	5th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

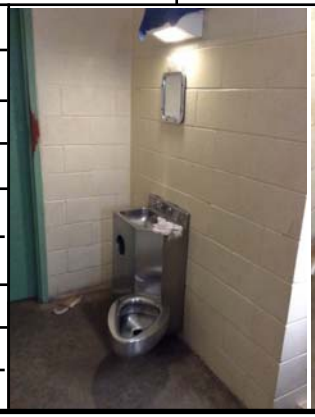

1762	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	5th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

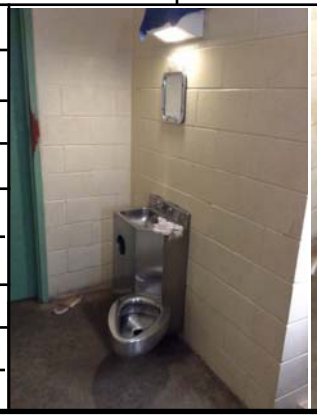

1763	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	5th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

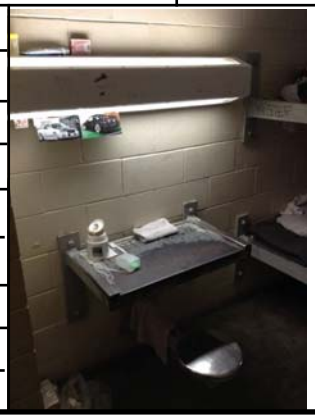

1764	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1765	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1766	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1767	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	See *8
Duration:	See *8

1768	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	See *5
Duration:	See *5

1769	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - C
Location:	
Cost:	200
Duration:	2 hrs

1770	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	See *8
Duration:	See *8

1771	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	See *8
Duration:	See *8

1772	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	3000
Duration:	15 hrs

1773	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	See *5
Duration:	See *5

1774	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	1000
Duration:	5 hrs

1775	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	N/A
Duration:	N/A

1776	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	1500
Duration:	2 hrs

1777	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	6000
Duration:	30 hrs

1778	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	5000
Duration:	20 hrs

1779	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	10000
Duration:	50 hrs

1780	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

1781	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

1782	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

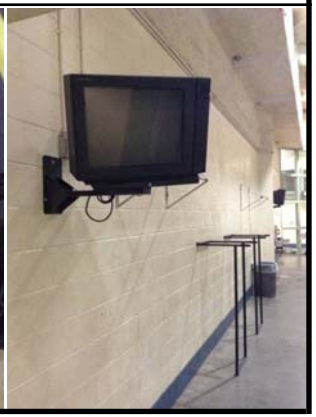

1783	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	1000
Duration:	5 hrs

1784	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	5th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1785	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	5th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1786	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	5th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1787	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	5th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1788	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	5th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1789	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1790	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	5th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1791	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1792	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	5th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1793	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	5th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1794	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	5th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

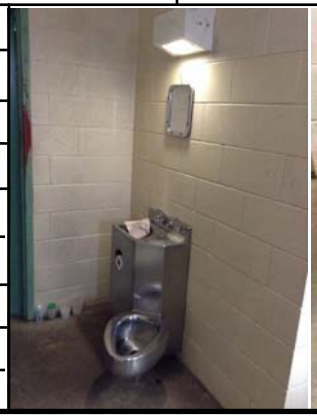

1795	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	5th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

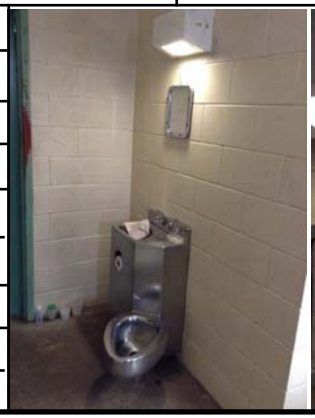

1796	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

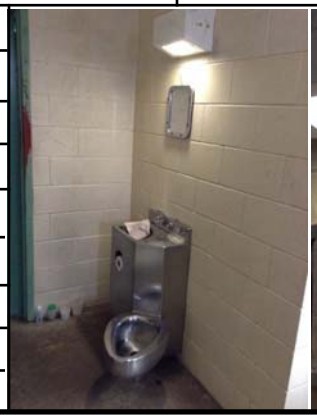

1797	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	5th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1798	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	5th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1799	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	5th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1800	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	5th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1801	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	5th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1802	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

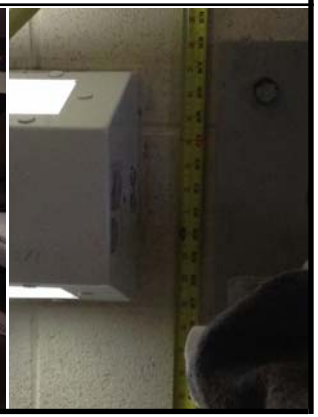

1803	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1804	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

1805	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	5th
Room:	Pod - D
Location:	
Cost:	See *8
Duration:	See *8

1806	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	See *8
Duration:	See *8

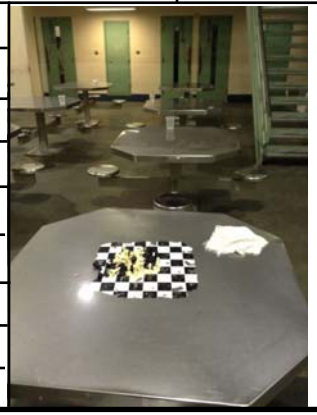

1807	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	See *8
Duration:	See *8

1808	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	1500
Duration:	2 hrs

1809	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	N/A
Duration:	N/A

1810	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	5000
Duration:	20 hrs

1811	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	6000
Duration:	30 hrs

1812	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	10000
Duration:	50 hrs

1813	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	See *5
Duration:	See *5

1814	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide assistance placard

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	1000
Duration:	5 hrs

1815	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

1816	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

1817	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

1818	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	5th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

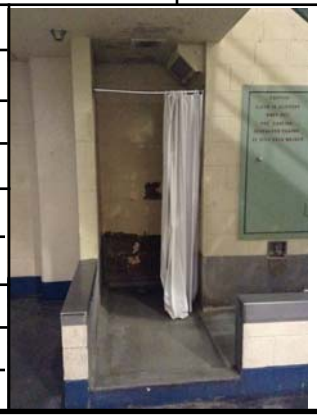

1819	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	5th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

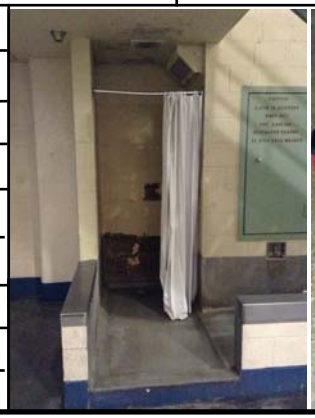

1820	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	5th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

1821	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	5th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

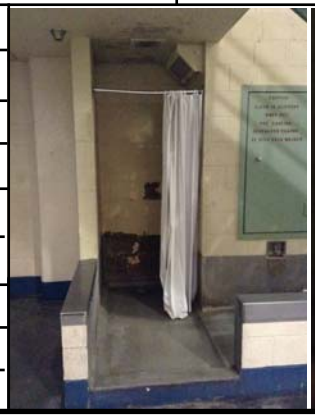

1822	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	5th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

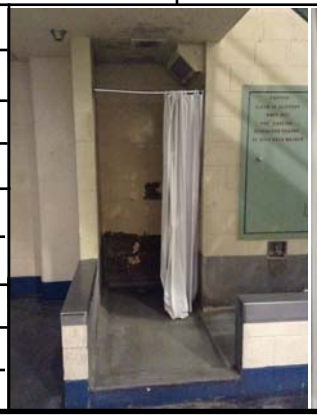

1823	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

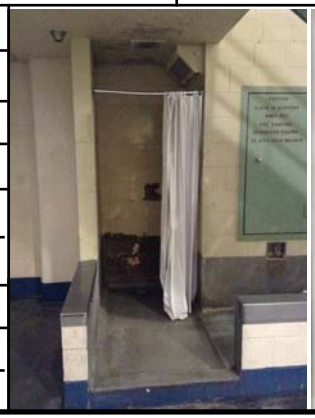

1824	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	5th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

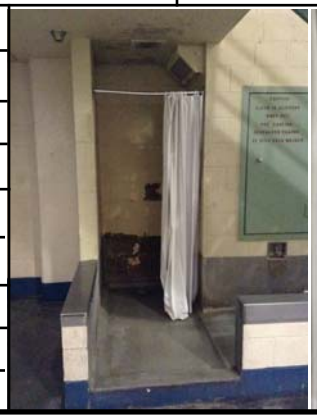

1825	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

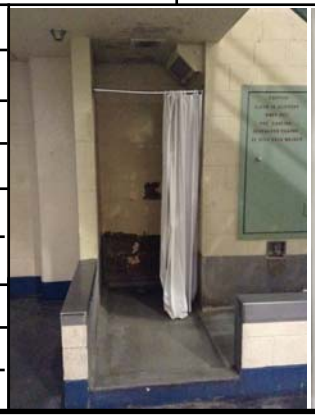

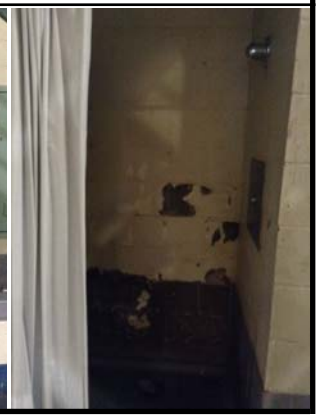

1826	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	5th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

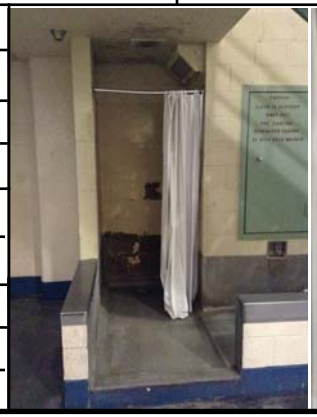

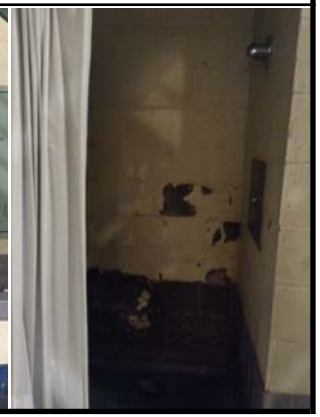

1827	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	5th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1828	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	5th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1829	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	5th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1830	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1831	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	5th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1832	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	5th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1833	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	5th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1834	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	5th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1835	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	5th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

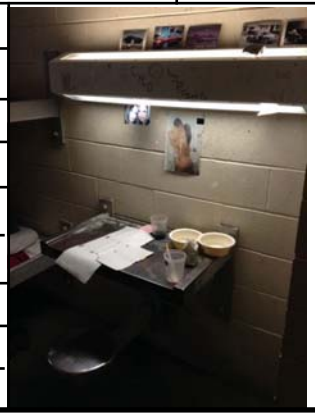

1836	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1837	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1838	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

1839	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	5th
Room:	Pod - E
Location:	
Cost:	See *8
Duration:	See *8

1840	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	See *8
Duration:	See *8

1841	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	Recommendation
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	See *8
Duration:	See *8

1842	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	Recommendation
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	1500
Duration:	2 hrs

1843	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	Recommendation
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	N/A
Duration:	N/A

1844	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	Recommendation
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	5000
Duration:	20 hrs

1845	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	6000
Duration:	30 hrs

1846	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	10000
Duration:	50 hrs

1847	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	See *5
Duration:	See *5

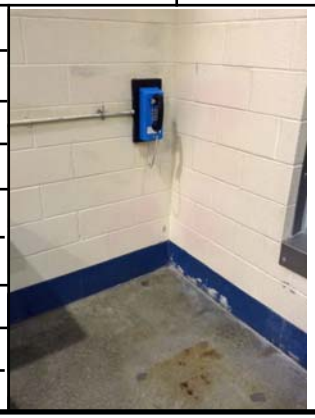

1848	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

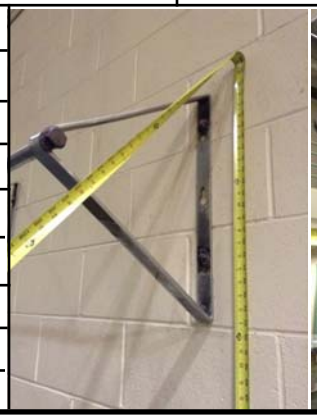

1849	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

1850	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

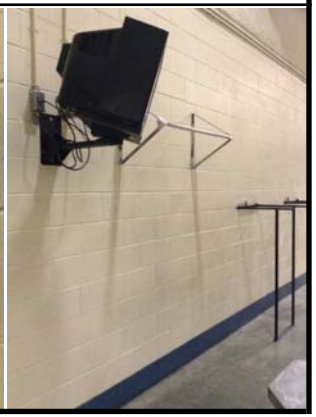

1851	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	1000
Duration:	5 hrs

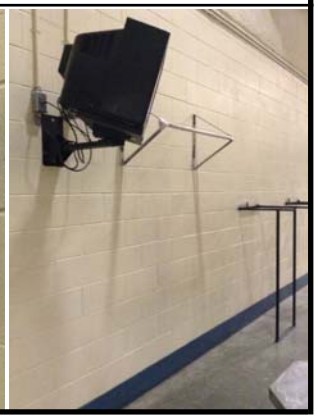

1852	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	5th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1853	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	5th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1854	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	5th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1855	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	5th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1856	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	5th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1857	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1858	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	5th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1859	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	5th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1860	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	5th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

1861	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	5th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1862	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	5th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1863	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	5th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1864	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	5th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1865	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1866	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	5th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1867	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	5th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1868	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	5th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1869	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	5th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

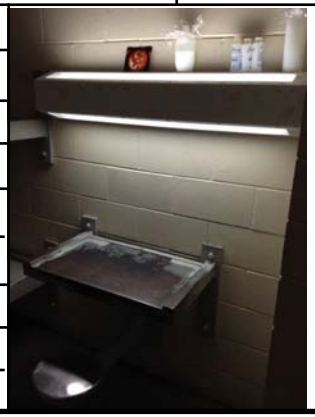

1870	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1871	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	5th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1872	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	5th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

1873	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	5th
Room:	Pod - F
Location:	
Cost:	See *8
Duration:	See *8

1874	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	5th
Room:	Visitation
Location:	Inmate
Cost:	See *5
Duration:	See *5

1875	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 32 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	6th
Room:	Pod - A
Location:	
Cost:	See *8
Duration:	See *8

1876	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	6th
Room:	Pod - A
Location:	
Cost:	See *8
Duration:	See *8

1877	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - A
Location:	
Cost:	500
Duration:	5 hrs

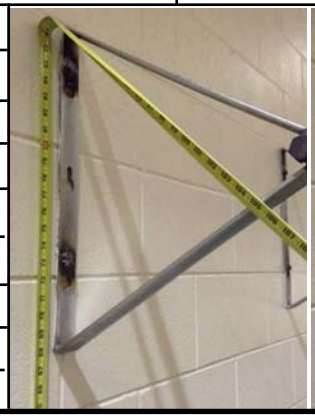
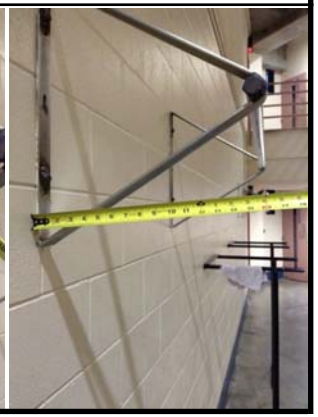

1878	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - A
Location:	
Cost:	500
Duration:	5 hrs

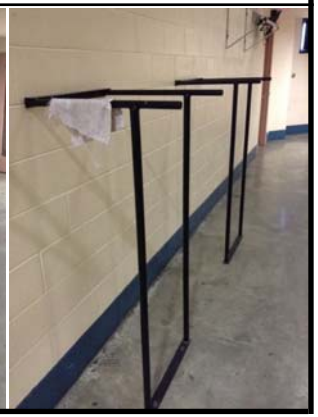

1879	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - A
Location:	
Cost:	500
Duration:	5 hrs

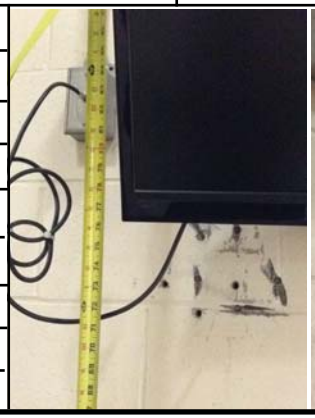

1880	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - A
Location:	
Cost:	1000
Duration:	5 hrs

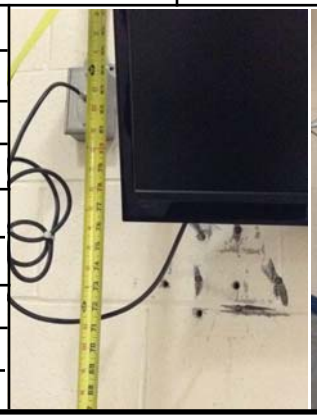

1881	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	6th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1882	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	6th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1883	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	6th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1884	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	6th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1885	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	6th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1886	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	6th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1887	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1888	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	6th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1889	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1890	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	6th
Room:	Pod - A
Location:	Shower
Cost:	See *7
Duration:	See *7

1891	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1892	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1893	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1894	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1895	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1896	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1897	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1898	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1899	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

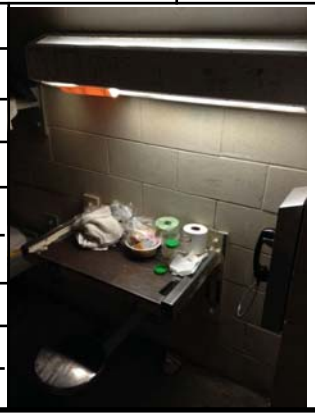

1900	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1901	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *5
Duration:	See *5

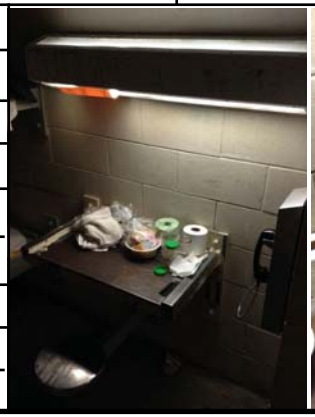

1902	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

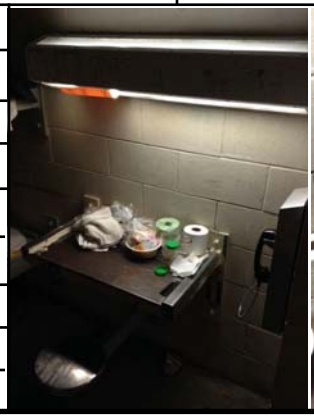

1903	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1904	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - A
Location:	Cell
Cost:	See *9
Duration:	See *9

1905	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	6th
Room:	Pod - A
Location:	
Cost:	1500
Duration:	2 hrs

1906	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	6th
Room:	Pod - A
Location:	
Cost:	N/A
Duration:	N/A

1907	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	6th
Room:	Pod - A
Location:	
Cost:	5000
Duration:	20 hrs

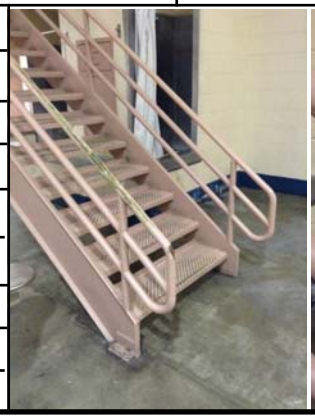

1908	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	6th
Room:	Pod - A
Location:	
Cost:	6000
Duration:	30 hrs

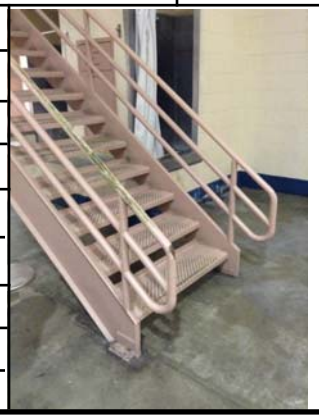

1909	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	6th
Room:	Pod - A
Location:	
Cost:	10000
Duration:	50 hrs

1910	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	6th
Room:	Pod - A
Location:	
Cost:	See *8
Duration:	See *8

1911	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	See *8
Duration:	See *8

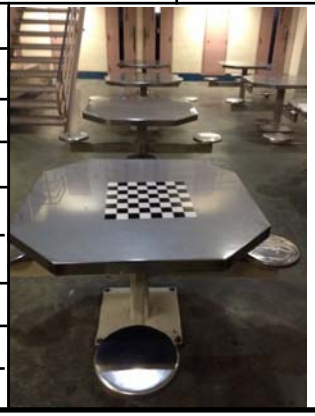

1912	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	See *8
Duration:	See *8

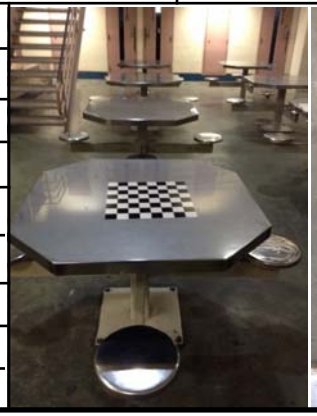

1913	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Height of tables over 34" AFF	Provide table(s) with required clearance per current standards

ADA Reference:	
902.3	
CBC Reference:	
11B-902.3	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

1914	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	200
Duration:	2 hrs

1915	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	See *5
Duration:	See *5

1916	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

1917	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

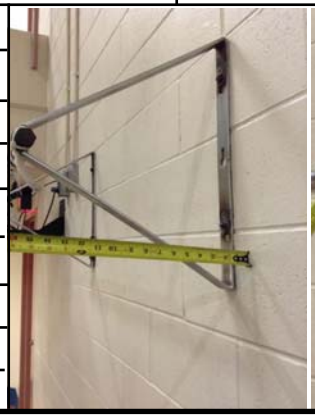

1918	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	500
Duration:	5 hrs

1919	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	1000
Duration:	5 hrs

1920	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	N/A
Duration:	N/A

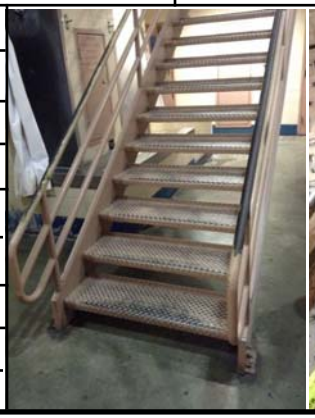

1921	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	5000
Duration:	20 hrs

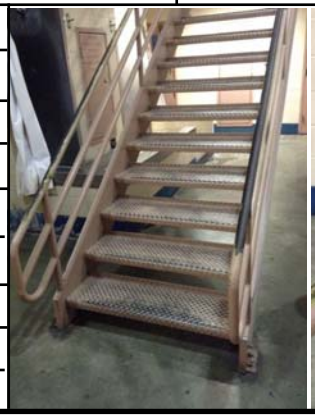

1922	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	1500
Duration:	2 hrs

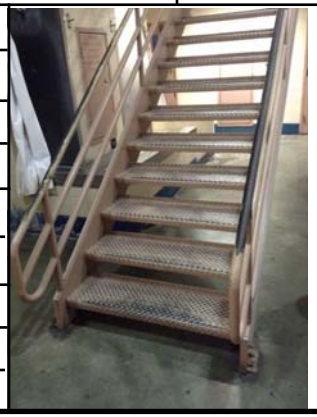

1923	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	10000
Duration:	50 hrs

1924	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	6th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

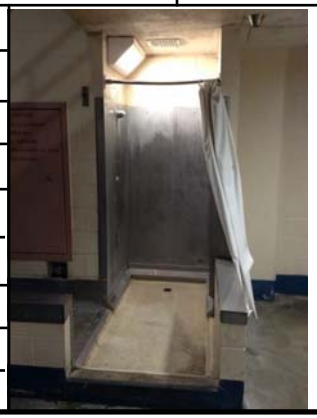

1925	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	6th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1926	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	6th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

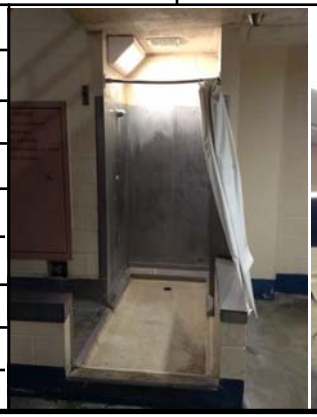

1927	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	6th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

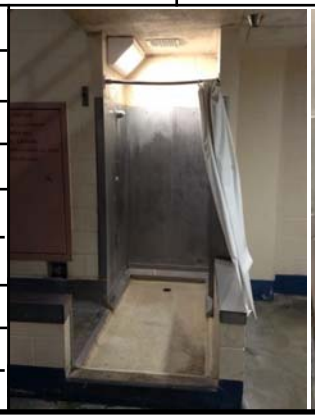

1928	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	6th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

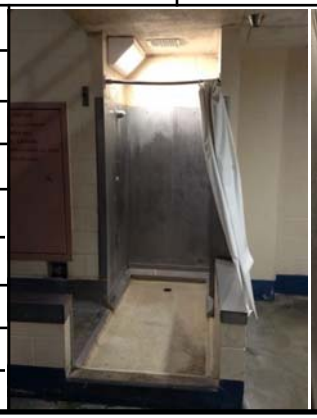

1929	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1930	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	6th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

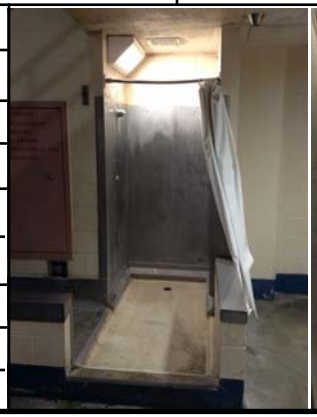

1931	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

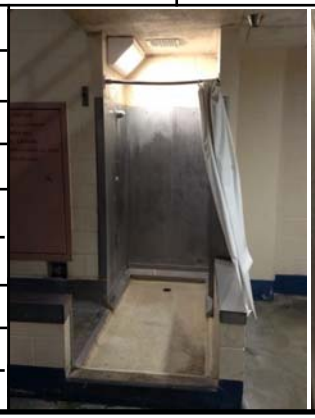

1932	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	6th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

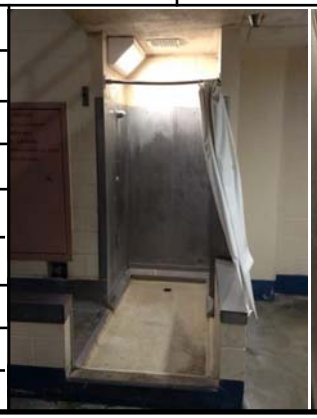

1933	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	6th
Room:	Pod - B
Location:	Shower
Cost:	See *7
Duration:	See *7

1934	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

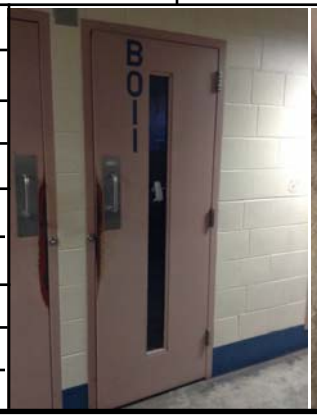

1935	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1936	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1937	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1938	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1939	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1940	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1941	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1942	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

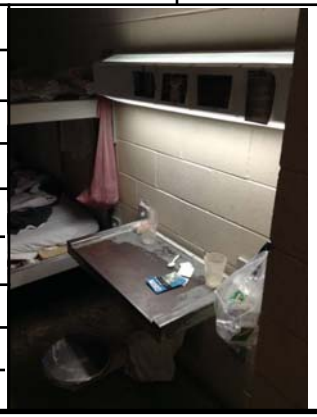

1943	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1944	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

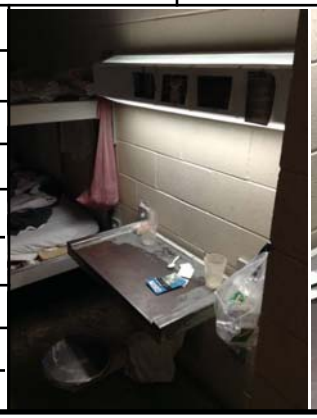

1945	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1946	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - B
Location:	Cell
Cost:	See *9
Duration:	See *9

1947	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	6th
Room:	Pod - B
Location:	
Cost:	See *8
Duration:	See *8

1948	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	See *8
Duration:	See *8

1949	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	Recommendation
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	See *8
Duration:	See *8

1950	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	Recommendation
Minimum 27" high x 8" deep clearance under counter not provided	Provide minimum 27" high X 8" deep clearance under counter

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

1951	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	Recommendation
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	See *5
Duration:	See *5

1952	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	Recommendation
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

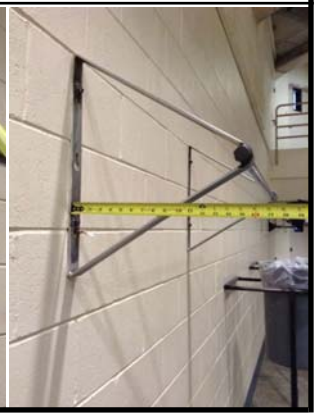

1953	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

1954	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	500
Duration:	5 hrs

1955	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	1000
Duration:	5 hrs

1956	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	6th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

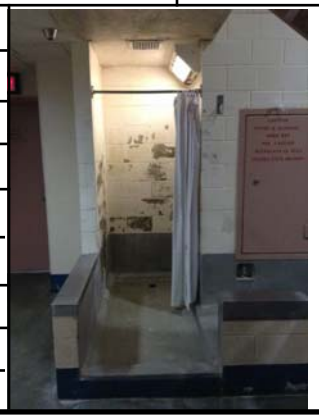

1957	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	6th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

1958	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	6th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

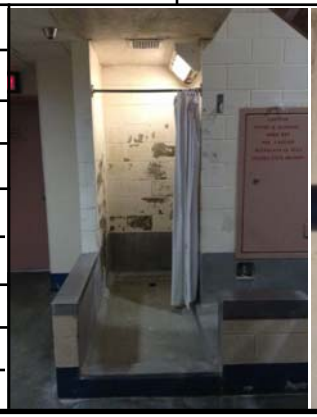

1959	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	6th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

1960	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	6th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

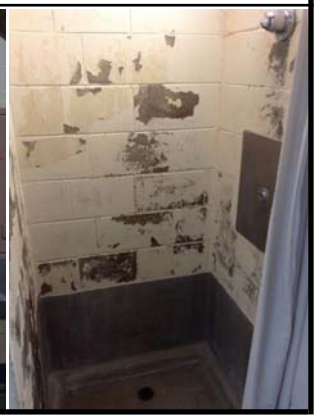

1961	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

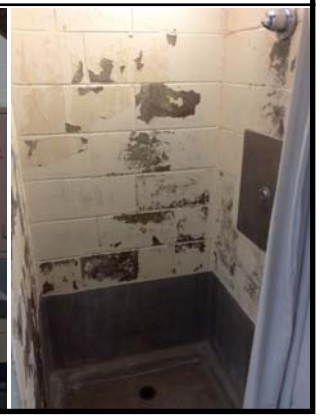

1962	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	6th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

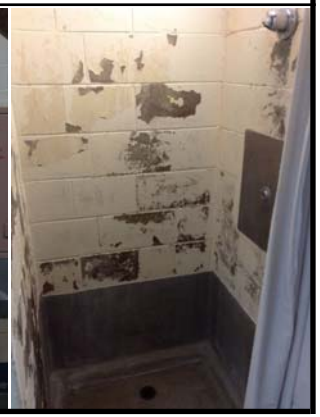

1963	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

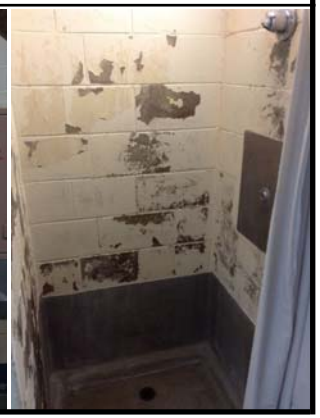

1964	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	6th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

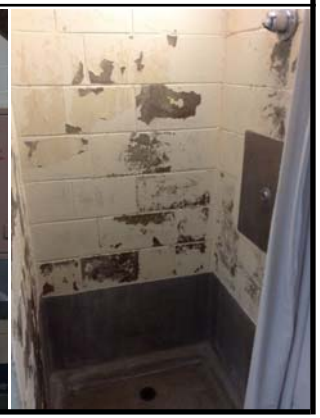

1965	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	6th
Room:	Pod - C
Location:	Shower
Cost:	See *7
Duration:	See *7

1966	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	N/A
Duration:	N/A

1967	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	5000
Duration:	20 hrs

1968	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	1500
Duration:	2 hrs

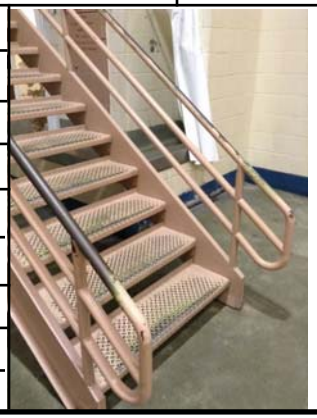

1969	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	6000
Duration:	30 hrs

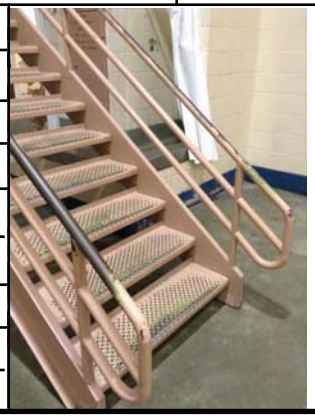

1970	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	6th
Room:	Pod - C
Location:	
Cost:	10000
Duration:	50 hrs

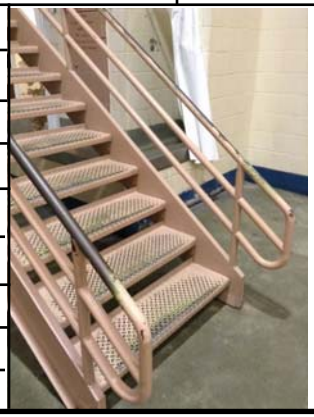

1971	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1972	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1973	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1974	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

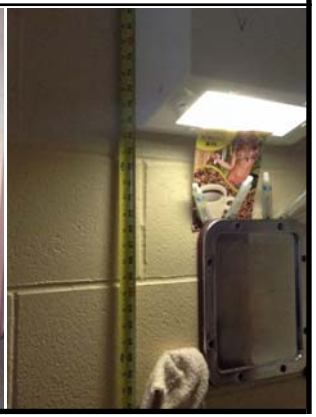

1975	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

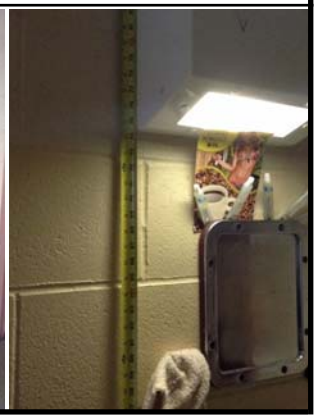

1976	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1977	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1978	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1979	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1980	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1981	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1982	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *5
Duration:	See *5

1983	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1984	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - C
Location:	Cell
Cost:	See *9
Duration:	See *9

1985	Main Annex Jail	**Priority:**	1

Category	Accessible Path of Travel

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:
206.2.2
CBC Reference:
11B-206.2.2

Floor:	6th
Room:	Pod - C
Location:	
Cost:	See *8
Duration:	See *8

1986	Main Annex Jail	**Priority:**	4

Category	Telephones

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:
217.4.8
CBC Reference:
11B-217.4.8

Floor:	6th
Room:	Visitation -
Location:	Inmate
Cost:	See *5
Duration:	See *5

1987	Main Annex Jail	**Priority:**	2

Category	Dining/Bar Facilities

Issue	**Recommendation**
At least 5% of total seating is not accessible	Provide accessible seating spaces as required

ADA Reference:
226.1
CBC Reference:
11B-226.1

Floor:	6th
Room:	Pod - D
Location:	
Cost:	See *8
Duration:	See *8

1988	Main Annex Jail	**Priority:**	1

Category	Corridors/Hallways

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:
N/A
CBC Reference:
11B-403.5.1

Floor:	6th
Room:	Pod - D
Location:	
Cost:	See *8
Duration:	See *8

1989	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	6th
Room:	Pod - D
Location:	
Cost:	See *5
Duration:	See *5

1990	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Minimum 27" high x 8" deep clearance under counter not provided	Provide minimum 27" high X 8" deep clearance under counter

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

1991	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

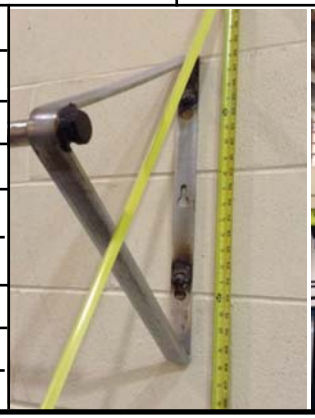

1992	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

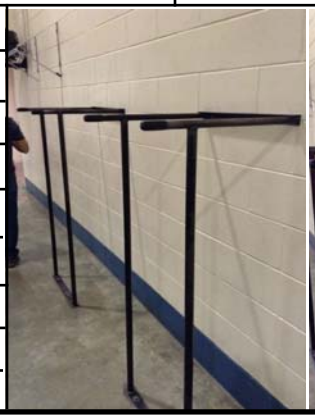

1993	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - D
Location:	
Cost:	500
Duration:	5 hrs

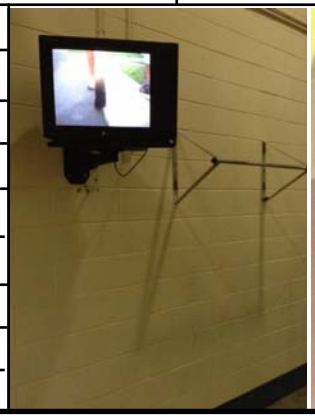

1994	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - D
Location:	
Cost:	1000
Duration:	5 hrs

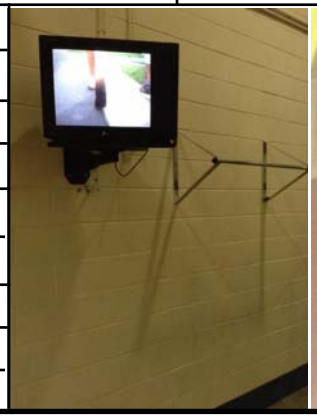

1995	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	6th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

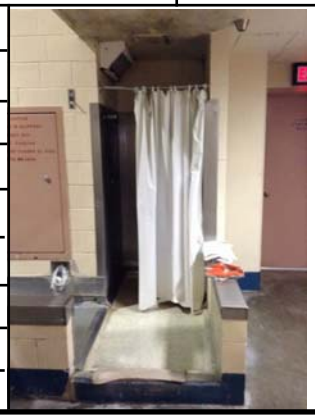

1996	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	6th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1997	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	6th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1998	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	6th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

1999	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	6th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

2000	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

2001	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	6th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

2002	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

2003	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	6th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

2004	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	6th
Room:	Pod - D
Location:	Shower
Cost:	See *7
Duration:	See *7

2005	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	6th
Room:	Pod - D
Location:	
Cost:	N/A
Duration:	N/A

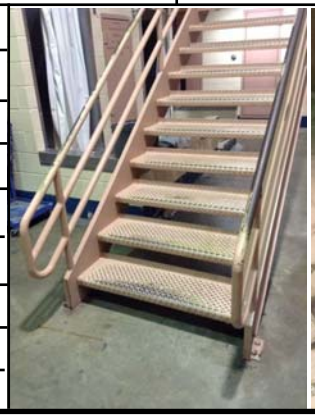

2006	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	6th
Room:	Pod - D
Location:	
Cost:	5000
Duration:	20 hrs

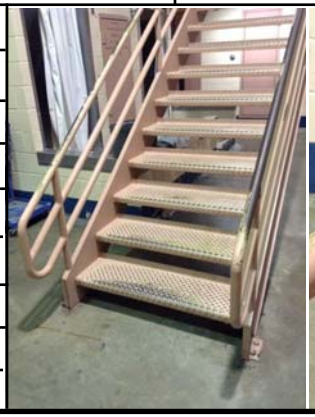

2007	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	6th
Room:	Pod - D
Location:	
Cost:	1500
Duration:	2 hrs

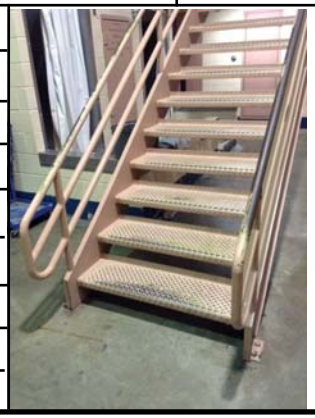

2008	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	6th
Room:	Pod - D
Location:	
Cost:	6000
Duration:	30 hrs

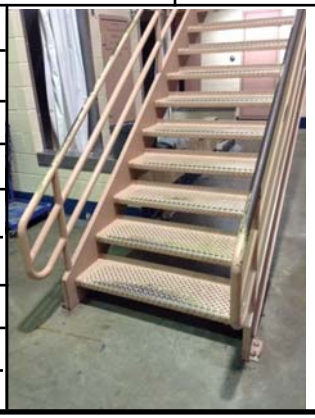

2009	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	6th
Room:	Pod - D
Location:	
Cost:	10000
Duration:	50 hrs

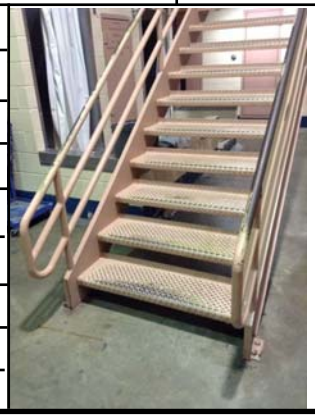

2010	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	6th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

2011	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	6th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

2012	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	6th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

2013	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

2014	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

2015	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

2016	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	6th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

2017	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	6th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

2018	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

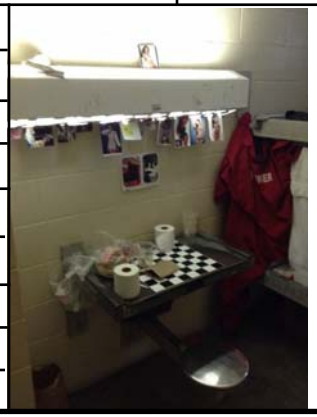

2019	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

2020	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

2021	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - D
Location:	Cell
Cost:	See *9
Duration:	See *9

2022	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	6th
Room:	Pod - D
Location:	
Cost:	See *8
Duration:	See *8

2023	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible 48 Seats	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	See *8
Duration:	See *8

2024	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	See *8
Duration:	See *8

2025	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	See *5
Duration:	See *5

2026	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	200
Duration:	2 hrs

2027	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Minimum 27" high x 8" deep clearance under counter not provided	Provide minimum 27" high X 8" deep clearance under counter

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

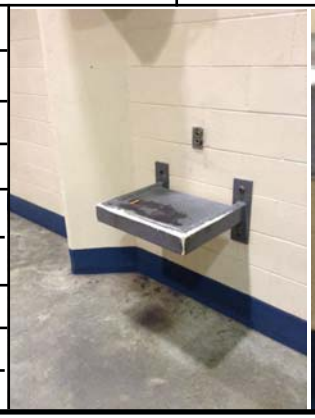

2028	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

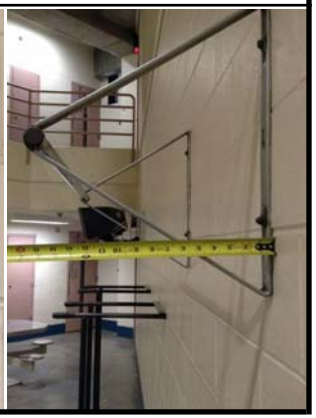

2029	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

2030	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	500
Duration:	5 hrs

2031	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	1000
Duration:	5 hrs

2032	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	6th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

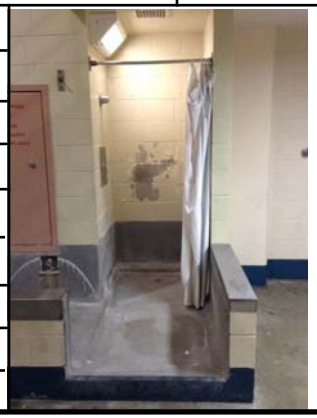

2033	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	6th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

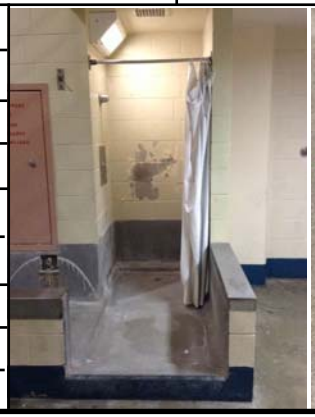

2034	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	6th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

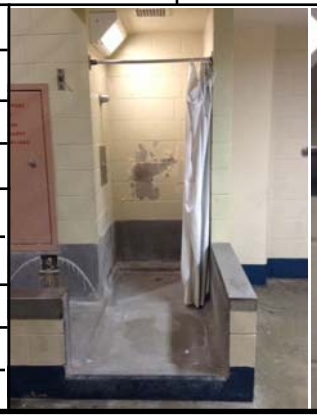

2035	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	6th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

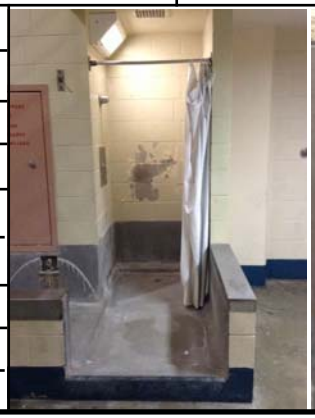

2036	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	6th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

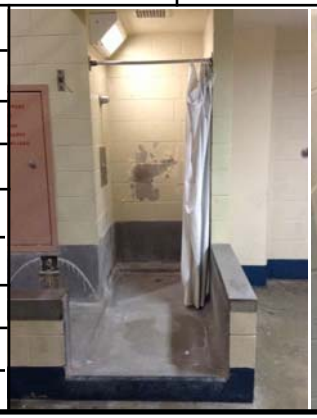

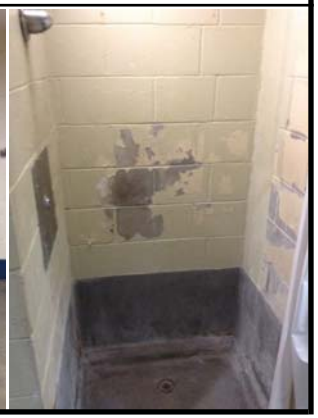

2037	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

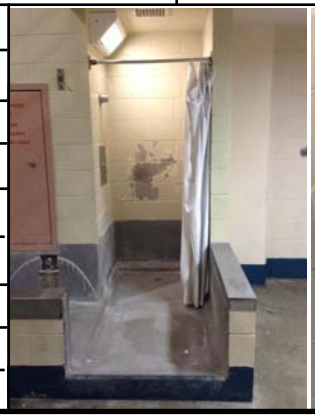

2038	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	6th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

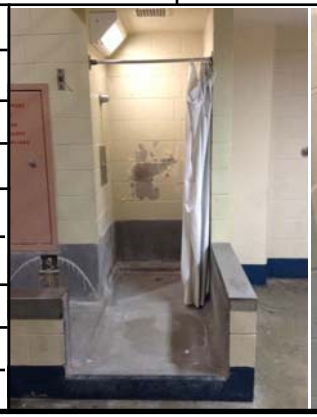

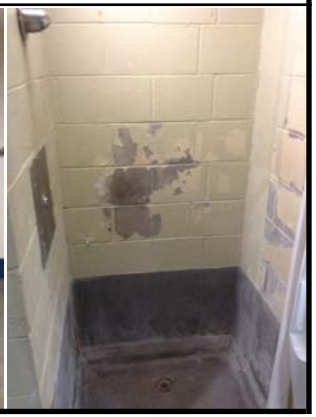

2039	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

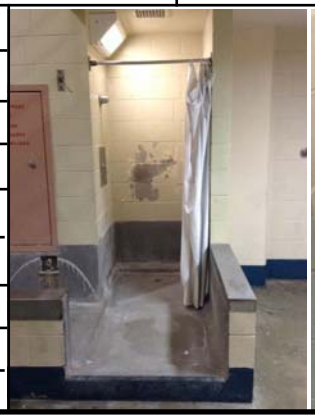

2040	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	6th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

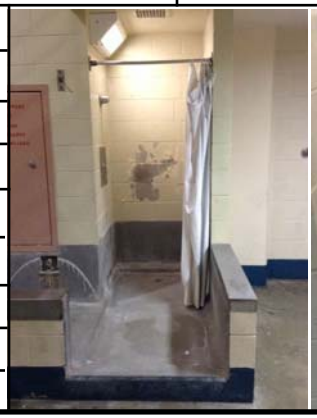

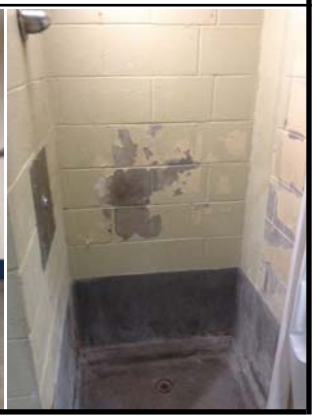

2041	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	6th
Room:	Pod - F
Location:	Shower
Cost:	See *7
Duration:	See *7

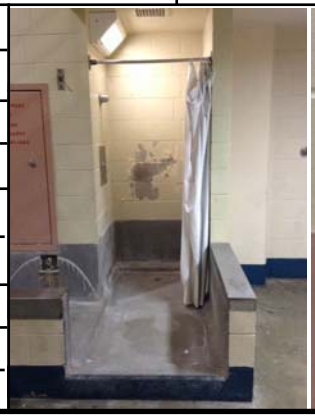

2042	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	N/A
Duration:	N/A

2043	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	5000
Duration:	20 hrs

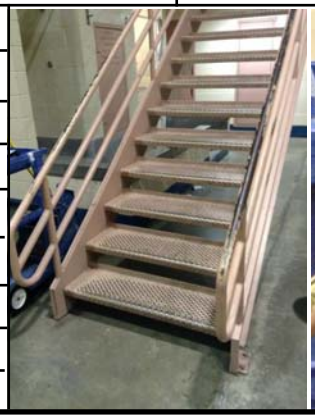

2044	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	6000
Duration:	30 hrs

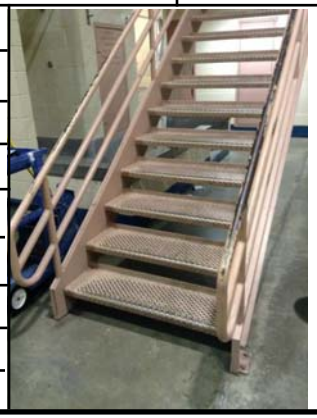

2045	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	1500
Duration:	2 hrs

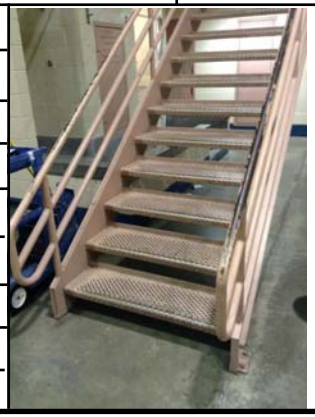

2046	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	10000
Duration:	50 hrs

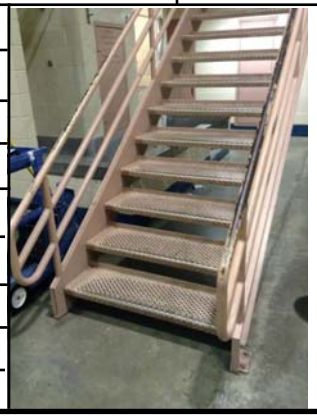

2047	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

2048	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

2049	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

2050	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

2051	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

2052	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

2053	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

2054	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

2055	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

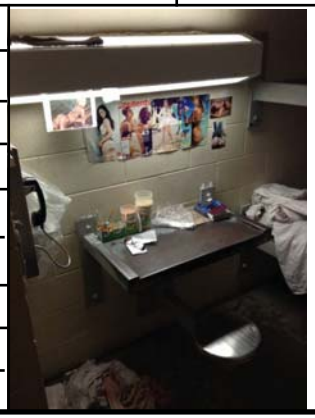

2056	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

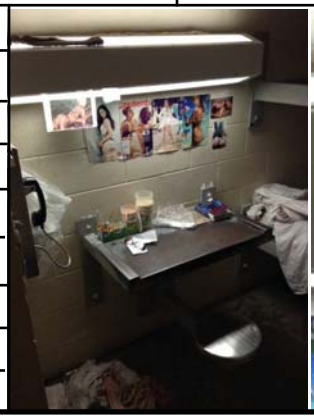

2057	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

2058	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

2059	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - F
Location:	Cell
Cost:	See *9
Duration:	See *9

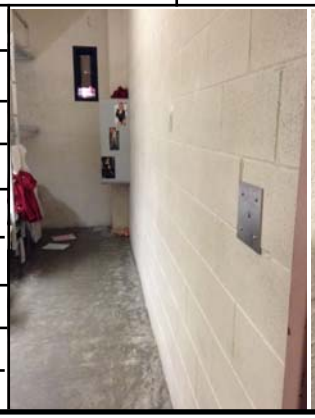

2060	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	6th
Room:	Pod - F
Location:	
Cost:	See *8
Duration:	See *8

2061	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	See *8
Duration:	See *8

2062	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 44" width not provided/where serving occupant load over 10	Provide 44" width

ADA Reference:	
N/A	
CBC Reference:	
11B-403.5.1	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	See *8
Duration:	See *8

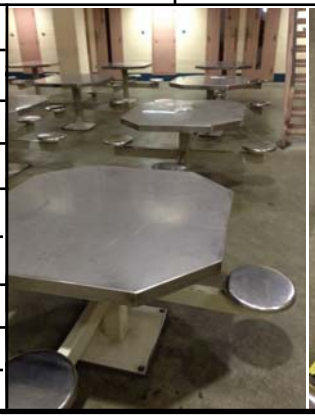

2063	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	See *5
Duration:	See *5

2064	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Minimum 27" high x 8" deep clearance under counter not provided	Provide minimum 27" high X 8" deep clearance under counter

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

2065	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

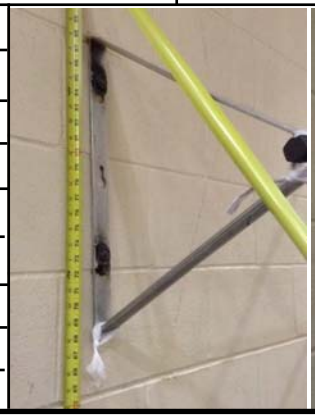
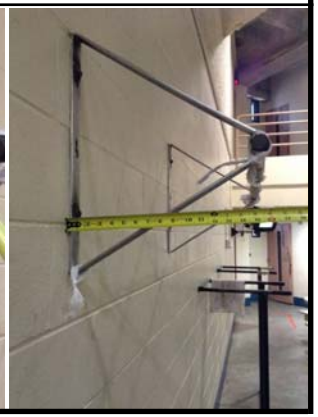

2066	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

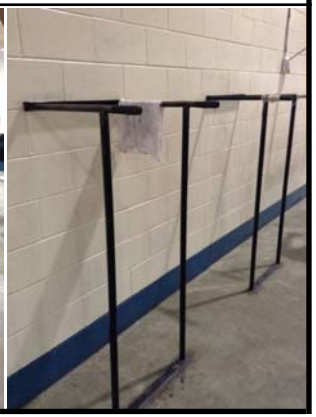

2067	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	500
Duration:	5 hrs

2068	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	1000
Duration:	5 hrs

2069	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	6th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

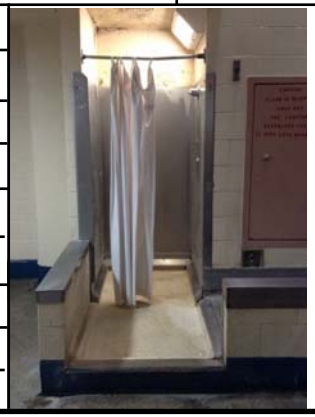

2070	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	6th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

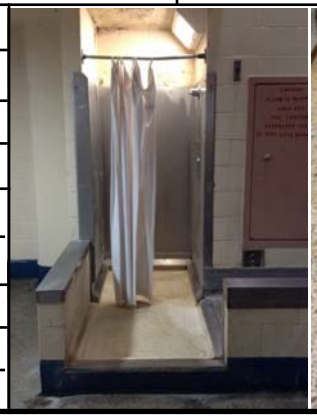

2071	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	6th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

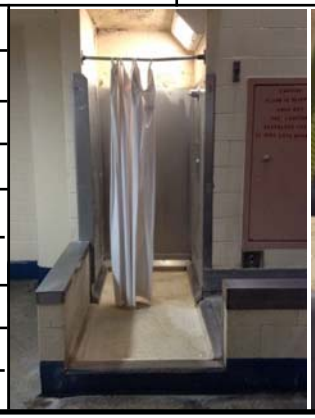

2072	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	6th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

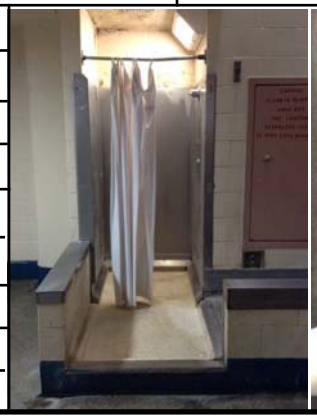

2073	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	6th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

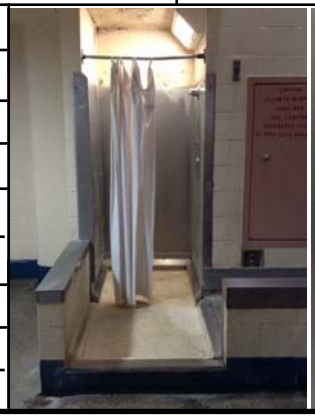

2074	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

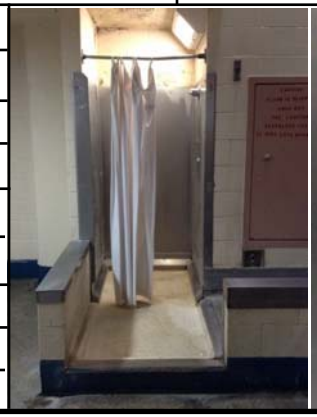

2075	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	6th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

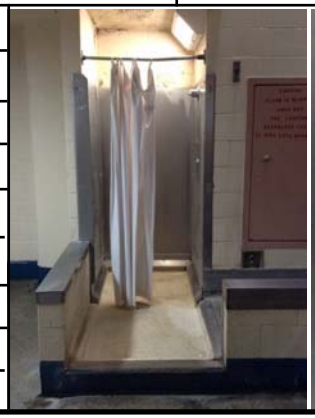

2076	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

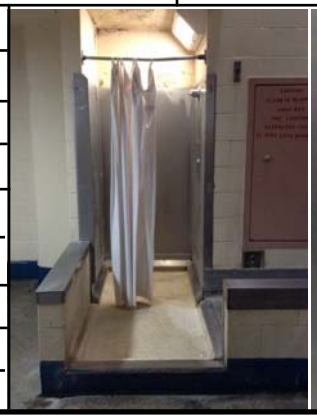

2077	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	6th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

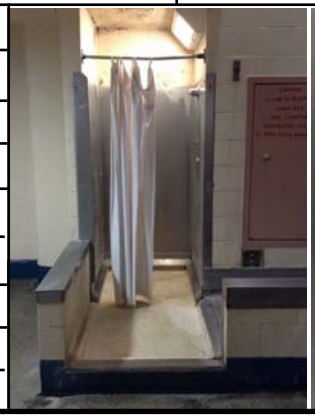

2078	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	6th
Room:	Pod - E
Location:	Shower
Cost:	See *7
Duration:	See *7

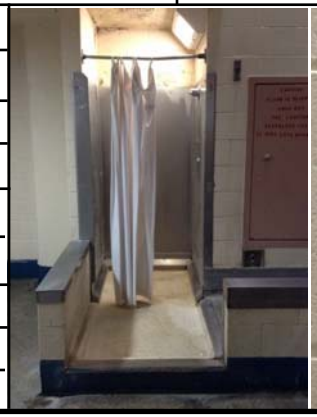

2079	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	N/A
Duration:	N/A

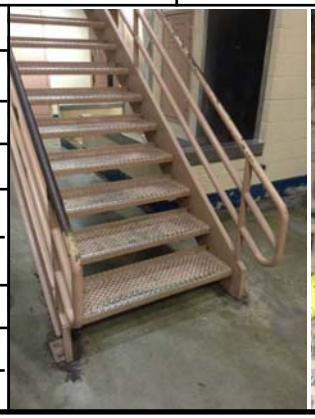

2080	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	5000
Duration:	20 hrs

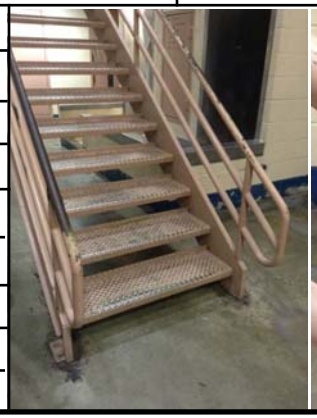

2081	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at bottom of stairs not a minimum of tread width; plus 12" beyond bottom nosing horizontal with ground or floor surface	Modify handrail(s) to provide required extensions or replace per current standards

ADA Reference:	
505.10.3	
CBC Reference:	
11B-505.10.3	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	1500
Duration:	2 hrs

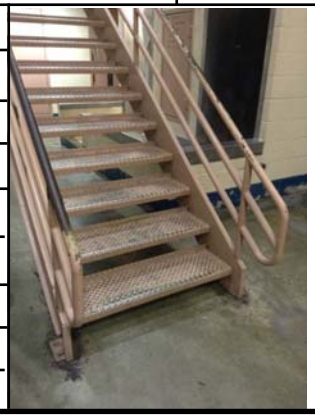

2082	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Open risers provided interior stairways only	Install closer strip at open risers or remove and replace stairs for compliance

ADA Reference:	
504.3	
CBC Reference:	
11B-504.3	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	6000
Duration:	30 hrs

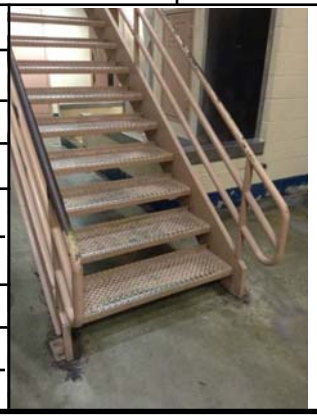

2083	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Vertical clearance not 80" high minimum	Provide required vertical clearance

ADA Reference:	
307.4	
CBC Reference:	
11B-307.4	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	10000
Duration:	50 hrs

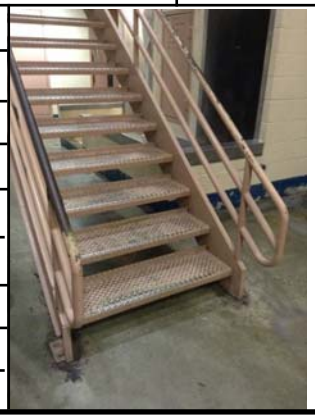

2084	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	6th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

2085	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	6th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

2086	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

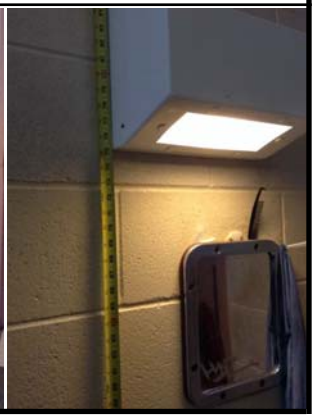

2087	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	6th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

2088	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

2089	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

2090	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	6th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

2091	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	6th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

2092	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

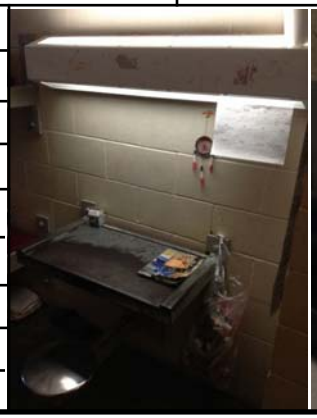

2093	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

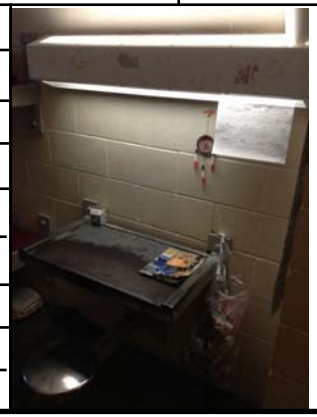

2094	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

2095	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Pod - E
Location:	Cell
Cost:	See *9
Duration:	See *9

2096	Main Annex Jail	**Priority:**	1
Category	Accessible Path of Travel		

Issue	**Recommendation**
Accessible path of travel not provided	Provide accessible path of travel

ADA Reference:	
206.2.2	
CBC Reference:	
11B-206.2.2	
Floor:	6th
Room:	Pod - E
Location:	
Cost:	See *8
Duration:	See *8

2097	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	6th
Room:	Gym
Location:	
Cost:	See *4
Duration:	See *4

2098	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Minimum 17" deep toe clearance under counter not provided	Provide required toe clearance

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Gym
Location:	
Cost:	1000
Duration:	1 hr

2099	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Gym
Location:	
Cost:	See *6
Duration:	See *6

2100	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

2101	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	2000
Duration:	16 hrs

2102	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

2103	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

2104	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

2105	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

2106	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	3000
Duration:	16 hrs

2107	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
Clear floor space not provided for wheelchair accessible telephone	Reconfigure telephone location to provide required clear floor space

ADA Reference:	
704.2.1	
CBC Reference:	
11B-704.2.1	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

2108	Main Annex Jail	**Priority:**	4
Category	Telephones		

Issue	**Recommendation**
At least one TTY not provided in a secured area of a correctional facility if a public phone for detainees is provided	Provide accessible TTY per current standards

ADA Reference:	
217.4.8	
CBC Reference:	
11B-217.4.8	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	See *5
Duration:	See *5

2109	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

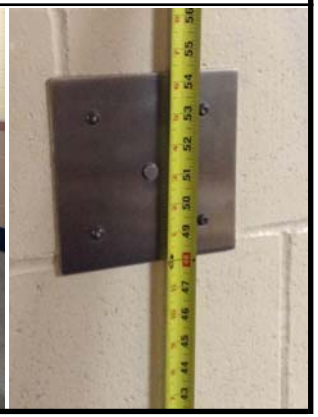

2110	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

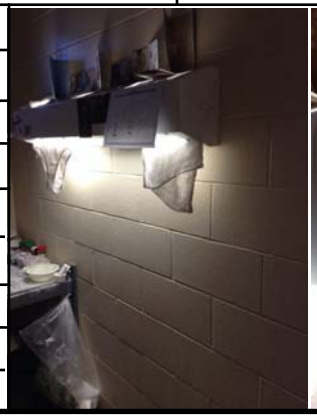

2111	Main Annex Jail	**Priority:**	1
Category	Protruding Objects		

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

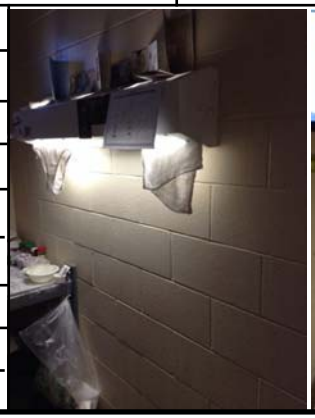

2112	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Required 30" by 48" clear floor space not provided at accessible seating spaces	Provide required clear floor space at accessible seating

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Cell FF
Location:	Cell
Cost:	See *10
Duration:	See *10

2113	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Minimum 32" wide clear width not provided	Provide 32" wide clear width

ADA Reference:	
404.2.3	
CBC Reference:	
11B-404.2.3	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2114	Main Annex Jail	**Priority:**	1
Category	Walks		

Issue	**Recommendation**
Cross slope of walk over 2.083% (1:48)	Remove and replace concrete walk with maximum 2.0% slope cross slope where cross slope exceeds 2.0%

ADA Reference:	
403.3	
CBC Reference:	
11B-403.3	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2115	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Threshold into shower greater than 1/2" height	Provide transition into shower

ADA Reference:	
608.7	
CBC Reference:	
11B-608.7	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2116	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Centerline of water control not 39"-41" above shower floor and top of unit not greater than 48"	Adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-608.5.2	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2117	Main Annex Jail	**Priority:**	2
Category	Detention Facility Accessories		

Issue	**Recommendation**
Coat hook measured over 48" AFF	Reset hook to maximum 48" AFF

ADA Reference:	
603.4	
CBC Reference:	
11B-603.4	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2118	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Shower floor slope greater that 2.083 percent	Provide accessible shower

ADA Reference:	
N/A	
CBC Reference:	
11B-608.9	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2119	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Folding seat not provided	Provide folding seat

ADA Reference:	
N/A	
CBC Reference:	
11B-610.5	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2120	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on back wall for standard or alternate shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2121	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of entry in alternate shower	Adjust as required and/or provide new bar per current standards

ADA Reference:	
608.3.3	
CBC Reference:	
11B-608.3.3	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2122	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Grab bar not provided on side wall opposite of seat in standard shower	Provide new bar per current standards

ADA Reference:	
608.3.2	
CBC Reference:	
11B-608.3.2	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2123	Main Annex Jail	**Priority:**	2
Category	Detention Facility Showers		

Issue	**Recommendation**
Minimum 59" long hose not provided	Provide required hose and/or adjust height per current standards

ADA Reference:	
608.6	
CBC Reference:	
11B-608.6	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2124	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2125	Main Annex Jail	**Priority:**	4
Category	Accessible Clearance		

Issue	**Recommendation**
Required 60" diameter circle or 'T'-shaped clear floor space not provided within room	Provide required clearance

ADA Reference:	
304.3	
CBC Reference:	
11B-304.3	
Floor:	6th
Room:	Cell FF
Location:	Shower
Cost:	See *11
Duration:	See *11

2126	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
At least 5% of total seating is not accessible	Provide accessible seating spaces as required

ADA Reference:	
226.1	
CBC Reference:	
11B-226.1	
Floor:	6th
Room:	Cell FF
Location:	
Cost:	500
Duration:	5 hrs

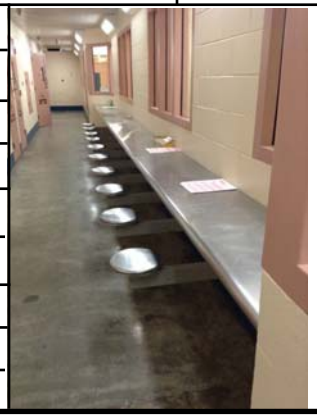

2127	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	6th
Room:	Cell FF
Location:	
Cost:	See *4
Duration:	See *4

2128	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Corridor
Location:	
Cost:	See *6
Duration:	See *6

2129	Main Annex Jail	**Priority:**	1

Category	Protruding Objects

Issue	**Recommendation**
Objects with leading edges more than 27" and no more than 80" AFF shall protrude 4" maximum horizontally into the circulation path	Provide required clearance/adjust as required

ADA Reference:	
307.2	
CBC Reference:	
11B-307.2	
Floor:	6th
Room:	Corridor
Location:	
Cost:	2000
Duration:	8 hrs

2130	Main Annex Jail	**Priority:**	4

Category	Alarms

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	6th
Room:	Corridor
Location:	
Cost:	See *4
Duration:	See *4

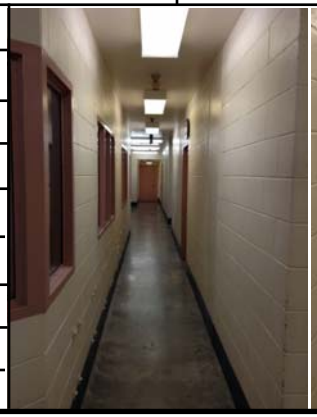

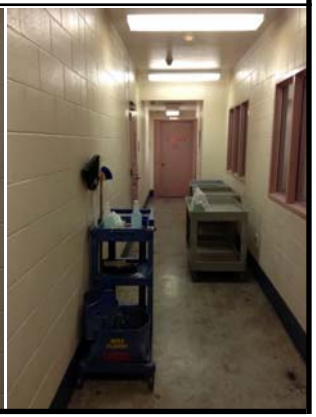

2131	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Conference
Location:	Law Library
Cost:	See *6
Duration:	See *6

2132	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	6th
Room:	Conference
Location:	Law Library
Cost:	500
Duration:	1 hr

2133	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	6th
Room:	Conference
Location:	Law Library
Cost:	See *1
Duration:	See *1

2134	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	6th
Room:	Janitor
Location:	
Cost:	See *1
Duration:	See *1

2135	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	6th
Room:	Janitor
Location:	
Cost:	500
Duration:	1 hr

2136	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Janitor
Location:	
Cost:	See *6
Duration:	See *6

2137	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	6th
Room:	Scullery
Location:	
Cost:	See *2
Duration:	See *2

2138	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	6th
Room:	Scullery
Location:	
Cost:	500
Duration:	1 hr

2139	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	6th
Room:	Scullery
Location:	
Cost:	See *1
Duration:	See *1

2140	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Scullery
Location:	
Cost:	See *6
Duration:	See *6

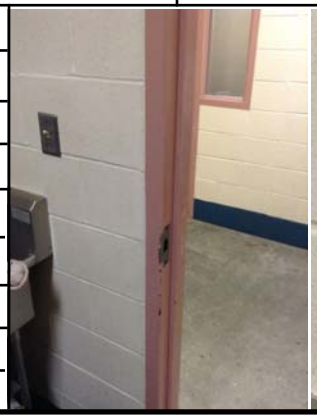

2141	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:
703.3
CBC Reference:
11B-703.3

Floor:	6th
Room:	Storage
Location:	South
Cost:	See *1
Duration:	See *1

2142	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:
404.2.7
CBC Reference:
11B-404.2.7

Floor:	6th
Room:	Storage
Location:	South
Cost:	500
Duration:	1 hr

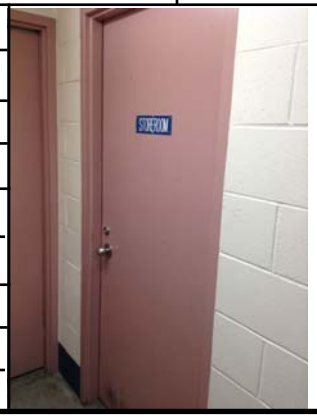

2143	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:
308.2.1
CBC Reference:
11B-308.2.1

Floor:	6th
Room:	Storage
Location:	South
Cost:	See *6
Duration:	See *6

2144	Main Annex Jail	**Priority:**	1

Category	Stairs

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:
N/A
CBC Reference:
1009.4

Floor:	6th
Room:	Stairwell
Location:	South
Cost:	N/A
Duration:	N/A

2145	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	6th
Room:	Stairwell
Location:	South
Cost:	5000
Duration:	20 hrs

2146	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at top stairs not 12" minimum of level distance (parallel with floor) beyond top nosing	Modify handrail(s) to provide required 12" extensions or replace per current standards

ADA Reference:	
505.10.2	
CBC Reference:	
11B-505.10.2	
Floor:	6th
Room:	Stairwell
Location:	South
Cost:	1500
Duration:	2 hrs

2147	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Stairwell
Location:	South
Cost:	See *6
Duration:	See *6

2148	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	See *2
Duration:	See *2

2149	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:
404.2.7
CBC Reference:
11B-404.2.7

Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	500
Duration:	1 hr

2150	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:
703.3
CBC Reference:
11B-703.3

Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	See *1
Duration:	See *1

2151	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:
308.2.1
CBC Reference:
11B-308.2.1

Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	See *6
Duration:	See *6

2152	Main Annex Jail	**Priority:**	2

Category	Operable parts

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:
309.4
CBC Reference:
11B-309.4

Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hr

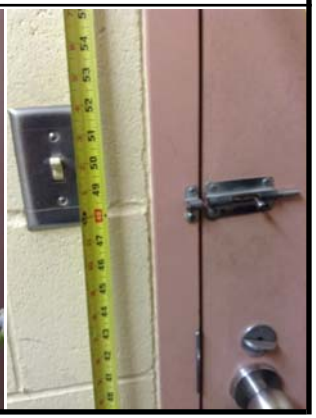

2153	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	16 hrs

2154	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Flush controls not on open side of fixture (non-ambulatory accessible compartments)	Remove and replace water closet per current standards

ADA Reference:	
604.6	
CBC Reference:	
11B-604.6	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	2000
Duration:	16 hrs

2155	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	300
Duration:	1.5

2156	Main Annex Jail	**Priority:**	3
Category	Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	300
Duration:	1.5

2157	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

2158	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser not located min. 7" from edge of toilet	Relocate TPD with 7" minimum from edge of toilet

ADA Reference:	
604.7	
CBC Reference:	
11B-604.7	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

2159	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide assistance placard

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

2160	Main Annex Jail	**Priority:**	2
Category	Operable parts		

Issue	**Recommendation**
Operable part requires tight grasping, pinching or twisting of the wrist	Remove and replace operable part

ADA Reference:	
309.4	
CBC Reference:	
11B-309.4	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	500
Duration:	1 hr

2161	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.25 hrs

2162	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

2163	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror over lavatory or countertop measured over 40" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 40" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	100
Duration:	1 hr

2164	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	6th
Room:	Staff Restroom
Location:	
Cost:	50
Duration:	.5 hrs

2165	Main Annex Jail	**Priority:**	1

Category	Interior Signage

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	6th
Room:	Storage
Location:	North
Cost:	See *1
Duration:	See *1

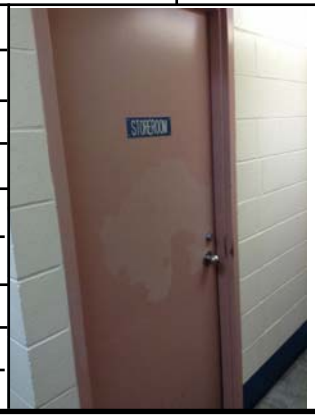

2166	Main Annex Jail	**Priority:**	1

Category	Doors / Gates

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	6th
Room:	Storage
Location:	North
Cost:	500
Duration:	1 hr

2167	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Storage
Location:	North
Cost:	See *6
Duration:	See *6

2168	Main Annex Jail	**Priority:**	1

Category	Stairs

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	6th
Room:	Stairwell
Location:	North
Cost:	N/A
Duration:	N/A

2169	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	6th
Room:	Stairwell
Location:	North
Cost:	5000
Duration:	20 hrs

2170	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Stairwell
Location:	North
Cost:	See *6
Duration:	See *6

2171	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	6th
Room:	Conference
Location:	
Cost:	See *2
Duration:	See *2

2172	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	6th
Room:	Conference
Location:	
Cost:	500
Duration:	1 hr

2173	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	6th
Room:	Conference
Location:	
Cost:	See *1
Duration:	See *1

2174	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Conference
Location:	
Cost:	See *6
Duration:	See *6

2175	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	See *2
Duration:	See *2

2176	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	See *1
Duration:	See *1

2177	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	500
Duration:	1 hr

2178	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

2179	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

2180	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

2181	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Lettering height on sign over 40"-70" AFF (to bottom) not 5/8" minimum	Remove and replace sign per current standards

ADA Reference:	
703.5.5	
CBC Reference:	
11B-703.5.5	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	See *1
Duration:	See *1

2182	Main Annex Jail	**Priority:**	4
Category	Sinks (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate piping as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	50
Duration:	.25 hrs

2183	Main Annex Jail	**Priority:**	4
Category	Sinks (ADULT)		

Issue	**Recommendation**
Height of rim or counter measured over 34" AFF	Reset sink/or provide maximum 34" AFF counter

ADA Reference:	
606.3	
CBC Reference:	
11B-606.3	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	1000
Duration:	8 hrs

2184	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide assistance placard

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	50
Duration:	.5 hrs

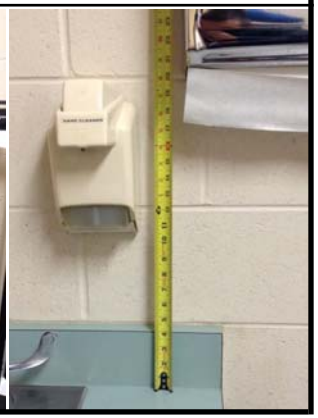

2185	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	500
Duration:	1 hr

2186	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Room identification sign not provided in Braille	Provide sign per current standards

ADA Reference:	
703.3	
CBC Reference:	
11B-703.3	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	See *1
Duration:	See *1

2187	Main Annex Jail	**Priority:**	1
Category	Interior Signage		

Issue	**Recommendation**
Unisex toilet door sign not 1/4" thick of contrasting circle and triangle symbols with the circle circumscribing the triangle	Provide sign per current standards

ADA Reference:	
N/A	
CBC Reference:	
11B-703.7.2.6.3	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	See *1
Duration:	See *1

2188	Main Annex Jail	**Priority:**	3
Category	Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	6th
Room:	Infirmary
Location:	Restroom
Cost:	2000
Duration:	16 hrs

2189	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet paper dispenser not located on sidewall below grab bar	Relocate TPD below sidewall grab bar

ADA Reference:	
N/A	
CBC Reference:	
11B-604.7	
Floor:	6th
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.5 hrs

2190	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Toilet seat dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	6th
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.5 hrs

2191	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Soap dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	6th
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.5 hrs

2192	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Mirror (not over lavatory) measured over 35" AFF to the bottom edge of the reflecting surface	Reset mirror to maximum 35" AFF to reflecting surface

ADA Reference:	
603.3	
CBC Reference:	
11B-603.3	
Floor:	6th
Room:	Infirmary
Location:	Restroom
Cost:	100
Duration:	1 hr

2193	Main Annex Jail	**Priority:**	3
Category	Accessories		

Issue	**Recommendation**
Towel dispenser measured over 40" AFF to operable part	Reset accessories to maximum 40" AFF to operating controls

ADA Reference:	
N/A	
CBC Reference:	
11B-603.5	
Floor:	6th
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.5 hrs

2194	Main Annex Jail	**Priority:**	3
Category	Lavatories (GENERAL)		

Issue	**Recommendation**
Drain and/or hot water piping not insulated (wrapped)	Insulate as required to protect against contact

ADA Reference:	
606.5	
CBC Reference:	
11B-606.5	
Floor:	6th
Room:	Infirmary
Location:	Restroom
Cost:	50
Duration:	.25 hrs

2195	Main Annex Jail	**Priority:**	4
Category	Accessible Clearance		

Issue	**Recommendation**
Required 60" diameter circle or 'T'-shaped clear floor space not provided within room	Provide required clearance

ADA Reference:	
304.3	
CBC Reference:	
11B-304.3	
Floor:	6th
Room:	Infirmary
Location:	Restroom
Cost:	10000
Duration:	50 hrs

2196	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

2197	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

2198	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Switch measured over 48" AFF / measure to top of switch box	Provide occupancy room sensor or lower switch

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	See *6
Duration:	See *6

2199	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Door requires over 5 lbs force to open	Adjust closing device

ADA Reference:	
404.2.9	
CBC Reference:	
11B-404.2.9	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	See *2
Duration:	See *2

2200	Main Annex Jail	**Priority:**	1
Category	Doors / Gates		

Issue	**Recommendation**
Lever-type hardware not provided	Remove and replace with lever-type hardware

ADA Reference:	
404.2.7	
CBC Reference:	
11B-404.2.7	
Floor:	6th
Room:	Infirmary
Location:	
Cost:	500
Duration:	1 hr

2201	Main Annex Jail	**Priority:**	4
Category	Alarms		

Issue	**Recommendation**
Audible Fire Alarm not provided in public or common use areas	Provide audible and visual fire alarm per current standards

ADA Reference:	
215.2	
CBC Reference:	
11B-215.2	
Floor:	6th
Room:	Classroom
Location:	
Cost:	See *4
Duration:	See *4

2202	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	6th
Room:	Classroom
Location:	
Cost:	See *6
Duration:	See *6

2203	Main Annex Jail	**Priority:**	2
Category	Dining/Bar Facilities		

Issue	**Recommendation**
Minimum 27" high x 8" deep clearance under counter not provided	Provide minimum 27" high X 8" deep clearance under counter

ADA Reference:	
902.2	
CBC Reference:	
11B-902.2	
Floor:	6th
Room:	Classroom
Location:	
Cost:	1000
Duration:	1 hr

2204	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
50% of all drinking fountains are not standing accessible	Install for standing persons drinking fountain(s)

ADA Reference:	
211.3	
CBC Reference:	
11B-211.3	
Floor:	6th
Room:	Corridor
Location:	
Cost:	2000
Duration:	8 hrs

2205	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
Knee clearance space under drinking fountain not provided/8" deep at 27" tall and 11" deep at 9" tall and 30" wide	Reset fountain for compliance; replace if required

ADA Reference:	
602.2	
CBC Reference:	
11B-602.2	
Floor:	6th
Room:	Corridor
Location:	
Cost:	1000
Duration:	8 hrs

2206	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	Roof
Room:	Yard
Location:	
Cost:	3000
Duration:	16 hrs

2207	Main Annex Jail	**Priority:**	2
Category	Detention Facility Urinals		

Issue	**Recommendation**
Urinal rim measured over 17" AFF	Adjust as required

ADA Reference:	
605.2	
CBC Reference:	
11B-605.2	
Floor:	Roof
Room:	Yard
Location:	
Cost:	2000
Duration:	10 hrs

2208	Main Annex Jail	**Priority:**	1
Category	Corridors/Hallways		

Issue	**Recommendation**
Minimum 36" clear width not provided/where serving occupant load less than 10	Provide 36" clear width

ADA Reference:	
403.5.1	
CBC Reference:	
11B-403.5.1	
Floor:	Roof
Room:	Yard
Location:	
Cost:	2000
Duration:	8 hrs

2209	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	Roof
Room:	Yard
Location:	
Cost:	2000
Duration:	16 hrs

2210	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Centerline of toilet not 17"-18" from sidewall or partition in wheel chair accessible toilet compartment	Relocate/adjust as required

ADA Reference:	
N/A	
CBC Reference:	
11B-604.2	
Floor:	Roof
Room:	Yard
Location:	
Cost:	2000
Duration:	16 hrs

2211	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on rear wall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	Roof
Room:	Yard
Location:	
Cost:	800
Duration:	1 hr

2212	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Grab bars not provided on sidewall	Provide required grab bar

ADA Reference:	
604.5	
CBC Reference:	
11B-604.5	
Floor:	Roof
Room:	Yard
Location:	
Cost:	800
Duration:	1 hr

2213	Main Annex Jail	**Priority:**	4
Category	Drinking Fountains		

Issue	**Recommendation**
50% of all drinking fountains are not wheel chair accessible	Install wheel chair accessible drinking fountain(s)

ADA Reference:	
211.3	
CBC Reference:	
11B-211.3	
Floor:	Roof
Room:	Yard
Location:	
Cost:	2000
Duration:	8 hrs

2214	Main Annex Jail	**Priority:**	3
Category	Lavatories (ADULT)		

Issue	**Recommendation**
Minimum 29" clearance under lavatory apron not provided (measured at front edge)	Reset lavatory as required

ADA Reference:	
N/A	
CBC Reference:	
11B-606.2	
Floor:	Roof
Room:	Yard
Location:	Open for 2nd
Cost:	3000
Duration:	16 hrs

2215	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (ADULT)		

Issue	**Recommendation**
Seat height measured less than 17" AFF	Provide water closet per current standards

ADA Reference:	
604.4	
CBC Reference:	
11B-604.4	
Floor:	Roof
Room:	Yard
Location:	Open for 2nd
Cost:	2000
Duration:	16 hrs

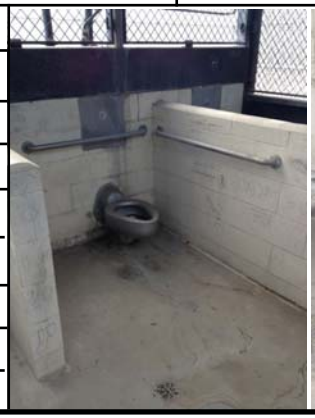

2216	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Sidewall grab bar minimum extension 54" from rear wall	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.1	
CBC Reference:	
11B-604.5.1	
Floor:	Roof
Room:	Yard
Location:	Open for 2nd
Cost:	500
Duration:	1 hr

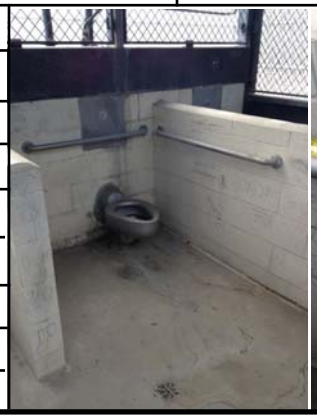

2217	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Rear wall grab bar not 24" minimum length from C/L of toilet towards open side	Adjust as required and/or provide new bar per current standards

ADA Reference:	
604.5.2	
CBC Reference:	
11B-604.5.2	
Floor:	Roof
Room:	Yard
Location:	Open for 2nd
Cost:	500
Duration:	1 hr

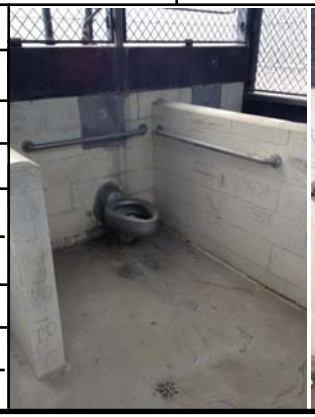

2218	Main Annex Jail	**Priority:**	2
Category	Detention Facility Water Closets (GENERAL)		

Issue	**Recommendation**
Water closet clearance not 60" wide measured perpendicular from the side wall	Provide required clearance or provide alternative accessible water closet

ADA Reference:	
604.3.1	
CBC Reference:	
11B-604.3.1	
Floor:	Roof
Room:	Yard
Location:	Open for 2nd
Cost:	8000
Duration:	40 hrs

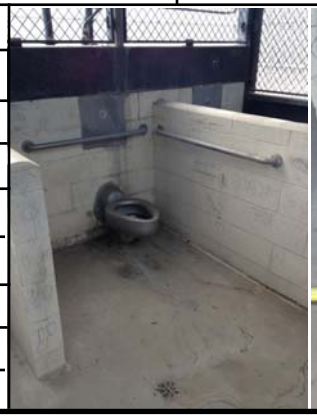

2219	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at top stairs not 12" minimum of level distance (parallel with floor) beyond top nosing	Modify handrail(s) to provide required 12" extensions or replace per current standards

ADA Reference:	
505.10.2	
CBC Reference:	
11B-505.10.2	
Floor:	Roof
Room:	Stairwell
Location:	South
Cost:	1500
Duration:	2 hrs

2220	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	Roof
Room:	Stairwell
Location:	South
Cost:	N/A
Duration:	N/A

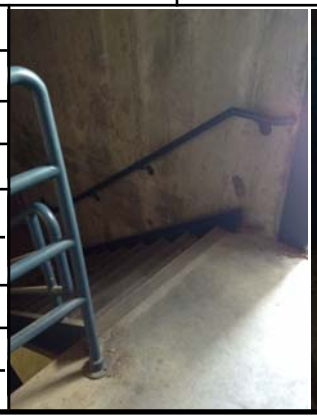

2221	Main Annex Jail	**Priority:**	1

Category	Stairs

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	Roof
Room:	Stairwell
Location:	South
Cost:	5000
Duration:	20 hrs

2222	Main Annex Jail	**Priority:**	2

Category	Reach Range

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	Roof
Room:	Stairwell
Location:	South
Cost:	See *6
Duration:	See *6

2223	Main Annex Jail	**Priority:**	1

Category	Stairs

Issue	**Recommendation**
Width of stairs not 44" minimum	Provide stairs with minimum 44" width

ADA Reference:	
N/A	
CBC Reference:	
1009.4	
Floor:	Roof
Room:	Stairwell
Location:	North
Cost:	N/A
Duration:	N/A

2224	Main Annex Jail	**Priority:**	1

Category	Stairs

Issue	**Recommendation**
Height of handrail(s) less than 34" above nosing of threads	Provide handrails per current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	Roof
Room:	Stairwell
Location:	North
Cost:	5000
Duration:	20 hrs

2225	Main Annex Jail	**Priority:**	1
Category	Stairs		

Issue	**Recommendation**
Extension of handrail at top stairs not 12" minimum of level distance (parallel with floor) beyond top nosing	Modify handrail(s) to provide required 12" extensions or replace per current standards

ADA Reference:	
505.10.2	
CBC Reference:	
11B-505.10.2	
Floor:	Roof
Room:	Stairwell
Location:	North
Cost:	1500
Duration:	2 hrs

2226	Main Annex Jail	**Priority:**	2
Category	Reach Range		

Issue	**Recommendation**
Maximum 48" AFF reach range exceeded /(forward unobstructed reach, 10" maximum reach depth)	Provide required reach range

ADA Reference:	
308.2.1	
CBC Reference:	
11B-308.2.1	
Floor:	Roof
Room:	Stairwell
Location:	North
Cost:	See *6
Duration:	See *6

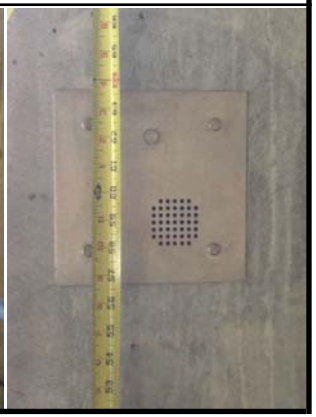

2227	Main Annex Jail	**Priority:**	1
Category	Pedestrian Ramps		

Issue	**Recommendation**
Slope of top landing exceeds 2.083% (1:48) in all directions	Provide landing with maximum 2.0% slope in all directions

ADA Reference:	
405.7.1	
CBC Reference:	
11B-405.7.1	
Floor:	Outdoor
Room:	
Location:	M Street
Cost:	6000
Duration:	30 hrs

2228	Main Annex Jail	**Priority:**	1
Category	Pedestrian Ramps		

Issue	**Recommendation**
Extension of handrail at top of ramp not 12" minimum of level distance beyond ramp	Provide handrails to current standards with required extensions

ADA Reference:	
505.10.1	
CBC Reference:	
11B-505.10.1	
Floor:	Outdoor
Room:	
Location:	M Street
Cost:	1500
Duration:	8 hrs

2229	Main Annex Jail	**Priority:**	1
Category	Pedestrian Ramps		

Issue	**Recommendation**
Handrail(s) not continuous for full length of ramp	Remove and replace handrails to current standards

ADA Reference:	
505.3	
CBC Reference:	
11B-505.3	
Floor:	Outdoor
Room:	
Location:	M Street
Cost:	5000
Duration:	25 hrs

2230	Main Annex Jail	**Priority:**	1
Category	Pedestrian Ramps		

Issue	**Recommendation**
Directional slope of ramp exceeds 8.33%	Provide ramp per current standards

ADA Reference:	
405.2	
CBC Reference:	
11B-405.2	
Floor:	Outdoor
Room:	
Location:	M Street
Cost:	15000
Duration:	80 hrs

2231	Main Annex Jail	**Priority:**	1
Category	Pedestrian Ramps		

Issue	**Recommendation**
Directional slope of ramp exceeds 8.33%	Provide ramp per current standards

ADA Reference:	
405.2	
CBC Reference:	
11B-405.2	
Floor:	Outdoor
Room:	
Location:	M Street
Cost:	15000
Duration:	80 hrs

2232	Main Annex Jail	**Priority:**	1
Category	Pedestrian Ramps		

Issue	**Recommendation**
Extension of handrail at bottom of ramp not 12" minimum of level distance beyond ramp	Provide handrails to current standards with required extensions

ADA Reference:	
505.10.1	
CBC Reference:	
11B-505.10.1	
Floor:	Outdoor
Room:	
Location:	M Street
Cost:	1500
Duration:	8 hrs

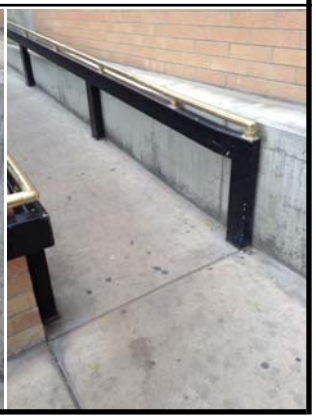

2233	Main Annex Jail	**Priority:**	1
Category	Pedestrian Ramps		

Issue	**Recommendation**
Height of handrail(s) less than 34" to top (above ramp surface)	Provide handrails to current standards

ADA Reference:	
505.4	
CBC Reference:	
11B-505.4	
Floor:	Outdoor
Room:	
Location:	M Street
Cost:	5000
Duration:	25 hrs